

AMERICAN NATIONAL STANDARD

SAMPLING PROCEDURES AND TABLES FOR INSPECTION BY ATTRIBUTES



AMERICAN SOCIETY FOR QUALITY
600 NORTH PLANKINTON AVENUE
MILWAUKEE, WISCONSIN 53203

AMERICAN NATIONAL STANDARD

Sampling Procedures and Tables for Inspection by Attributes

Prepared by
The Statistics Subcommittee of the Accredited
Standards Committee Z1 on Quality, Environment,
Dependability and Statistics

Secretariat
American Society for Quality

Abstract

Sampling Procedures and Tables for Inspection by Attributes is an acceptance sampling system to be used with switching rules on a continuing stream of lots for AQL specified. It provides tightened, normal, and reduced plans to be applied for attributes inspection for percent nonconforming or nonconformities per 100 units.

AMERICAN NATIONAL STANDARD: An American national Standard implies a consensus of those substantially concerned with its scope and provisions. An American National Standard is intended as a guide to aid the manufacturer, the consumer, and the general public. The existence of an American National Standard does not in any respect preclude anyone, whether he has approved the standard or not, from manufacturing, marketing, purchasing, or using products, processes, or procedures not conforming to the standard. American National Standards are subject to periodic review and users are cautioned to obtain the latest editions.

CAUTION NOTICE: This American National Standard may be revised or withdrawn at any time. The procedures of the American National Standards Institute require that action be taken to reaffirm, revise, or withdraw this standard no later than five years from the date of publication. Purchasers of American National Standards may receive current information on all standards by calling or writing the American National Standards Institute.



Quality Press
600 N. Plankinton Avenue
Milwaukee, Wisconsin 53203
Call toll free 800-248-1946
Fax 414-272-1734
www.asq.org
<http://qualitypress.asq.org>
<http://standardsgroup.asq.org>
E-mail: authors@asq.org

Published by

**AMERICAN SOCIETY FOR QUALITY
600 NORTH PLANKINTON
MILWAUKEE, WISCONSIN 53203**

© 2003 by the AMERICAN SOCIETY FOR QUALITY

No part of this publication may be reproduced in any form, in an electronic retrieval system or otherwise, without the prior written permission of the publisher.

Printed in the United States of America

Foreword

(This foreword is not a part of the American National Standard—*Sampling Procedures and Tables for Inspection by Attributes*, Z1.4-2003)

This standard is a revision of ANSI/ASQC Z1.4-1993, “Sampling Procedures and Tables for Inspection by Attributes.” Beyond editorial refinements, only the following eight changes have been made:

- 1) Acceptable Quality Level (AQL) has been changed to Acceptance Quality Limit (AQL). See Clause 4.
- 2) The definition and explanation of AQL have been changed. See Clauses 4.2 and 4.3.
- 3) The Discontinuation of Inspection rule has been changed. See Clause 8.4.
- 4) ANSI/ASQC A2-1987 has been changed to ANSI/ASQ A3534-2-1993. See Clauses 2 and 7.2.
- 5) ANSI/ASQC Q3 has been changed to ASQC Q3-1988. See Clause 11.6.3.

6) The connected arrows in Table II-A, III-A, III-C, IV-A, and IV-C have been separated.

7) In Tables III-A, III-B, and III-C and for clarification of instructions, the * footnote has changed and the + footnote added.

8) In Tables IV-A, IV-B, and IV-C and for clarification of instructions, the footnotes * and ++ have changed and the footnote ## added.

Note 1: Other than 3), 7), and 8) above, all tables, table numbers and procedures used in MIL-STD-105E (which was cancelled in 1995) have been retained.

Note 2: A compatible and interchangeable standard for variables inspection is ANSI/ASQC Z1.9-2003.

Suggestions for improvement of this standard are welcomed. Send your comments to the sponsor, ASQ, 600 North Plankinton Avenue, Milwaukee, WI 53203.

(This page intentionally left blank)

Table of Contents

Paragraph	Page
1. SCOPE	1
2. DEFINITIONS AND TERMINOLOGY	1
3. PERCENT NONCONFORMING AND NONCONFORMITIES PER HUNDRED UNITS	2
4. ACCEPTANCE QUALITY LIMIT (AQL)	2
5. SUBMISSION OF PRODUCT	3
6. ACCEPTANCE AND NON-ACCEPTANCE.	3
7. DRAWING OF SAMPLES	4
8. NORMAL, TIGHTENED, AND REDUCED INSPECTION.	4
9. SAMPLING PLANS.	5
10. DETERMINATION OF ACCEPTABILITY	6
11. SUPPLEMENTARY INFORMATION	6

Tables

Table I	Sample Size Code Letters.	10
Table II-A	Single Sampling Plans for Normal Inspection (Master Table).	11
Table II-B	Single Sampling Plans for Tightened Inspection (Master Table).	12
Table II-C	Single Sampling Plans for Reduced Inspection (Master Table).	13
Table III-A	Doubling Sampling Plans for Normal Inspection (Master Table)	14
Table III-B	Doubling Sampling Plans for Tightened Inspection (Master Table)	15
Table III-C	Doubling Sampling Plans for Reduced Inspection (Master Table).	16
Table IV-A	Multiple Sampling Plans for Normal Inspection (Master Table)	17
Table IV-B	Multiple Sampling Plans for Tightened Inspection (Master Table)	19
Table IV-C	Multiple Sampling Plans for Reduced Inspection (Master Table)	21
Table V-A	Factors for Determining Approximate Values for Average Outgoing Quality Limits for Normal Inspection (Single Sampling)	23
Table V-B	Factors for Determining Approximate Values for Average Outgoing Quality Limits for Tightened Inspection (Single Sampling)	24
Table VI-A	Limiting Quality (in percent nonconforming) for Which $P_a = 10$ Percent (for Normal Inspection, Single Sampling)	25
Table VI-B	Limiting Quality (in nonconformities per hundred units) for Which $P_a = 10$ Percent (for Normal Inspection, Single Sampling)	26
Table VII-A	Limiting Quality (in percent nonconforming) for Which $P_a = 5$ Percent (for Normal Inspection, Single Sampling)	27
Table VII-B	Limiting Quality (in nonconformities per hundred units) for Which $P_a = 5$ Percent (for Normal Inspection, Single Sampling)	28
Table VIII	Limit Numbers for Reduced Inspection	29
Table IX	Average Sample Size Curves for Double and Multiple Sampling Plans (normal and tightened inspection).	30
Table X-A	Sample Size Code Letter A—Individual Plans	31
Table X-B	Sample Size Code Letter B—Individual Plans	33
Table X-C	Sample Size Code Letter C—Individual Plans	35

Table X-D	Sample Size Code Letter D—Individual Plans	37
Table X-E	Sample Size Code Letter E—Individual Plans	39
Table X-F	Sample Size Code Letter F—Individual Plans	41
Table X-G	Sample Size Code Letter G—Individual Plans	43
Table X-H	Sample Size Code Letter H—Individual Plans	45
Table X-J	Sample Size Code Letter J—Individual Plans	47
Table X-K	Sample Size Code Letter K—Individual Plans	49
Table X-L	Sample Size Code Letter L—Individual Plans	51
Table X-M	Sample Size Code Letter M—Individual Plans	53
Table X-N	Sample Size Code Letter N—Individual Plans	55
Table X-P	Sample Size Code Letter P—Individual Plans	57
Table X-Q	Sample Size Code Letter Q—Individual Plans	59
Table X-R	Sample Size Code Letter R—Individual Plans	61
Table X-S	Sample Size Code Letter S—Individual Plans	63
Table XI	Average Outgoing Quality Limit Factors for ANSI-Z1.4 Scheme Performance (Single Sampling)	64
Table XII	Limiting Quality for ANSI-Z1.4 Scheme Performance for Which $P_a = 10$ Percent (Single Sampling)	65
Table XIII	Limiting Quality for ANSI-Z1.4 Scheme Performance for Which $P_a = 5$ Percent (Single Sampling)	66
Table XIV	Average Sample Size Tables for ANSI-Z1.4 Scheme Performance (Single Sampling)	67
Table XV-A	Sample Size Code Letter A—Scheme Performance	71
Table XV-B	Sample Size Code Letter B—Scheme Performance	72
Table XV-C	Sample Size Code Letter C—Scheme Performance	73
Table XV-D	Sample Size Code Letter D—Scheme Performance	74
Table XV-E	Sample Size Code Letter E—Scheme Performance	75
Table XV-F	Sample Size Code Letter F—Scheme Performance	76
Table XV-G	Sample Size Code Letter G—Scheme Performance	77
Table XV-H	Sample Size Code Letter H—Scheme Performance	78
Table XV-J	Sample Size Code Letter J—Scheme Performance	79
Table XV-K	Sample Size Code Letter K—Scheme Performance	80
Table XV-L	Sample Size Code Letter L—Scheme Performance	81
Table XV-M	Sample Size Code Letter M—Scheme Performance	82
Table XV-N	Sample Size Code Letter N—Scheme Performance	83
Table XV-P	Sample Size Code Letter P—Scheme Performance	84
Table XV-Q	Sample Size Code Letter Q—Scheme Performance	85
Table XV-R	Sample Size Code Letter R—Scheme Performance	86
INDEX OF TERMS WITH SPECIAL MEANINGS		87

SAMPLING PROCEDURES AND TABLES FOR INSPECTION BY ATTRIBUTES

1. SCOPE

1.1 PURPOSE. This publication establishes sampling plans and procedures for inspection by attributes. When specified by the responsible authority, this publication shall be referenced in the specification, contract, inspection instructions, or other documents and the provisions set forth herein shall govern. The “responsible authority” shall be designated in one of the above documents, as agreed to by the purchaser and seller or producer and user.

1.2 APPLICATION. Sampling plans designated in this publication are applicable, but not limited, to inspection of the following:

- a. End items.
- b. Components and raw materials.
- c. Operations.
- d. Materials in process.
- e. Supplies in storage.
- f. Maintenance operations.
- g. Data or records.
- h. Administrative procedures.

These plans are intended primarily to be used for a continuing series of lots or batches. The plans may also be used for the inspection of isolated lots or batches, but, in this latter case, the user is cautioned to consult the operating characteristic curves to find a plan which will yield the desired protection (see 11.6).

1.3 INSPECTION. Inspection is the process of measuring, examining, testing, or otherwise comparing the unit of product (see 1.5) with the requirements.

1.4 INSPECTION BY ATTRIBUTES. Inspection by attributes is inspection whereby either the unit of product is classified simply as conforming or nonconforming, or

the number of nonconformities in the unit of products is counted, with respect to a given requirement or set of requirements.

1.5 UNIT OF PRODUCT. The unit of product is the unit inspected in order to determine its classification as conforming or nonconforming or to count the number of nonconformities. It may be a single article, a pair, a set, a length, an area, an operation, a volume, a component of an end product, or the end product itself. The unit of product may or may not be the same as the unit of purchase, supply, production, or shipment.

2. DEFINITIONS AND TERMINOLOGY

The definitions and terminology employed in this standard are in accord with ANSI/ASQ A3534-2-1993 (Terms, Symbols, and Definitions for Acceptance Sampling). The following two definitions are particularly important in applying the standard.

DEFECT: A departure of a quality characteristic from its intended level or state that occurs with a severity sufficient to cause an associated product or service not to satisfy intended normal, or foreseeable, usage requirements.

NONCONFORMITY: A departure of a quality characteristic from its intended level or state that occurs with severity sufficient to cause an associated product or service not to meet a specification requirement.

These acceptance sampling plans for attributes are given in terms of the percent or proportion of product in a lot or batch that depart from some requirement. The general terminology used within the document will be given in terms of percent of nonconforming units or number of nonconformities, since these terms are likely to constitute the most widely used criteria for acceptance sampling.

In the use of this standard it is helpful to distinguish between:

- a. an individual sampling plan—a specific plan that states the sample size or sizes to be used, and the associated acceptance criteria.

- b. a sampling scheme—a combination of sampling plans with switching rules and possibly a provision for discontinuance of inspection. In this standard the terms “sampling scheme” and “scheme performance” will be used in the restricted sense described in Sec. 11.1.
- c. a sampling system—a collection of sampling schemes. This standard is a sampling system indexed by lot-size ranges, inspection levels, and AQLs.

3. PERCENT NONCONFORMING AND NONCONFORMITIES PER HUNDRED UNITS

3.1 EXPRESSION OF NONCONFORMANCE. The extent of nonconformance of product shall be expressed either in terms of percent nonconforming or in terms of nonconformities per hundred units.

3.2 PERCENT NONCONFORMING. The percent nonconforming of any given quantity of units of product is one hundred times the number of nonconforming units divided by the total number of units of product, i.e.:

$$\text{Percent nonconforming} = \frac{\text{Number nonconforming}}{\text{Number of units inspected}} \times 100$$

3.3 NONCONFORMITIES PER HUNDRED UNITS. The number of nonconformities per hundred units of any given quantity of units of product is one hundred times the number of nonconformities contained therein (one or more nonconformities being possible in any unit of product) divided by the total number of units of product, i.e.:

$$\text{Nonconformities per hundred units} = \frac{\text{Number of nonconformities}}{\text{Number of units inspected}} \times 100$$

It is assumed that nonconformities occur randomly and with statistical independence within and between units.

4. ACCEPTANCE QUALITY LIMIT (AQL)

4.1 USE. The AQL together with the Sample Size Code Letter, is used for indexing the sampling plans provided herein.

4.2 DEFINITION. The AQL is the quality level that is the worst tolerable process average when a continuing series of lots is submitted for acceptance sampling.

Note: The use of the abbreviation AQL to mean Acceptable Quality Level is no longer recommended.

4.3 NOTE ON THE MEANING OF AQL. The concept of AQL only applies when an acceptance sampling scheme with rules for switching between normal, tightened and reduced inspection and discontinuance of sampling inspection is used. These rules are designed to encourage suppliers to have process averages consistently better than the AQL. If suppliers fail to do so, there is a high probability of being switched from normal inspection to tightened inspection where lot acceptance becomes more difficult. Once on tightened inspection, unless corrective action is taken to improve product quality, it is very likely that the rule requiring discontinuance of sampling inspection will be invoked.

Although individual lots with quality as bad as the AQL can be accepted with fairly high probability, the designation of an AQL does not suggest that this is necessarily a desirable quality level. The AQL is a parameter of the sampling scheme and should not be confused with a process average which describes the operating level of a manufacturing process. It is expected that the product quality level will be less than the AQL to avoid excessive non-accepted lots.

The sampling plans in this standard are so arranged that the probability of lot acceptance at the designated AQL depends upon sample size, being generally higher for large samples than for small samples for a given AQL. To determine the specific protection to the consumer at a given AQL, it is necessary to refer to the operating characteristic curves (which are provided in this standard) of the corresponding scheme and its constituent plans.

The AQL alone does not describe the protection to the consumer for individual lots or batches, but more directly relates to what is expected from a series of lots or batches provided the provisions of this standard are satisfied.

4.4 LIMITATION. The designation of an AQL shall not imply that the supplier has the right to knowingly supply any nonconforming unit of product.

4.5 SPECIFYING AQLs. The AQL to be used will be designated in the contract or by the responsible authority. Different AQLs may be designated for groups of nonconformities considered collectively, or for individual nonconformities. For example, Group A may include nonconformities of a type felt to be of the highest concern for the product or service and therefore be assigned a small AQL value; Group B may include nonconformities of the next higher degree of concern and therefore be assigned a larger AQL value than for Group A and smaller than that of Group C, etc. The classification into groups should be appropriate to the quality

requirements of the specific situation. An AQL for a group of nonconformities may be designated in addition to AQLs for individual nonconformities, or subgroups, within that group. AQL values of 10.0 or less may be expressed either in percent nonconforming or in nonconformities per hundred units; those over 10.0 shall be expressed in nonconformities per hundred units only.

4.6 PREFERRED AQLs. The values of AQLs given in these tables are known as preferred AQLs. If, for any product, an AQL be designated other than a preferred AQL, these tables are not applicable.

5. SUBMISSION OF PRODUCT

5.1 LOT OR BATCH. The term lot or batch shall mean “inspection lot” or “inspection batch,” i.e., a collection of units of product from which a sample is to be drawn and inspected to determine conformance with the acceptability criteria, and may differ from a collection of units designated as a lot or batch for other purposes (e.g., production, shipment, etc.).

5.2 FORMATION OF LOTS OR BATCHES. The product shall be assembled into identifiable lots, sublots, batches, or in such other manner as may be prescribed (see 5.4). Each lot or batch shall, as far as is practicable, consist of units of product of a single type, grade, class, size, and composition, manufactured under essentially the same conditions, and at essentially the same time.

5.3 LOT OR BATCH SIZE. The lot or batch size is the number of units of product in a lot or batch.

5.4 PRESENTATION OF LOTS OR BATCHES. The formation of the lots or batches, lot or batch size, and the manner in which each lot or batch is to be presented and identified by the supplier shall be designated or approved by the responsible authority. As necessary, the supplier shall provide adequate and suitable storage space for each lot or batch, equipment needed for proper identification and presentation, and personnel for all handling of product required for drawing of samples.

6. ACCEPTANCE AND NON-ACCEPTANCE

6.1 ACCEPTABILITY OF LOTS OR BATCHES. Acceptability of a lot or batch will be determined by the use of a sampling plan or plans associated with the designated AQL or AQLs.

In the use of this standard a statement that a lot is acceptable means simply that sample results satisfy the standard's

acceptance criteria. The acceptance of a lot is not intended to provide information about lot quality. If a stream of lots from a given process is inspected under an acceptance sampling scheme such as provided in this standard, some lots will be accepted and others will not. If all incoming lots are assumed to be at the same process average and if the nonconforming items that are discovered and replaced by conforming items during sample inspection are ignored, it will be found that both the set of accepted lots and the set of non-accepted lots will have the same long run average quality as the original set of lots submitted for inspection. Inspection of incoming lots whose quality levels vary around a fixed long run average quality level will divide the lots into a set of accepted lots and a set of non-accepted lots, but it will be found that the long run average quality of the accepted lots is only slightly better than the long run average quality of the non-accepted lots. Replacement of the nonconforming items that are discovered during sample inspection does not alter this finding because the samples are a small fraction of the lots.

The purpose of this standard is, through the economic and psychological pressure of lot non-acceptance, to induce a supplier to maintain a process average at least as good as the specified AQL while at the same time providing an upper limit on the consideration of the consumer's risk of accepting occasional poor lots. The standard is not intended as a procedure for estimating lot quality or for segregating lots.

In acceptance sampling, when sample data do not meet the acceptance criteria, it is often stated that the lot is to be “rejected.” In this connection, the words “to reject” generally are used. Rejection in an acceptance sampling sense means to decide that a batch, lot or quantity of product, material, or service has not been shown to satisfy the acceptance criteria based on the information obtained from the sample(s).

In acceptance sampling, the words “to reject” generally are used to mean “to not accept” without direct implication of product usability. Lots which are “rejected” may be scrapped, sorted (with or without nonconforming units being replaced), reworked, re-evaluated against more specific usability criteria, held for additional information, etc. Since the common language usage of “reject” often results in an inference of unsafe or unusable product, it is recommended that “not accept” be understood rather than “reject” in the use of this standard.

The word “non-acceptance” is used here for “rejection” when it refers to the result of following the procedure. Forms of the word “reject” are retained when they refer to actions the customer may take, as in “rejection number.”

6.2 NONCONFORMING UNITS. The right is reserved to reject any unit of product found nonconforming during inspection whether that unit of product forms a part of a sample or not, and whether the lot or batch as a whole is accepted or rejected. Rejected units may be repaired or corrected and resubmitted for inspection with the approval of, and in the manner specified by, the responsible authority.

6.3 SPECIAL RESERVATION FOR DESIGNATED NONCONFORMITIES. Since most acceptance sampling involves evaluation of more than one quality characteristic, and since these may differ in importance in terms of quality and/or economic effects, it is often desirable to classify the types of nonconformity according to agreed upon groupings. Specific assignment of types of nonconformities to each class is a function of agreement on specific sampling applications. In general, the function of such classification is to permit the use of a set of sampling plans having a common sample size, but different acceptance numbers for each class having a different AQL, such as in Tables II, III, and IV.

The supplier may be required at the discretion of the responsible authority to inspect every unit of the lot or batch for designated classes of nonconformities. The right is reserved to inspect every unit submitted by the supplier for specified nonconformities, and to reject the lot or batch immediately, when a nonconformity of this class is found. The right is reserved also to sample, for specified classes of nonconformities, lots or batches submitted by the supplier and to reject any lot or batch if a sample drawn therefrom is found to contain one or more of these nonconformities.

6.4 RESUBMITTED LOTS OR BATCHES. Lots or batches found unacceptable shall be resubmitted for reinspection only after all units are re-examined or re-tested and all nonconforming units are removed or nonconformities corrected. The responsible authority shall determine whether normal or tightened inspection shall be used on reinspection and whether reinspection shall include all types or classes of nonconformities or only the particular types or classes of nonconformities which caused initial rejection.

7. DRAWING OF SAMPLES

7.1 SAMPLE. A sample consists of one or more units of product drawn from a lot or batch, the units of the sample being selected at random without regard to their quality. The number of units of product in the sample is the sample size.

7.2 SAMPLING. When appropriate, the number of units in the sample shall be selected in proportion to the size of sublots or subbatches, or parts of the lot or batch, identified by some rational criterion. In so doing, the units from each part of the lot or batch shall be selected at random, as defined in ANSI/ASQ A3534-2-1993.

7.3 TIME OF SAMPLING. Samples may be drawn after all the units comprising the lot or batch have been produced, or samples may be drawn during production of the lot or batch.

7.4 DOUBLE OR MULTIPLE SAMPLING. Where double or multiple sampling is to be used, each sample shall be selected over the entire lot or batch.

8. NORMAL, TIGHTENED AND REDUCED INSPECTION

8.1 INITIATION OF INSPECTION. Normal inspection will be used at the start of inspection unless otherwise directed by the responsible authority.

8.2 CONTINUATION OF INSPECTION. Normal, tightened or reduced inspection shall continue unchanged on successive lots or batches except where the switching procedures given below require change.

8.3 SWITCHING PROCEDURES.

8.3.1 NORMAL TO TIGHTENED. When normal inspection is in effect, tightened inspection shall be instituted when 2 out of 5 or fewer consecutive lots or batches have been non-acceptable on original inspection (i.e., ignoring resubmitted lots or batches for this procedure).

8.3.2 TIGHTENED TO NORMAL. When tightened inspection is in effect, normal inspection shall be instituted when 5 consecutive lots or batches have been considered acceptable on original inspection.

8.3.3 NORMAL TO REDUCED. When normal inspection is in effect, reduced inspection shall be instituted providing that all of the following conditions are satisfied.

- a. The preceding 10 lots or batches (or more, as indicated by the note to Table VIII) have been on normal inspection and all have been accepted on original inspection; and

- b. The total number of nonconforming units (or nonconformities) in the samples from the preceding 10 lots or batches (or such other number as was used for condition “a” above) is equal to or less than the applicable limit number given in Table VIII (see 8.5). If double or multiple sampling is in use, all samples inspected should be included, not “first” samples only; and
- c. Production is at a steady rate; and
- d. Reduced inspection is considered desirable by the responsible authority.

8.3.4 REDUCED TO NORMAL. When reduced inspection is in effect, normal inspection shall be instituted if any of the following occur on original inspection:

- a. A lot or batch is rejected; or
- b. A lot or batch is considered acceptable under the procedures for reduced inspection given in 10.1.4; or
- c. Production becomes irregular or delayed; or
- d. Other conditions warrant that normal inspection shall be instituted.

8.4 DISCONTINUATION OF INSPECTION. If the cumulative number of lots not accepted in a sequence of consecutive lots on tightened inspection reaches 5, the acceptance procedures of this standard shall be discontinued. Inspection under the provisions of this standard shall not be resumed until corrective action has been taken. Tightened inspection shall then be used as if 8.3.1 had been invoked.

8.5 LIMIT NUMBERS FOR REDUCED INSPECTION. When agreed upon by responsible authority for both parties to the inspection, that is, the supplier and the end item customer, the requirements of 8.3.3b may be dropped. This action will have little effect on the operating properties of the scheme.

8.6 SWITCHING SEQUENCE. A schematic diagram describing the sequence of application of the switching rules is shown in Figure 1.

9. SAMPLING PLANS

9.1 SAMPLING PLAN. A sampling plan indicates the number of units of product from each lot or batch which are

to be inspected (sample size or series of sample sizes) and the criteria for determining the acceptability of the lot or batch (acceptance and rejection numbers).

9.2 INSPECTION LEVEL. The inspection level determines the relationship between the lot or batch size and the sample size. The inspection level to be used for any particular requirement will be prescribed by the responsible authority. Three inspection levels: I, II and III are given in Table I for general use. Unless otherwise specified, Inspection Level II will be used. However, Inspection Level I may be specified when less discrimination is needed, or Level III may be specified for greater discrimination. Four additional special levels: S-1, S-2, S-3, and S-4, are given in the same table and may be used where relatively small sample sizes are necessary and large sampling risks can or must be tolerated.

NOTE: In the designation of inspection levels S-1 to S-4, care must be exercised to avoid AQLs inconsistent with these inspection levels.

9.3 CODE LETTERS. Sample sizes are designated by code letters. Table I shall be used to find the applicable code letter for the particular lot or batch size and the prescribed inspection level.

9.4 OBTAINING SAMPLING PLAN. The AQL and the code letter shall be used to obtain the sampling plan from Tables II, III, or IV. When no sampling plan is available for a given combination of AQL and code letter, the tables direct the user to a different letter. The sample size to be used is given by the new code letter, not by the original letter. If this procedure leads to different sample sizes for different classes of nonconformities, the code letter corresponding to the largest sample size derived may be used for all classes of nonconformities when designated or approved by the responsible authority. As an alternative to a single sampling plan with an acceptance number of 0, the plan with an acceptance number of 1 with its correspondingly larger sample size for a designated AQL (where available), may be used when designated or approved by the responsible authority.

9.5 TYPES OF SAMPLING PLANS. Three types of sampling plans: Single, Double and Multiple, are given in Tables II, III, and IV, respectively. When several types of plans are available for a given AQL and code letter, any one may be used. A decision as to type of plan, either single, double, or multiple, when available for a given AQL and code letter, will usually be based upon the comparison between the

administrative difficulty and the average sample sizes of the available plans. The average sample size of multiple plans is less than for double (except in the case corresponding to single acceptance number 1) and both of these are always less than a single sample size (see Table IX). Usually the administrative difficulty for single sampling and the cost per unit of the sample are less than for double or multiple.

10. DETERMINATION OF ACCEPTABILITY

10.1 PERCENT NONCONFORMING INSPECTION.

To determine acceptability of a lot or batch under percent nonconforming inspection, the applicable sampling plan shall be used in accordance with 10.1.1, 10.1.2, 10.1.3 and 10.1.4.

10.1.1 SINGLE SAMPLING PLAN. The number of sample units inspected shall be equal to the sample size given by the plan. If the number of nonconforming units found in the sample is equal to or less than the acceptance number, the lot or batch shall be considered acceptable. If the number of nonconforming units is equal to or greater than the rejection number, the lot or batch shall be considered not acceptable.

10.1.2 DOUBLE SAMPLE PLAN. The number of sample units first inspected shall be equal to the first sample size given by the plan. If the number of nonconforming units found in the first sample is equal to or less than the first acceptable number, the lot or batch shall be considered acceptable. If the number of nonconforming units found in the first sample is equal to or greater than the first rejection number, the lot or batch shall be considered not acceptable. If the number of nonconforming units found in the first sample is between the first acceptance and rejection numbers, a second sample of the size given by the plan shall be inspected. The number of nonconforming units found in the first and second samples shall be accumulated. If the cumulative number of nonconforming units is equal to or less than the second acceptance number, the lot or batch shall be considered acceptable. If the cumulative number of nonconforming units is equal to or greater than the second rejection number, the lot or batch shall be considered not acceptable.

10.1.3 MULTIPLE SAMPLE PLAN. Under multiple sampling, the procedure shall be similar to that specified in 10.1.2, except that the number of successive samples required to reach a decision might be more than two.

10.1.4 SPECIAL PROCEDURE FOR REDUCED INSPECTION. Under reduced inspection, the sampling procedure may terminate without making a decision. In

these circumstances, the lot or batch will be considered acceptable, but normal inspection will be reinstated starting with the next lot or batch (see 8.3.4(b)).

10.2 NONCONFORMITIES PER HUNDRED UNITS INSPECTION. To determine the acceptability of a lot or batch under Nonconformities per Hundred Units inspection, the procedure specified for Percent Nonconforming inspection above shall be used, except that the word “nonconformities” shall be substituted for “nonconforming units.”

11. SUPPLEMENTARY INFORMATION

11.1 OPERATING CHARACTERISTIC CURVES.

Operating characteristic curves and other measures of performance presented in this standard are of two types. Those for the individual plans that represent the elements of the schemes are presented in Tables V, VI, VII, IX, and X. Analogous curves and other measures of overall scheme performance when the switching rules are used are given in Tables XI, XII, XIII, XIV, and XV. Scheme performance is defined as the composite proportion of lots accepted at a stated percent nonconforming when the switching rules are applied. The term scheme performance is used here in a very restrictive sense. It refers to how the ANSI Z1.4 scheme of switching rules would operate at a given process level under the assumption that the process stays at that level even after switching to tightened inspection or discontinuation of inspection. This gives a conservative “worst case” description of the performance of the scheme for use as a baseline in the sense that if the psychological and economic pressures associated with the switching rules are considered, the protection of the scheme may be somewhat better than that shown.

Operating characteristic curves are given in Table X for individual sampling plans for normal and tightened inspection. The operating characteristic curve for unqualified acceptance under reduced inspection can be found by using the AQL index of the normal plan with the sample size(s) and acceptance number(s) of the reduced plan. The curves shown are for single sampling; curves for double and multiple sampling are matched as closely as practicable. The O.C. curves shown for AQLs greater than 10.0 are based on the Poisson distribution and apply for nonconformities per hundred units inspection; those for AQLs of 10.0 or less and sample sizes of 80 or less are based on the binomial distribution and apply for percent nonconforming inspection; those for AQLs of 10.0 or less and sample sizes larger than 80 are based on the Poisson distribution and apply either for nonconformities per hundred units inspection, or for percent

nonconforming inspection (the Poisson distribution being an adequate approximation to the binomial distribution under these conditions). Tabulated values corresponding to selected values of probabilities of acceptance (P_a in percent) are given for each of the curves shown, and, in addition, are indexed for tightened inspection, and also show values for nonconformities per hundred units for AQLs of 10.0 or less and sample sizes of 80 or less.

The operating characteristic curves for scheme performance shown in Table XV indicate the percentage of lots or batches which may be expected to be accepted under use of the switching rules with the various sampling plans for a given process quality subject to the restrictions stated above. The operating characteristic curves of scheme performance are based on the use of limit numbers in switching to reduced inspection and are approximately correct when the limit numbers for reduced inspection are not used under Option 8.5. The curves also assume a return to tightened inspection when inspection is resumed after discontinuation has been imposed. This is also true of average outgoing quality limit and average sample size for ANSI Z1.4 scheme performance.

Note that the operating characteristic curve for scheme performance is approximately that of the normal plan for low levels of percent nonconforming and that the tightened plan for high levels of percent nonconforming. Use of the reduced plan increases scheme probability of acceptance only for extremely low levels of percent nonconforming.

11.2 PROCESS AVERAGE. The process average is the average percent nonconforming or average number of nonconformities per hundred units (whichever is applicable) of product submitted by the supplier for original inspection. Original inspection is the first inspection of a particular quantity of product as distinguished from the inspection of product which has been resubmitted after prior rejection. When double or multiple sampling is used, only first sample results shall be included in the process average calculation.

11.3 AVERAGE OUTGOING QUALITY (AOQ). The AOQ is the average quality of outgoing product including all accepted lots or batches, plus all lots or batches which are not accepted after such lots or batches have been effectively 100 percent inspected and all nonconforming units replaced by conforming units.

11.4 AVERAGE OUTGOING QUALITY LIMIT (AOQL). The AOQL is the maximum of the AOQs for all possible incoming qualities for a given acceptance sampling

plan. AOQL values are given in Table V-A for each of the single sampling plans for normal inspection and in Table V-B for each of the single sampling plans for tightened inspections. AOQL values for ANSI Z1.4 scheme performance are given in Table XI subject to the restrictions of 11.1. They show the average outgoing quality limits for scheme performance when using single sampling. AOQL will be slightly higher when the limit numbers for reduced inspection are not used under Option 8.5.

11.5 AVERAGE SAMPLE SIZE CURVES. Average sample size curves for double and multiple sampling as compared to the single sampling plan for each acceptance number are in Table IX. These show the average sample sizes which may be expected to occur under the various sampling plans for a given process quality level. The curves assume no curtailment of inspection and are approximate to the extent that they are based upon the Poisson distribution, and that the sample sizes at each stage for double and multiple sampling are assumed to be $0.631n$ and $0.25n$ respectively, where n is the equivalent single sample size. Average sample size tables for ANSI Z1.4 scheme performance are given in Table XIV. They show the average sample size for scheme performance when using single sampling.

11.6 LIMITING QUALITY PROTECTION.

11.6.1 USE OF INDIVIDUAL PLANS. This standard is intended to be used as a system employing tightened, normal, and reduced inspection on a continuing series of lots to achieve consumer protection while assuring the producer that acceptance will occur most of the time if quality is better than the AQL.

11.6.2 IMPORTANCE OF SWITCHING RULES. Occasionally specific individual plans are selected from the standard and used without the switching rules. This is not the intended application of the ANSI Z1.4 system and its use in this way should not be referred to as inspection under ANSI Z1.4. When employed in this way, this document simply represents a repository for a collection of individual plans indexed by AQL. The operating characteristics and other measures of a plan so chosen must be assessed individually for that plan from the tables provided.

11.6.3 LIMITING QUALITY TABLES. If the lot or batch is of an isolated nature, it is desirable to limit the selection of sampling plans to those, associated with a designated AQL value, that provide not less than a specified limiting quality protection. Sampling plans for this purpose

can be selected by choosing a Limiting Quality (LQ) and a consumer's risk to be associated with it. Limiting Quality is the percentage of nonconforming units (or nonconformities) in a batch or lot for which for purposes of acceptance sampling, the consumer wishes the probability of acceptance to be restricted to a specified low value.

Tables VI and VII give process levels for which the probabilities of lot acceptance under various sampling plans are 10 percent and 5 percent respectively. If a different value of consumer's risk is required, the O.C. curves and their tabulated values may be used. For individual lots with percents nonconforming or nonconformities per 100 units equal to the specified Limiting Quality (LQ) values, the probabilities of lot acceptance are less than 10 percent in the case of plans listed in Table VI and less than 5 percent in the case of plans listed in Table VII. When there is reason for avoiding more than a limiting percentage of nonconforming units (or nonconformities) in a lot or batch, Tables VI and VII may be useful for fixing minimum sample sizes to be associated

with the AQL and Inspection Level specified for the inspection of a series of lots or batches. For example, if an LQ of 5 percent is desired for individual lots with an associated P_a of 10 percent or less, then if an AQL of 1.5 percent is designated for inspection of a series of lots or batches, Table VI indicates that the minimum sample size must be that given by Code Letter M.

Where there is interest in a limiting *process level*, Tables XII and XIII, which give LQ values and ANSI Z1.4 scheme performance may be used in a similar way to fix minimum sample sizes.

In the case of an isolated lot, it is preferable for the customer to adapt a sampling plan with a small consumer's risk. The ideal method of calculating the sample size and risk is by use of the hypergeometric probability function. ASQC Q3-1988 contains sampling plans that have been calculated on this basis and therefore provide a more accurate set of tables for these situations.

Switching Rules for ANSI Z1.4 System

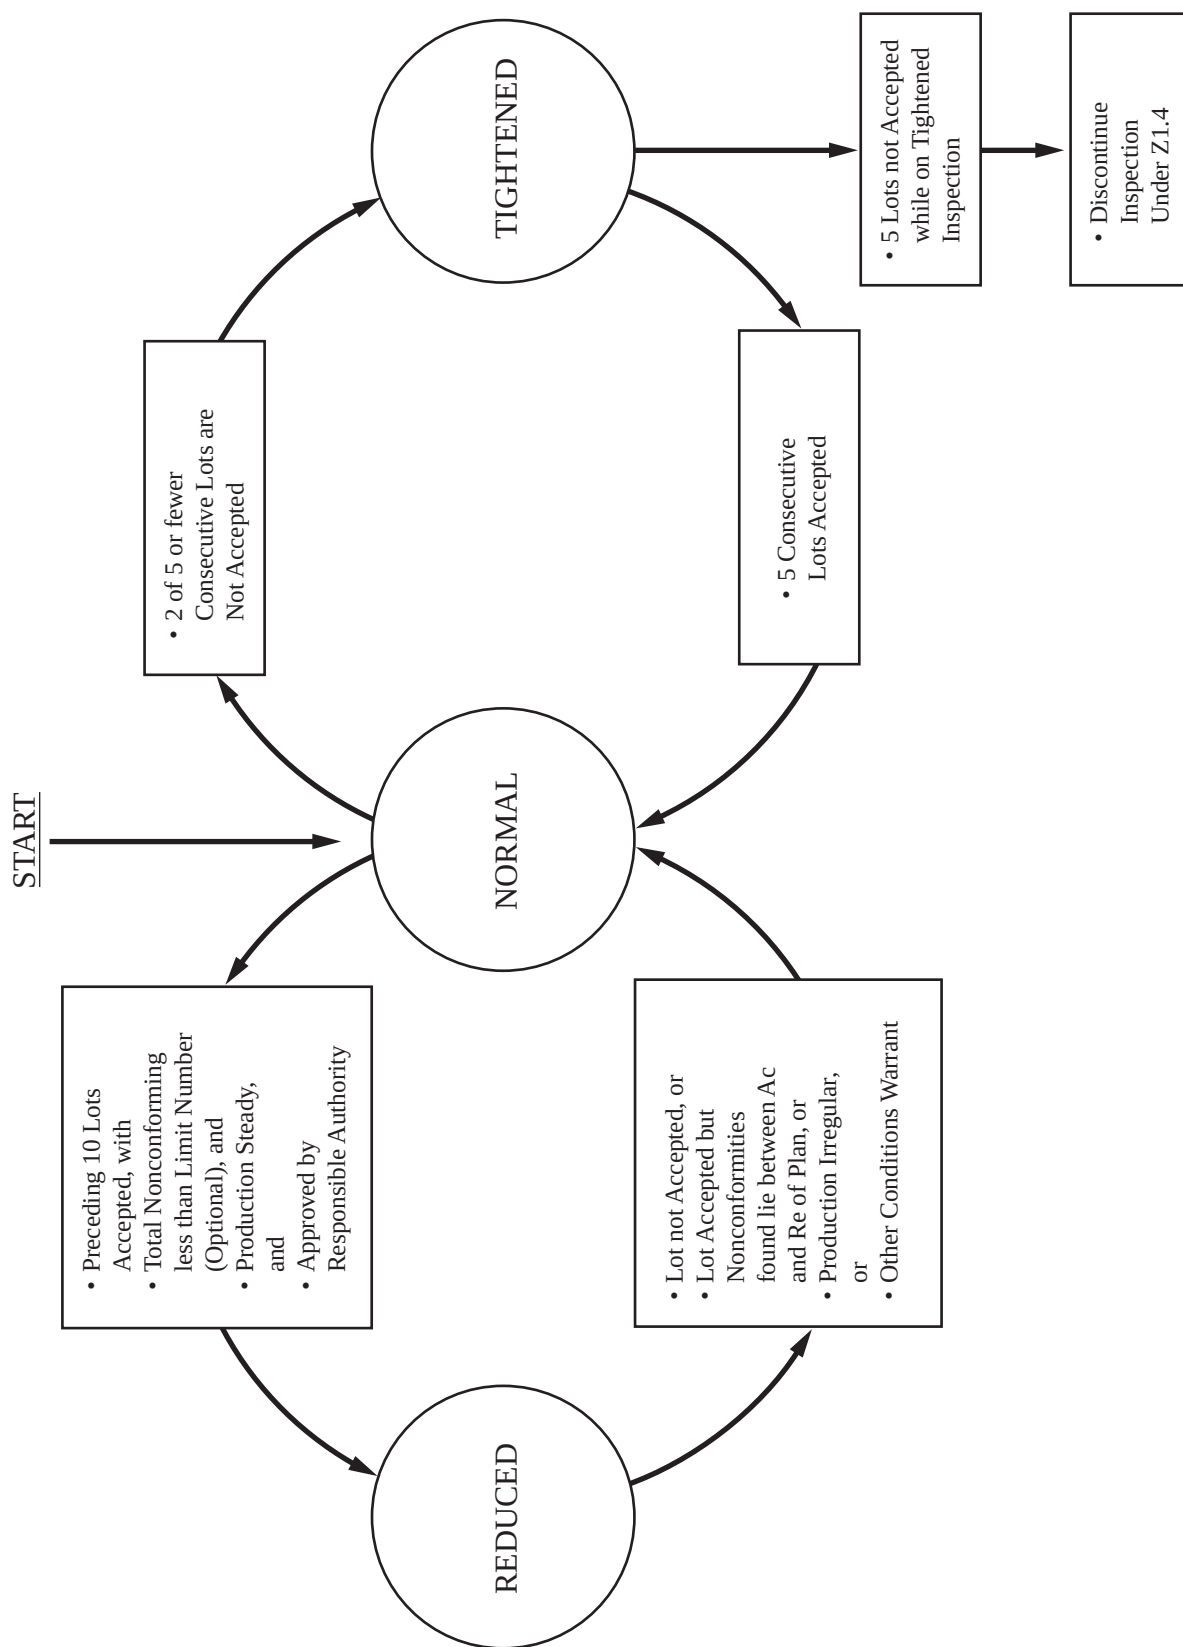


FIGURE 1

**SWITCHING
RULES**

Table I—Sample size code letters

(See 9.2 and 9.3)

Lot or batch size	Special inspection levels				General inspection levels		
	S-1	S-2	S-3	S-4	I	II	III
2 to 8	A	A	A	A	A	A	B
9 to 15	A	A	A	A	A	B	C
16 to 25	A	A	B	B	B	C	D
26 to 50	A	B	B	C	C	D	E
51 to 90	B	B	C	C	C	E	F
91 to 150	B	B	C	D	D	F	G
151 to 280	B	C	D	E	E	G	H
281 to 500	B	C	D	E	F	H	J
501 to 1200	C	C	E	F	G	J	K
1201 to 3200	C	D	E	G	H	K	L
3201 to 10000	C	D	F	G	J	L	M
10001 to 35000	C	D	F	H	K	M	N
35001 to 150000	D	E	G	J	L	N	P
150001 to 500000	D	E	G	J	M	P	Q
500001 and over	D	E	H	K	N	Q	R

Table II-A—Single sampling plans for normal inspection (Master table)

(See 9.4 and 9.5)

Sample size code letter	Sample size	Acceptance Quality Limits, AQLs, in Percent Nonconforming Items and Nonconformities per 100 Items (Normal Inspection)																				
		0.010	0.015	0.025	0.040	0.065	1.0	1.5	2.5	4.0	6.5	10	15	25	40	65	100	150	250	400	650	1000
		Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re
A B C	2	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	
	3	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	
	5	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	
D E F	8	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	
	13	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	
	20	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	
G H J	32	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	
	50	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	
	80	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	
K L M	125	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	
	200	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	
	315	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	
N P Q	500	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	
	800	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	
	1250	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	
R	2000	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	

↓ = Use the first sampling plan below the arrow. If sample size equals, or exceeds, lot size, carry out 100 percent inspection.

↑ = Use the first sampling plan above the arrow.

Ac = Acceptance number.

Re = Rejection number.

SINGLE
NORMAL
PLANS

**SINGLE
TIGHTENED
PLANS**

Table II-B—Single sampling plans for tightened inspection (Master table)

(See 9.4 and 9.5)

Sample size code letter	Sample size	Acceptance Quality Limits (tightened inspection)																				
		0.010	0.015	0.025	0.040	0.065	1.0	1.5	2.5	4.0	6.5	10	15	25	40	65	100	150	250	400	650	1000
		Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re
A B C	2	→																				
	3	→																				
	5	→																				
D E F	8	→																				
	13	→																				
	20	→																				
G H J	32	→																				
	50	→																				
	80	→																				
K L M	125	→																				
	200	→																				
	315	→																				
N P Q	500	→																				
	800	→																				
	1250	→																				
R S	2000	0	1	→																		
	3150	→																				

↓ = Use first sampling plan below arrow. If sample size equals or exceeds lot or batch size, do 100 percent inspection.

↑ = Use first sampling plan above arrow.

Ac = Acceptance number.

Re = Rejection number.

Table II-C—Single sampling plans for reduced inspection (Master table)

(See 9.4 and 9.5)

Sample size code letter	Sample size	Acceptance Quality Limits (reduced inspection) [†]																					
		0.010	0.015	0.025	0.040	0.065	1.0	1.5	2.5	4.0	6.5	10	15	25	40	65	100	150	250	400	650	1000	
		Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re
A	2	→																					
B	2	→																					
C	2	→																					
D	3	→																					
	5	→																					
	8	→																					
G	13	→																					
	20	→																					
	32	→																					
K	50	→																					
	80	→																					
	125	→																					
N	200	→																					
	315	→																					
	500	→																					
R	800	→																					

↓ = Use first sampling plan below arrow. If sample size equals or exceeds lot or batch size, do 100 percent inspection.

↑ = Use first sampling plan above arrow.

Ac = Acceptance number.

Re = Rejection number.

† = If the acceptance number has been exceeded, but the rejection number has not been reached, accept the lot, but reinstate normal inspection (see 10.1.4).

SINGLE
REDUCED
PLANS

Table III-A—Double sampling plans for normal inspection (Master table)

Acceptance Quality Limits (reduced inspection)

[illegible]

↓ = Use first sampling plan below arrow. If sample size equals or exceeds lot or batch size, do 100 percent inspection.

↑ = Use first sampling plan above arrow.

Ac = Acceptance number.

Re = Rejection number.

★ = Use corresponding single sampling plan.

† = Use corresponding single sampling plan or double sampling plan for code letter B below.

Table III-B—Double sampling plans for tightened inspection (Master table)

(See 9.4 and 9.5)

Sample size code letter		Sample	Sample size	Cumulative sample size	Acceptance Quality Limits (tightened inspection)																65	100	150	250	400	650	1000			
					0.010	0.015	0.025	0.040	0.065	0.10	0.15	0.25	0.40	0.65	1.0	1.5	2.5	4.0	6.5	10								15	25	40
A					Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re
B	First	Second	2	2	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓
	4																													
C	First	Second	3	3	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓
	6																													
D	First	Second	5	5	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓
	10																													
E	First	Second	8	8	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓
	16																													
F	First	Second	13	13	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓
	26																													
G	First	Second	20	20	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓
	40																													
H	First	Second	32	32	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓
	64																													
J	First	Second	50	50	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓
	100																													
K	First	Second	80	80	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓
	160																													
L	First	Second	125	125	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓
	250																													
M	First	Second	200	200	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓
	400																													
N	First	Second	315	315	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓
	630																													
P	First	Second	500	500	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓
	1000																													
Q	First	Second	800	800	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓
	1600																													
R	First	Second	1250	1250	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓
	2500																													
S	First	Second	2000	2000	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓	↓
	4000																													

↓ = Use first sampling plan below arrow. If sample size equals or exceeds lot or batch size, do 100 percent inspection.
 ↓ = Use first sampling plan above arrow.

Ac = Acceptance number.

Re = Rejection number.

* = Use corresponding single sampling plan.

+ = Use corresponding single sampling plan or double sampling plan for code letter B below.

**DOUBLE
TIGHTENED
PLANS**

**DOUBLE
REDUCED
PLANS**

Table III-C—Double sampling plans for reduced inspection (Master table)

(See 9.4 and 9.5)

Sample size code letter	Sample	Sample size	Cumulative sample size	Acceptance Quality Limits (reduced inspection)†																											
				0.010	0.015	0.025	0.040	0.065	0.10	0.15	0.25	0.40	0.65	1.0	1.5	2.5	4.0	6.5	10	15	25	40	65	100	150	250	400	650	1000		
				Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re
A																															
B																															
C																															
D	First Second	2 2	2 4																												
E	First Second	3 3	3 6																												
F	First Second	5 5	5 10																												
G	First Second	8 8	8 16																												
H	First Second	13 13	13 26																												
J	First Second	20 20	20 40																												
K	First Second	32 32	32 64																												
L	First Second	50 50	50 100																												
M	First Second	80 80	80 160																												
N	First Second	125 125	125 250																												
P	First Second	200 200	200 400																												
Q	First Second	315 315	315 630																												
R	First Second	500 500	500 1000																												

↓ = Use first sampling plan below arrow. If sample size equals or exceeds lot or batch size, do 100 percent inspection.

↑ = Use first sampling plan above arrow.

Ac = Acceptance number.

Re = Rejection number.

* = Use corresponding single sampling plan.

† = If, after the second sample, the acceptance number has been exceeded, but the rejection number has not been reached, accept the lot, but reinstate normal inspection (see 10.1.4).

+ = Use corresponding single sampling plan or double sampling plan for code letter D below.

Table IV-A—Multiple sampling plans for normal inspection (Master table)

[illegible]

↓ = Use first sampling plan below arrow (refer to continuation of table on following page, when necessary). If sample size equals or exceeds lot or batch size, do 100 percent inspection.

MULTIPLE NORMAL PLANS

**MULTIPLE
NORMAL
PLANS**

Table IV-A—Multiple sampling plans for normal inspection (Master table)
(Continued)

(See 9.4 and 9.5)

Sample size code letter	Sample	Sample size	Cumulative sample size	Acceptance Quality Limits (normal inspection)																							
				0.010	0.015	0.025	0.040	0.065	1.0	1.5	2.5	4.0	6.5	10	15	25	40	65	100	150	250	400	650	1000			
				Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re
K	First	32	32	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Second	64	64	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Third	32	96	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Fourth	32	128	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Fifth	32	160	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Sixth	32	192	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Seventh	32	224	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
L	First	50	50	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Second	50	100	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Third	50	150	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Fourth	50	200	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Fifth	50	250	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Sixth	50	300	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Seventh	50	350	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
M	First	80	80	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Second	80	160	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Third	80	240	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Fourth	80	320	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Fifth	80	400	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Sixth	80	480	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Seventh	80	560	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
N	First	125	125	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Second	125	250	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Third	125	375	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Fourth	125	500	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Fifth	125	625	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Sixth	125	750	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Seventh	125	875	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
P	First	200	200	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Second	200	400	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Third	200	600	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Fourth	200	800	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Fifth	200	1000	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Sixth	200	1200	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Seventh	200	1400	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
Q	First	315	315	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Second	315	630	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Third	315	945	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Fourth	315	1260	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Fifth	315	1575	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Sixth	315	1890	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Seventh	315	2205	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
R	First	500	500	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Second	500	1000	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Third	500	1500	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Fourth	500	2000	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Fifth	500	2500	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Sixth	500	3000	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		
	Seventh	500	3500	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re		

↓ = Use first sampling plan below arrow. If sample size equals or exceeds lot or batch size, do 100 percent inspection.

↑ = Use first sampling plan above arrow (refer to preceding page, when necessary).

Ac = Acceptance number.

* = Use corresponding single sampling plan.

= Acceptance not permitted at this sample size.

Re = Rejection number.

Table IV-B—Multiple samplings for tightened inspection (Master table)

Acceptance Quality Limits (tightened inspection)																							
Sample size code letter	Sample size	Cumulative sample size	0.010	0.015	0.025	0.40	0.65	1.0	1.5	2.5	4.0	6.5	10	15	25	40	65	100	150	250	400	650	1000
			Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re
A B C			→																				
			→																				
			→																				
D	First	2	→																				
	Second	2	→																				
	Third	2	→																				
	Fourth	2	→																				
	Fifth	2	→																				
	Sixth	2	→																				
	Seventh	2	→																				
E	First	3	→																				
	Second	3	→																				
	Third	3	→																				
	Fourth	3	→																				
	Fifth	3	→																				
	Sixth	3	→																				
	Seventh	3	→																				
F	First	5	→																				
	Second	5	→																				
	Third	5	→																				
	Fourth	5	→																				
	Fifth	5	→																				
	Sixth	5	→																				
	Seventh	5	→																				
G	First	8	→																				
	Second	8	→																				
	Third	8	→																				
	Fourth	8	→																				
	Fifth	8	→																				
	Sixth	8	→																				
	Seventh	8	→																				
H	First	13	→																				
	Second	13	→																				
	Third	13	→																				
	Fourth	13	→																				
	Fifth	13	→																				
	Sixth	13	→																				
	Seventh	13	→																				
J	First	20	→																				
	Second	20	→																				
	Third	20	→																				
	Fourth	20	→																				
	Fifth	20	→																				
	Sixth	20	→																				
	Seventh	20	→																				

➡ = Use first sampling plan below arrow (refer to continuation of table on following page, when necessary). If sample size equals or exceeds lot or batch size, do 100 percent inspection.

MULTIPLE TIGHTENED PLANS

**MULTIPLE
TIGHTENED
PLANS**

Table IV-B—Multiple samplings for tightened inspection (Master table)
(Continued)

(See 9.4 and 9.5)

Acceptance Quality Limits (normal inspection)																															
Sample size code letter	Sample	Sample size	Cumulative sample size	0.010	0.015	0.025	0.40	0.65	1.0	1.5	2.5	4.0	6.5	10	15	25	40	65	100	150	250	400	650	1000							
				Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re					
K	First	32	32	↓				↓				↓				↓				↓				↓				↓			
	Second	64	64	↓				↓				↓				↓				↓				↓				↓			
	Third	96	96	↓				↓				↓				↓				↓				↓				↓			
	Fourth	128	128	↓				↓				↓				↓				↓				↓				↓			
	Fifth	160	160	↓				↓				↓				↓				↓				↓				↓			
	Sixth	192	192	↓				↓				↓				↓				↓				↓				↓			
	Seventh	224	224	↓				↓				↓				↓				↓				↓				↓			
L	First	50	50	↓				↓				↓				↓				↓				↓				↓			
	Second	100	100	↓				↓				↓				↓				↓				↓				↓			
	Third	150	150	↓				↓				↓				↓				↓				↓				↓			
	Fourth	200	200	↓				↓				↓				↓				↓				↓				↓			
	Fifth	250	250	↓				↓				↓				↓				↓				↓				↓			
	Sixth	300	300	↓				↓				↓				↓				↓				↓				↓			
	Seventh	350	350	↓				↓				↓				↓				↓				↓				↓			
M	First	80	80	↓				↓				↓				↓				↓				↓				↓			
	Second	160	160	↓				↓				↓				↓				↓				↓				↓			
	Third	240	240	↓				↓				↓				↓				↓				↓				↓			
	Fourth	320	320	↓				↓				↓				↓				↓				↓				↓			
	Fifth	400	400	↓				↓				↓				↓				↓				↓				↓			
	Sixth	480	480	↓				↓				↓				↓				↓				↓				↓			
	Seventh	560	560	↓				↓				↓				↓				↓				↓				↓			
N	First	125	125	↓				↓				↓				↓				↓				↓				↓			
	Second	250	250	↓				↓				↓				↓				↓				↓				↓			
	Third	375	375	↓				↓				↓				↓				↓				↓				↓			
	Fourth	500	500	↓				↓				↓				↓				↓				↓				↓			
	Fifth	625	625	↓				↓				↓				↓				↓				↓				↓			
	Sixth	750	750	↓				↓				↓				↓				↓				↓				↓			
	Seventh	875	875	↓				↓				↓				↓				↓				↓				↓			
P	First	200	200	↓				↓				↓				↓				↓				↓				↓			
	Second	400	400	↓				↓				↓				↓				↓				↓				↓			
	Third	600	600	↓				↓				↓				↓				↓				↓				↓			
	Fourth	800	800	↓				↓				↓				↓				↓				↓				↓			
	Fifth	1000	1000	↓				↓				↓				↓				↓				↓				↓			
	Sixth	1200	1200	↓				↓				↓				↓				↓				↓				↓			
	Seventh	1400	1400	↓				↓				↓				↓				↓				↓				↓			
Q	First	315	315	↓				↓				↓				↓				↓				↓				↓			
	Second	630	630	↓				↓				↓				↓				↓				↓				↓			
	Third	945	945	↓				↓				↓				↓				↓				↓				↓			
	Fourth	1260	1260	↓				↓				↓				↓				↓				↓				↓			
	Fifth	1575	1575	↓				↓				↓				↓				↓				↓				↓			
	Sixth	1890	1890	↓				↓				↓				↓				↓				↓				↓			
	Seventh	2205	2205	↓				↓				↓				↓				↓				↓				↓			
R	First	500	500	↓				↓				↓				↓				↓				↓				↓			
	Second	1000	1000	↓				↓				↓				↓				↓				↓				↓			
	Third	1500	1500	↓				↓				↓				↓				↓				↓				↓			
	Fourth	2000	2000	↓				↓				↓				↓				↓				↓				↓			
	Fifth	2500	2500	↓				↓				↓				↓				↓				↓				↓			
	Sixth	3000	3000	↓				↓				↓				↓				↓				↓				↓			
	Seventh	3500	3500	↓				↓				↓				↓				↓				↓				↓			
S	First	800	800	↓				↓				↓				↓				↓				↓				↓			
	Second	1600	1600	↓				↓				↓				↓				↓				↓				↓			
	Third	2400	2400	↓				↓				↓				↓				↓				↓				↓			
	Fourth	3200	3200	↓				↓				↓				↓				↓				↓				↓			
	Fifth	4000	4000	↓				↓				↓				↓				↓				↓				↓			
	Sixth	4800	4800	↓				↓				↓				↓				↓				↓				↓			
	Seventh	5600	5600	↓				↓				↓				↓				↓				↓				↓			

↓ = Use first sampling plan below arrow. If sample size equals or exceeds lot or batch size, do 100 percent inspection.
 ↑ = Use first sampling plan above arrow (refer to preceding page, when necessary).
 # = Acceptance not permitted at this sample size.

Ac = Acceptance number.
 Re = Rejection number.
 * = Use corresponding single sampling plan.

Table IV-C—Multiple sampling plans for reduced inspection (Master table)

(See 9.4 and 9.5)

[illegible]

➡ = Use first sampling plan below arrow (refer to continuation of table on following page, when necessary). If sample size equals or exceeds lot or batch size, do 100 percent inspection.

↑ = Use first sampling plan above arrow.
when necessary; if sample size equals

★ = Use corresponding single sampling plan.

++ = Use corresponding double sampling plan or multiple sampling plan for code letter F below.

Ac = Acceptance number.

Re = Rejection number.

= Acceptance not permitted at this sample size.

= Use corresponding double sampling plan.

† = If, after the final sample, the acceptance number has been exceeded, but the rejection number has not been reached, accept the lot but reinstate normal inspection (see 10.1.4).

**MULTIPLE
REDUCED
PLANS**

Table IV-C—Multiple sampling plans for reduced inspection (Master table)
(Continued)

(See 9.4 and 9.5)

Sample size code letter	Sample	Sample size	Cumulative sample size	Acceptance Quality Limits (reduced inspection)†																											
				0.010	0.015	0.025	0.040	0.065	0.10	0.15	0.25	0.40	0.65	1.0	1.5	2.5	4.0	6.5	10	15	25	40	65	100	150	250	400	650	1000		
				Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re	Ac	Re
L	First	20	20																												
	Second	20	40																												
	Third	20	60																												
	Fourth	20	80																												
	Fifth	20	100																												
	Sixth	20	120																												
	Seventh	20	140																												
M	First	32	32																												
	Second	32	64																												
	Third	32	96																												
	Fourth	32	128																												
	Fifth	32	160																												
	Sixth	32	192																												
	Seventh	32	224																												
N	First	50	50																												
	Second	50	100																												
	Third	50	150																												
	Fourth	50	200																												
	Fifth	50	250																												
	Sixth	50	300																												
	Seventh	50	350																												
P	First	80	80																												
	Second	80	160																												
	Third	80	240																												
	Fourth	80	320																												
	Fifth	80	400																												
	Sixth	80	480																												
	Seventh	80	560																												
Q	First	125	125																												
	Second	125	250																												
	Third	125	375																												
	Fourth	125	500																												
	Fifth	125	625																												
	Sixth	125	750																												
	Seventh	125	875																												
R	First	200	200																												
	Second	200	400																												
	Third	200	600																												
	Fourth	200	800																												
	Fifth	200	1000																												
	Sixth	200	1200																												

➡ = Use first sampling plan below arrow. If sample size equals or exceeds lot or batch size, do 100 percent inspection.

⬅ = Use first sampling plan above arrow.

= Acceptance not permitted at this sample size.

Ac = Acceptance number.

Re = Rejection number.

★ = Use corresponding single sampling plan.

† = If, after the final sample, the acceptance number has been exceeded, but the rejection number has not been reached, accept the lot, but reinstate normal inspection (see 10.1.4).

Table V-A—Factors for Determining Approximate Values for Average Outgoing
Quality Limits for Normal Inspection (Single Sampling)

(See 11.4)

		Acceptance Quality Limits																									
		0.010	0.015	0.025	0.040	0.065	0.10	0.15	0.25	0.40	0.65	100	150	250	400	650	1000										
A B C	2 3 5																										
D E F	8 13 20																										
G H J	32 50 80																										
K L M	125 200 315																										
N P Q	500 800 1250																										
R	2000																										

Note: For a more accurate AOQL, the above values must be multiplied by $\left(1 - \frac{\text{Sample size}}{\text{Lot or Batch size}}\right)$ (See 11.4)

AOQL
NORMAL
PLANS

Table V-B—Factors for Determining Approximate Values for Average Outgoing
Quality Limits for Tightened Inspection (Single Sampling)

(See 11.4)

Code Letter		Sample size	Acceptance Quality Limits																																																							
			0.010	0.015	0.025	0.040	0.065	1.0	1.5	2.5	4.0	6.5	10	15	25	40	65	100	150	250	400	650	1000																																			
A	2																																																									
B	3																							12	7.4	4.6	2.8	1.8	1.2	0.74	0.46	0.29	0.18	0.12	0.074	0.046	0.029	0.018	39	11	17	24	40	64	99	160	240	380		42	69	97	160	260	400	620	970	
C	5																																																									6.5
D	8																																																									
E	13																							4.2	2.6	1.7	1.1	0.67	0.42	0.27	0.17	0.11	0.067	0.042	0.027	0.018	16	25	39	6.1	9.9	16	25	39	62	99	160	240	380		42	65	110	170	270	410	650	1100
F	20																																																									
G	32																																																									
H	50																							4.3	2.7	1.7	1.1	0.69	0.44	0.27	0.18	0.12	0.074	0.046	0.029	0.018	16	25	39	6.1	9.9	16	25	39	62	99	160	240	380		42	65	110	170	270	410	650	1100
J	80																																																									
K	125																																																									
L	200																							4.1	2.5	1.6	1.1	0.67	0.42	0.27	0.17	0.11	0.067	0.042	0.027	0.018	16	25	39	6.4	9.9	16	25	39	62	99	160	240	380		42	65	110	170	270	410	650	1100
M	315																																																									
N	500																																																									
P	800																							4.1	2.5	1.6	1.1	0.63	0.39	0.27	0.17	0.11	0.067	0.042	0.027	0.018	16	25	39	6.4	9.9	16	25	39	62	99	160	240	380		42	65	110	170	270	410	650	1100
Q	1250																																																									
R	2000																																																									
S	3150																							4.1	2.5	1.6	1.1	0.63	0.39	0.27	0.17	0.11	0.067	0.042	0.027	0.018	16	25	39	6.4	9.9	16	25	39	62	99	160	240	380		42	65	110	170	270	410	650	1100

Note: For a more accurate AOQL, the above values must be multiplied by $\left(1 - \frac{\text{Sample size}}{\text{Lot or Batch size}}\right)$ (See 11.4)

*Table VI-A—Limiting Quality (in percent nonconforming) for Which $P_d = 10$ Percent
(for Normal Inspection, Single Sampling)*

(See 11.6)

		Acceptance Quality Limits															
		0.010	0.015	0.025	0.040	0.065	1.0	1.5	2.5	4.0	6.5	10					
A B C	2	68															
	3																
	5																
D E F	8	54															
	13																
	20																
G H J	32	37															
	50																
	80																
K L M	125	25															
	200																
	315																
N P Q	500	12															
	800																
	1250																
R	2000	16															

**LQ (Nonconforming Units)
10% PLANS**

**LQ (Nonconformities)
10% PLANS**

*Table VI-B—Limiting Quality (in nonconformities per hundred units) for Which $P_d = 10$ Percent
(for Normal Inspection, Single Sampling)*

(See 11.6)

		Acceptance Quality Limits																									
		0.010	0.015	0.025	0.040	0.065	0.10	0.15	0.25	40	65	100	150	250	400	650	1000										
A	2																										
	3																										
	5																										
D	8																										
	13																										
	20																										
G	32																										
	50																										
	80																										
K	125																										
	200																										
	315																										
N	500																										
	800																										
	1250																										
R	2000																										

*Table VII-A—Limiting Quality (in percent nonconforming) for Which $P_d = 5$ Percent
(for Normal Inspection, Single Sampling)*

(See 11.6)

		Acceptance Quality Limits																															
		0.010	0.015	0.025	0.040	0.065	1.0	1.5	2.5	4.0	6.5	10																					
A B C	2 3 5	66																															
	8 13 20																	78															
D E F	8 13 20	63																															
	31																	45															
G H J	32 50 80	60																															
	21																	47 41 50															
K L M	125 200 315	37																															
	14																	32 28															
N P Q	500 800 1250	24																															
	8.9																	6.1															
R 2000	0.010	0.015	0.025	0.040	0.065	0.10	0.15	0.25	0.40	0.65	2.4	3.7	5.8	8.9	14	9.1	7.7	5.4	4.2	3.8	5.0	6.2	8.4	11	14	18	20	25	30	37			

**LQ (Nonconforming Units)
5% PLANS**

**LQ (Nonconformities)
5% PLANS**

*Table VII-B—Limiting Quality (in nonconformities per hundred units) for Which $P_a = 5$ Percent
(for Normal Inspection, Single Sampling)*

(See 11.6)

		Acceptance Quality Limits																								
		0.010	0.015	0.025	0.040	0.065	0.10	0.15	1.0	1.5	2.5	4.0	6.5	10	15	25	40	65	100	150	250	400	650	1000		
A B C	2 3 5																									
D E F	8 13 20																									
G H J	32 50 80																									
K L M	125 200 315																									
N P Q	500 800 1250																									
R	2000																									

Table VIII—Limit Numbers for Reduced Inspection

(See 4.7.3)


Number of sample units from last 10 lots or batches	Acceptance Quality Limits																			
	0.010	0.015	0.025	0.040	0.065	1.0	1.5	2.5	4.0	6.5	10	15	25	40	65	100	150	250	400	650
	0.1000	0.1500	0.2500	0.4000	0.6500	1.0000	1.5000	2.5000	4.0000	6.5000	10.0000	15.0000	25.0000	40.0000	65.0000	100.0000	150.0000	250.0000	400.0000	650.0000
20-29	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*
30-49	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*
50-79	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*
80-129	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*
130-199	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*
200-319	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*
320-499	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*
500-799	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*
800-1249	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*
1250-1999	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*
2000-3149	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*
3150-4999	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*
5000-7999	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*
8000-12499	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*
12500-19999	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*
20000-31499	0	0	2	4	8	14	24	40	68	115	181									
31500 & Over	0	1	4	8	14	24	38	67	111	186										

* = Denotes that the number of sample units from the last ten lots or batches is not sufficient for reduced inspection for this AQL. Is this instance, more than ten lots or batches may be used for the calculation, provided that the lots or batches used are the most recent ones in sequence, that they have all been on normal inspection, and that none has been rejected while on original inspection.

**LIMIT
NUMBERS**

Table IX—Average sample size curves for double and multiple sampling plans
(normal and tightened inspection)

(See 11.5)

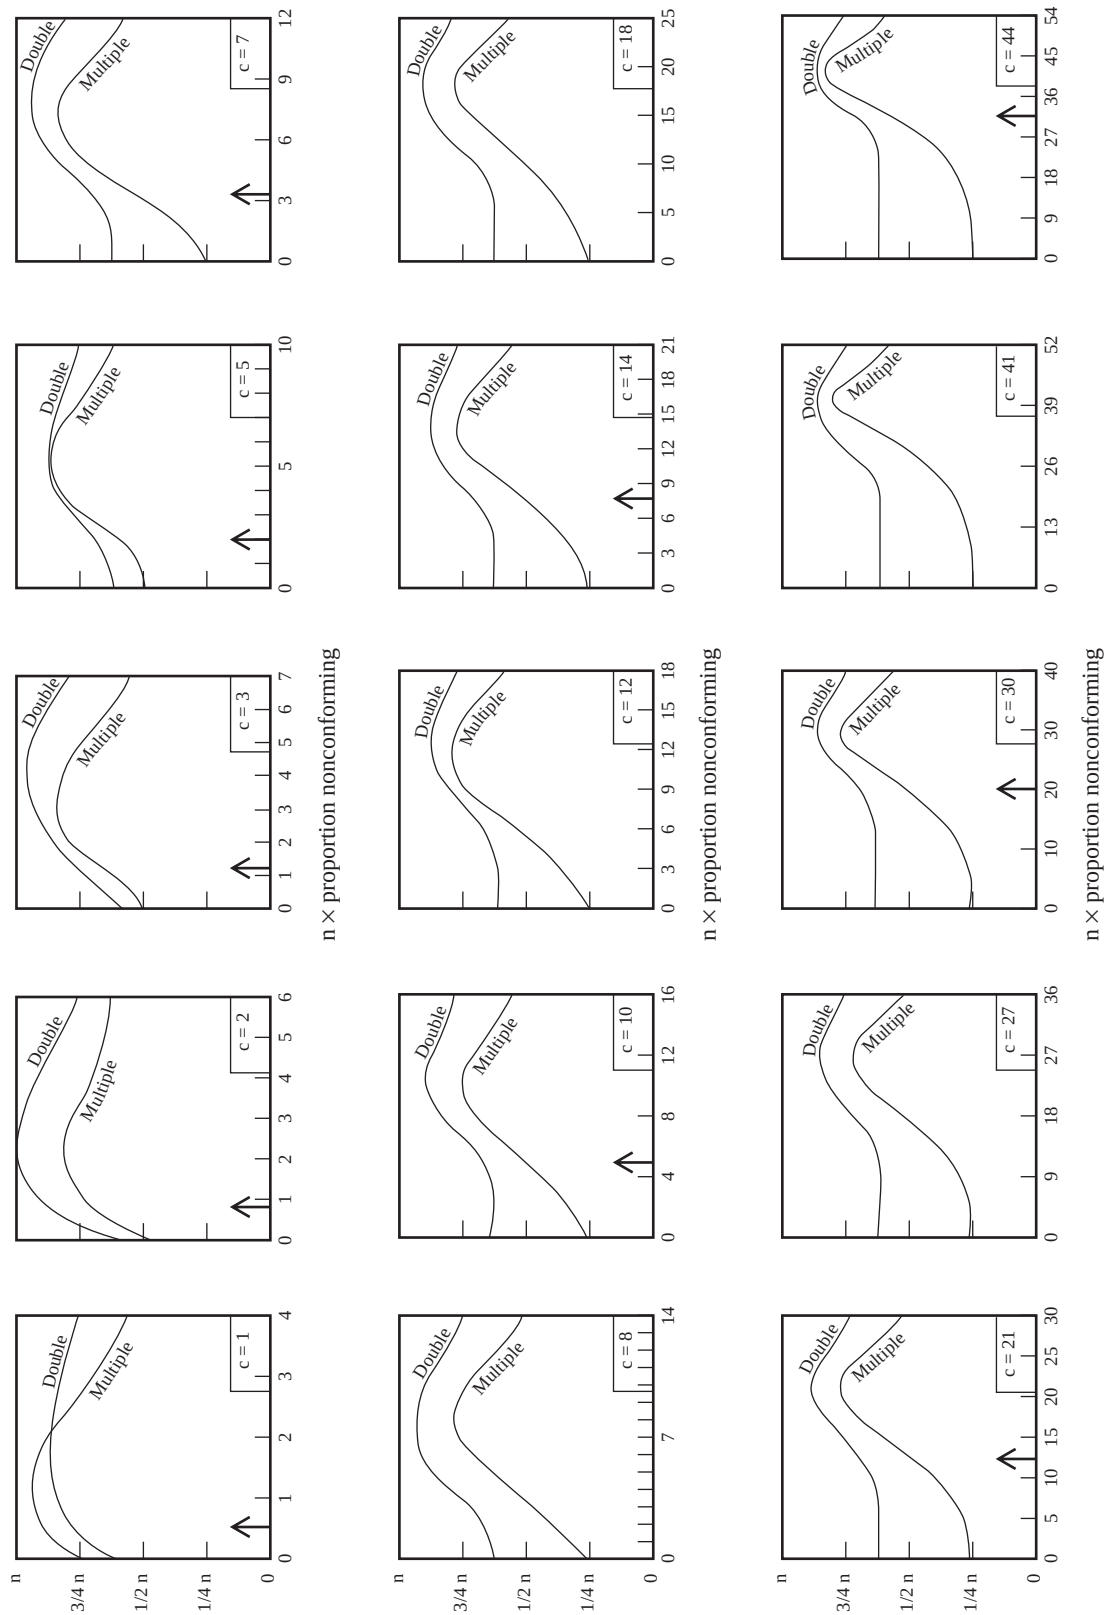

n = Equivalent single sample size


c = Single sample acceptance number

↑ = Reference point, shows performance at AQL for normal inspection

Table X-A—Tables for sample size code letter: A
INDIVIDUAL PLANS

PERCENT OF LOTS
EXPECTED TO BE
ACCEPTED (P_a)

CHART A—OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS
(Curves for double and multiple sampling are matched as closely as practicable)

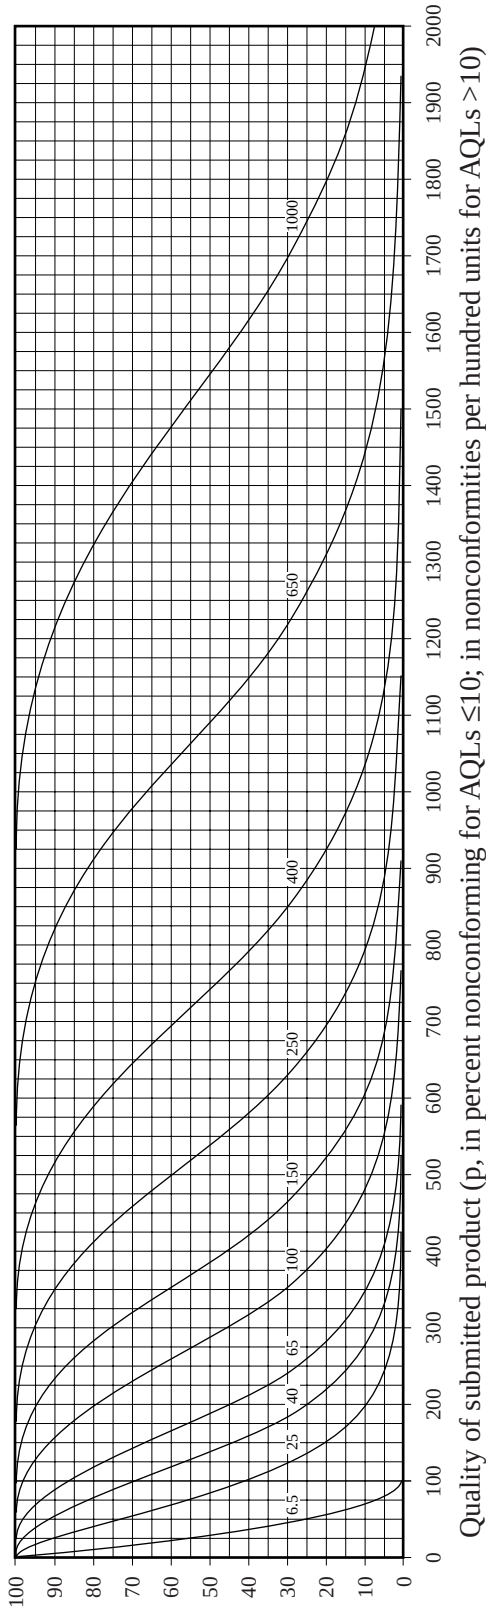

Note: Figures on curves are Acceptance Quality Limits (AQLs) for normal inspection.

TABLE X-A-1—TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS

P _a	Acceptance Quality Limits (normal inspection)														
	6.5	6.5	25	40	65	100	150	250	400	625	1000				
	p (in percent nonconforming)	p (in nonconformities per hundred units)													
99.0	0.501	0.503	7.43	21.8	41.2	89.3	145	175	239	305	374	517	629	859	977
95.0	2.53	2.56	17.8	40.9	68.3	131	199	235	308	384	462	622	745	995	1122
90.0	5.13	5.27	26.6	55.1	87.2	158	233	272	351	432	515	684	812	1073	1206
75.0	13.4	14.4	48.1	86.4	127	211	298	342	431	521	612	795	934	1214	1354
50.0	29.3	34.7	83.9	134	184	284	383	433	533	633	733	933	1083	1383	1533
25.0	50.0	69.3	135	196	255	371	484	540	651	761	870	1087	1248	1568	1728
10.0	68.4	115	194	266	334	464	589	650	770	889	1006	1238	1409	1748	1916
5.0	77.6	150	237	315	388	526	657	722	848	972	1094	1335	1512	1862	2035
1.0	90.0	230	332	420	502	655	800	870	1007	1141	1272	1529	1718	2088	2270
		✗	40	65	100	150	✗	250	✗	400	✗	650	✗	1000	✗
	Acceptance Quality Limits (tightened inspection)														

Note: Binomial distribution used for percent nonconforming computations; Poisson for nonconformities per hundred units.

Table X-A-2—Sampling Plans for Sample Size Code Letter: A

Type of sampling plan	Cumulative sample size	Acceptance Quality Limits (normal inspection)																	Cumulative sample size	
		Less than 6.5	6.5	X	10	15	25	40	65	100	150	X	250	X	400	X	650	X		1000
		Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re		Ac Re
		Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re		
Single	2	∇	0 1	Use Code Letter D	Use Code Letter C	Use Code Letter B	1 2	2 3	3 4	5 6	7 8	8 9	10 11	12 13	14 15	18 19	21 22	27 28	30 31	2
Double		∇	*				(*)	(*)	(*)	(*)	(*)	(*)	(*)	(*)	(*)	(*)	(*)	(*)	(*)	
Multiple		∇	*				*	*	*	*	*	*	*	*	*	*	*	*	*	
		Less than 10	X	10	15	25	40	65	100	150	X	250	X	400	X	650	X	1000	X	
		Acceptance Quality Limits (tightened inspection)																		

V = Use next subsequent sample size code letter for which acceptance and rejection numbers are available.

Ac = Acceptance number.

Re = Rejection number.


* = Use single sampling plan above (or alternatively use code letter D).

(*) = Use single sampling plan (or alternatively use code letter B).

Table X-B—Tables for sample size code letter: B
INDIVIDUAL PLANS

PERCENT OF LOTS
EXPECTED TO BE
ACCEPTED (P_a)

CHART B—OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS
(Curves for double and multiple sampling are matched as closely as practicable)

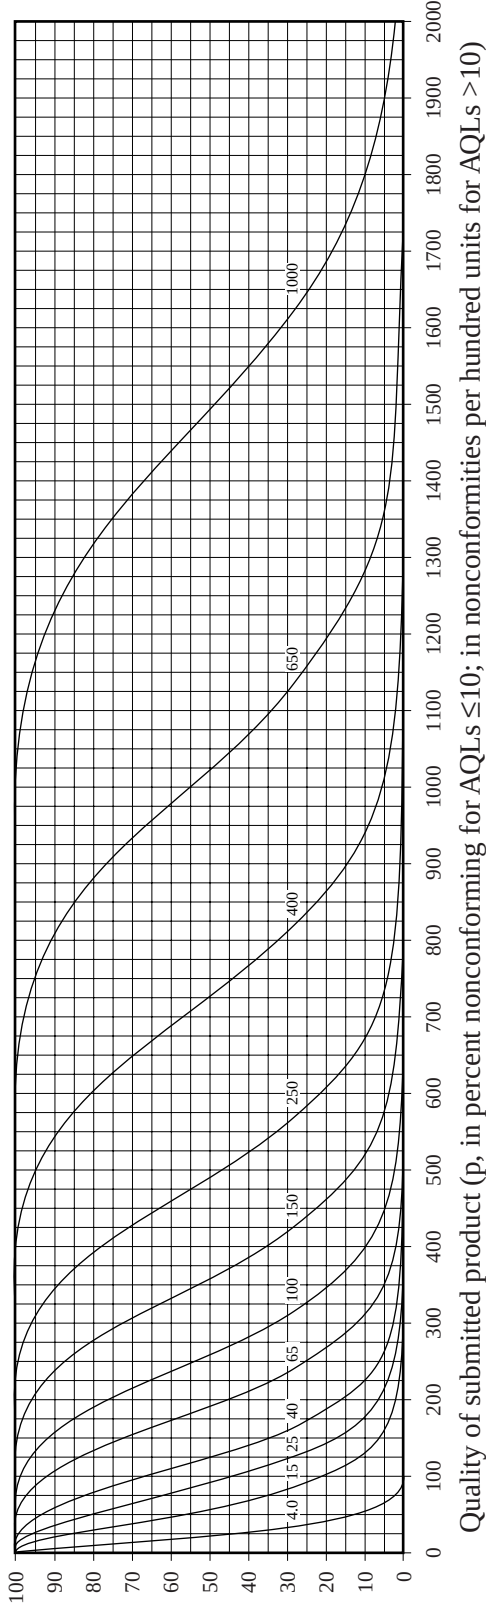

Note: Figures on curves are Acceptance Quality Limits (AQLs) for normal inspection.

TABLE X-B-1—TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS

P _a	Acceptance Quality Limits (normal inspection)																
	4.0	4.0	15	25	40	65	100	150	250	400	650	1000					
	p (in percent nonconforming)	p (in nonconformities per hundred units)															
99.0	0.33	0.335	4.95	14.5	27.4	59.5	96.9	117	159	203	249	345	419	572	651	947	1029
95.0	1.70	1.71	11.8	27.3	45.5	87.1	133	157	206	256	308	415	495	663	748	1065	1152
90.0	3.45	3.51	17.7	36.7	58.2	105	155	181	234	288	343	456	541	716	804	1131	1222
75.0	9.14	9.59	32.0	57.6	84.5	141	199	228	287	347	408	530	623	809	903	1249	1344
50.0	20.6	23.1	55.9	89.1	122	189	256	289	356	422	489	622	722	922	1022	1389	1489
25.0	37.0	46.2	89.8	131	170	247	323	360	434	507	580	724	832	1045	1152	1539	1644
10.0	53.6	76.8	130	177	223	309	392	433	514	593	671	825	939	1165	1277	1683	1793
5.0	63.2	99.9	158	210	258	350	438	481	565	648	730	890	1008	1241	1356	1773	1886
1.0	78.5	154	221	280	335	437	533	580	671	761	848	1019	1145	1392	1513	1951	2069
		6.5	25	40	65	100	150	250	400	650	1000						
		Acceptance Quality Limits (tightened inspection)															

Note: Binomial distribution used for percent nonconforming computations; Poisson for nonconformities per hundred units.

Table X-B-2—Sampling Plans for Sample Size Code Letter: B

Type of sampling plan	Cumulative sample size	Acceptance Quality Limits (normal inspection)															Cumulative sample size			
		Less than 4.0	4.0	6.5	10	15	25	40	65	100	150	250	400	650	1000					
		Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re					
Single	3	∇	0 1	Use Code Letter A	1 2	2 3	3 4	5 6	7 8	8 9	10 11	12 13	14 15	18 19	21 22	27 28	30 31	41 42	44 45	3
Double	2 4	∇	*	Use Code Letter D	0 2 1 2	0 3 3 4	1 4 4 5	2 5 6 7	3 7 8 9	3 7 11 12	5 9 12 13	6 10 15 16	7 11 18 19	9 14 23 24	11 16 26 27	15 20 34 35	17 22 37 38	23 29 52 53	25 31 56 57	2 4
Multiple		∇	*		+	+	+	+	+	+	+	+	+	+	+	+	+	+	+	
		Less than 6.5	6.5	×	10	15	25	40	65	100	150	250	400	650	1000	×	×	×	×	
Acceptance Quality Limits (tightened inspection)																				

∇ = Use next subsequent sample size code letter for which acceptance and rejection numbers are available.

Ac = Acceptance number.


Re = Rejection number.

* = Use single sampling plan above (or alternatively use code letter E).

+ = Use double sampling plan above (or alternatively use code letter D).

Table X-C—Tables for sample size code letter: C

CHART C—OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS
(Curves for double and multiple sampling are matched as closely as practicable)

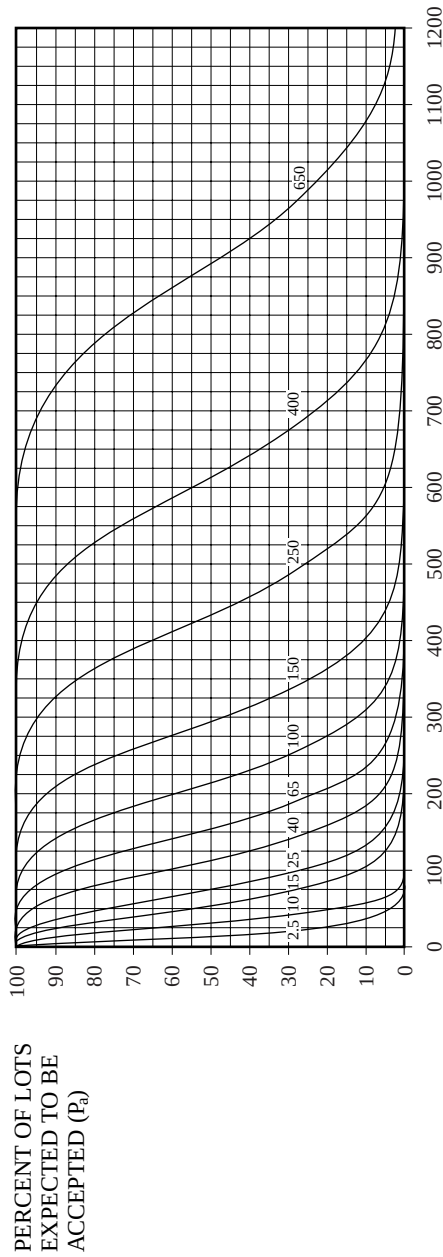

Quality of submitted product (p, in percent nonconforming for AQLs ≤ 10 ; in nonconformities per hundred units for AQLs > 10)

TABLE X-C-1—TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS

P _a	Acceptance Quality Limits (normal inspection)																	
	2.5	10	2.5	10	15	25	40	65	100	150	207	251	343	400	500	650		
	p (in percent nonconforming)		p (in nonconformities per hundred units)															
99.0	0.201	3.27	0.201	2.97	8.72	16.5	37.5	58.1	70.1	95.4	122	150	207	251	343	391	568	618
95.0	1.02	7.64	1.03	7.11	16.4	27.3	52.3	79.6	93.9	123	154	185	249	298	398	449	639	691
90.0	2.09	11.2	2.11	10.6	22.0	34.9	63.0	93.1	109	140	173	206	273	325	429	482	679	733
75.0	5.59	19.4	5.75	19.2	34.5	50.7	84.4	119	137	172	208	245	318	374	485	542	749	806
50.0	12.9	31.4	13.9	33.6	53.5	73.4	113	153	173	213	253	293	373	433	553	613	833	893
25.0	24.2	45.4	27.7	53.9	78.4	102	148	194	216	260	304	348	435	499	627	691	923	986
10.0	36.9	58.4	46.1	77.8	106	134	185	235	260	308	356	403	495	564	699	766	1010	1076
5.0	45.1	65.7	59.9	94.9	126	155	210	263	289	339	389	438	534	605	745	814	1064	1131
1.0	60.2	77.8	92.1	133	168	201	262	320	348	403	456	509	612	687	835	908	1171	1241
	4.0	✗	4.0	15	25	40	65	✗	100	✗	150	✗	250	✗	400	✗	650	✗
	Acceptance Quality Limits (tightened inspection)																	

Note: Binomial distribution used for percent nonconforming computations; Poisson for nonconformities per hundred units.

Table X-C-2—Sampling Plans for Sample Size Code Letter: C

Type of sampling plan	Cumulative sample size	Acceptance Quality Limits (normal inspection)															Cumulative sample size	
		Less than 2.5	2.5	4.0	6.5	10	15	25	40	65	100	150	250	400	650	1000		
Single	5	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	5	
Double	3	∇	0	Use Code Letter B	Use Code Letter E	1	2	3	4	5	6	7	8	9	10	11	3	
	6	∇	*	Use Code Letter B	Use Code Letter E	0	2	0	3	1	4	2	5	3	7	5	6	
Multiple		∇	*			+	+	+	+	+	+	+	+	+	+	+		
		Less than 4.0	4.0	6.5	10	15	25	40	65	100	150	250	400	650	1000			
Acceptance Quality Limits (tightened inspection)																		

∇ = Use next subsequent sample size code letter for which acceptance and rejection numbers are available.

Ac = Acceptance number.

Re = Rejection number.

* = Use single sampling plan above (or alternatively use code letter F).

+ = Use double sampling plan above (or alternatively use code letter D).

Table X-D—Tables for sample size code letter: D
INDIVIDUAL PLANS

PERCENT OF LOTS
EXPECTED TO BE
ACCEPTED (P_a)

CHART D—OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS
(Curves for double and multiple sampling are matched as closely as practicable)

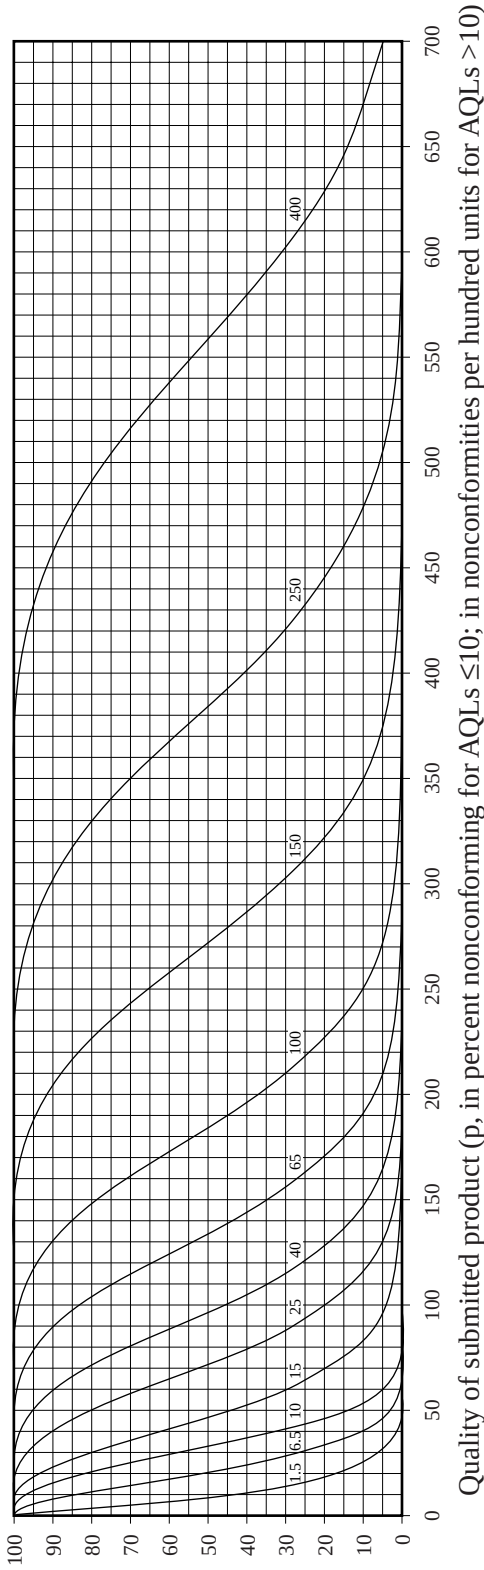


TABLE X-D-1—TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS

P _a	Acceptance Quality Limits (normal inspection)																		
	1.5	6.5	10	1.5	6.5	10	15	25	40	X	65	X	100	X	150	X	250	X	450
	p (in percent nonconforming)																		
p (in nonconformities per hundred units)																			
99.0	0.126	1.97	6.08	0.126	1.86	5.45	10.3	22.3	36.3	43.8	59.6	76.2	93.5	129	157	215	244	355	386
95.0	.0639	4.64	11.1	0.641	4.44	10.2	17.1	32.7	49.8	58.7	77.1	96.1	116	156	186	249	281	399	432
90.0	1.32	6.88	14.7	1.31	6.65	13.8	21.8	39.4	58.2	67.9	87.8	108	129	171	203	268	301	424	458
75.0	3.53	12.1	22.1	3.60	12.0	21.6	31.7	52.7	74.5	85.5	108	130	153	199	234	303	339	468	504
50.0	8.30	20.1	32.1	8.66	21.0	33.4	45.9	70.9	95.9	108	133	158	183	233	271	346	383	521	558
25.0	15.9	30.3	43.3	17.3	33.7	49.0	63.9	92.8	121	135	163	190	217	272	312	392	432	577	617
10.0	25.0	40.6	53.8	28.8	48.6	66.5	83.5	116	147	162	193	222	252	309	352	437	479	631	672
5.0	31.2	47.1	60.0	37.4	59.3	78.7	96.9	131	164	180	212	243	274	334	378	465	509	665	707
1.0	43.8	59.0	70.7	57.6	83.0	105	126	164	200	218	252	285	318	382	429	522	568	732	776
	2.5	10	X	2.5	10	15	25	40	X	65	X	100	X	150	X	250	X	400	X
	Acceptance Quality Limits (tightened inspection)																		

Note: Binomial distribution used for percent nonconforming computations; Poisson for nonconformities per hundred units.

Table X-D-2—Sampling Plans for Sample Size Code Letter: D

Type of sampling plan	Cumulative sample size	Acceptance Quality Limits (normal inspection)																		Cumulative sample size				
		Less than 1.5	1.5	2.5	4.0	6.5	10	15	25	40	65	100	150	250	400	Higher than 400								
		Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re								
Single	8	∇	0 1	Use Code Letter C	4.0	Ac Re	1 2	2 3	3 4	5 6	7 8	8 9	10 11	12 13	14 15	18 19	21 22	27 28	30 31	41 42	44 45	Δ	8	
Double	5 10	∇	*	Use Code Letter C	4.0	Ac Re	0 2	0 3	1 4	2 5	3 7	3 7	5 9	6 10	7 11	9 14	11 16	15 20	17 22	23 29	25 31	Δ	5 10	
								1 2	3 4	4 5	6 7	8 9	11 12	12 13	15 16	18 19	23 24	26 27	34 35	37 38	52 53			56 57
Multiple	2	∇	*		4.0	Ac Re	# 2	# 2	# 2	# 3	# 4	0 4	0 4	0 5	0 6	1 7	1 8	2 9	3 10	4 12	6 15	6 16	Δ	2
	4	# 2						0 3	0 3	1 5	1 6	2 7	3 8	3 9	4 10	6 12	7 14	10 17	11 19	16 25	17 26	4		
	6	0 2						0 3	1 4	2 6	3 8	4 9	6 10	7 12	8 13	11 17	13 19	17 24	19 27	26 36	29 39	6		
	8	0 3						1 4	2 5	3 7	5 10	6 11	8 13	10 15	12 17	16 22	19 25	24 31	27 34	37 46	40 49	8		
	10	1 3						2 4	3 6	5 8	7 11	9 12	11 15	14 17	17 20	22 25	25 29	32 37	36 40	49 55	53 58	10		
	12	1 3						3 5	4 6	7 9	10 12	12 14	14 17	18 20	21 23	27 29	31 33	40 43	45 47	61 64	65 68	12		
	14						2 3	4 5	6 7	9 10	13 14	14 15	18 19	21 22	25 26	32 33	37 38	48 49	53 54	72 73	77 78	14		
		Less than 2.5	2.5	4.0	6.5	10	15	25	40	65	100	150	250	400	Higher than 400									
Acceptance Quality Limits (tightened inspection)																								

Δ = Use next preceding sample size code letter for which acceptance and rejection numbers are available.

V = Use next subsequent sample size code letter for which acceptance and rejection numbers are available.

Ac = Acceptance number.

Re = Rejection number.


* = Use single sampling plan above (or alternatively use code letter G).

= Acceptance not permitted at this sample size.

Table X-E—Tables for sample size code letter: E
INDIVIDUAL PLANS

PERCENT OF LOTS
EXPECTED TO BE
ACCEPTED (P_a)

CHART E—OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS
(Curves for double and multiple sampling are matched as closely as practicable)

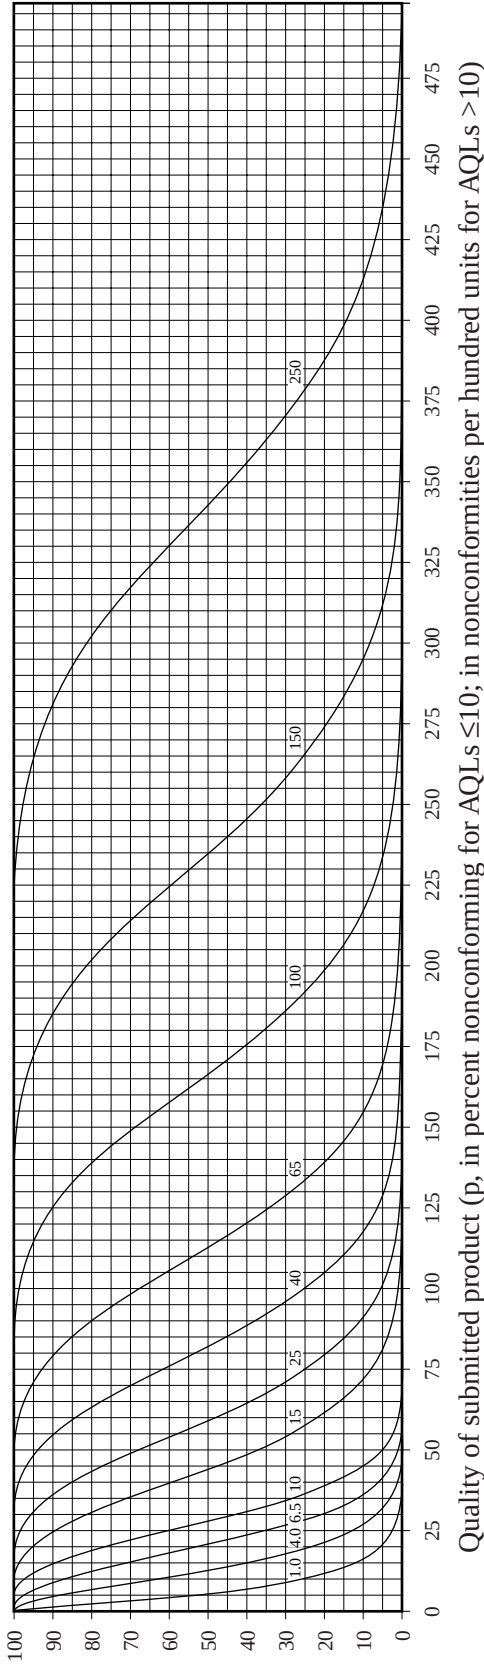

Note: Figures on curves are Acceptance Quality Limits (AQLs) for normal inspection.

TABLE X-E-1—TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS

P_a	Acceptance Quality Limits (normal inspection)														
	1.0	4.0	6.5	10	15	25	40	65	100	150	250	p (in percent nonconforming)			
	0.077	1.18	3.58	6.95	10.7	17.7	29.9	40.9	51.4	64.7	77.3	1.0	4.0	6.5	10
99.0	0.077	1.18	3.58	6.95	10.7	17.7	29.9	40.9	51.4	64.7	77.3	1.0	4.0	6.5	10
95.0	0.394	2.81	6.60	11.3	17.7	29.9	40.9	51.4	64.7	77.3	90.5	1.0	4.0	6.5	10
90.0	0.807	4.17	8.80	14.2	22.4	35.8	45.8	52.6	66.3	80.2	94.1	1.0	4.0	6.5	10
75.0	2.19	7.41	13.4	19.9	32.5	45.8	52.6	66.3	80.2	94.1	113	1.0	4.0	6.5	10
50.0	5.19	12.6	20.0	27.5	43.6	59.0	66.7	82.1	97.4	113	144	1.0	4.0	6.5	10
25.0	10.1	19.4	28.0	36.1	57.1	74.5	83.1	100	117	134	167	1.0	4.0	6.5	10
10.0	16.2	26.8	36.0	44.4	71.3	90.5	100	119	137	155	190	1.0	4.0	6.5	10
5.0	20.6	31.6	41.0	49.5	80.9	101	111	130	150	168	205	1.0	4.0	6.5	10
1.0	29.8	41.3	50.6	58.8	101	123	134	155	176	196	235	1.0	4.0	6.5	10
1.5	6.5	10	10	X	25	X	40	X	65	X	100	1.0	4.0	6.5	10
Acceptance Quality Limits (tightened inspection)															
99.0	0.077	1.18	3.58	6.95	10.7	17.7	29.9	40.9	51.4	64.7	77.3	1.0	4.0	6.5	10
95.0	0.394	2.81	6.60	11.3	17.7	29.9	40.9	51.4	64.7	77.3	90.5	1.0	4.0	6.5	10
90.0	0.807	4.17	8.80	14.2	22.4	35.8	45.8	52.6	66.3	80.2	94.1	1.0	4.0	6.5	10
75.0	2.19	7.41	13.4	19.9	32.5	45.8	52.6	66.3	80.2	94.1	113	1.0	4.0	6.5	10
50.0	5.19	12.6	20.0	27.5	43.6	59.0	66.7	82.1	97.4	113	144	1.0	4.0	6.5	10
25.0	10.1	19.4	28.0	36.1	57.1	74.5	83.1	100	117	134	167	1.0	4.0	6.5	10
10.0	16.2	26.8	36.0	44.4	71.3	90.5	100	119	137	155	190	1.0	4.0	6.5	10
5.0	20.6	31.6	41.0	49.5	80.9	101	111	130	150	168	205	1.0	4.0	6.5	10
1.0	29.8	41.3	50.6	58.8	101	123	134	155	176	196	235	1.0	4.0	6.5	10
1.5	6.5	10	10	X	25	X	40	X	65	X	100	1.0	4.0	6.5	10

Note: Binomial distribution used for percent nonconforming computations; Poisson for nonconformities per hundred units.

Table X-E-2—Sampling Plans for Sample Size Code Letter: E

Type of sampling plan	Cumulative sample size	Acceptance Quality Limits (normal inspection)																	Cumulative sample size			
		Less than 1.0	1.0	1.5	2.5	4.0	6.5	10	15	25	40	65	100	150	250	Higher than 250						
		Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re					
Single	13	V	0 1			1 2	2 3	3 4	5 6	7 8	8 9	10 11	12 13	14 15	18 19	21 22	27 28	30 31	41 42	44 45	Δ	13
	8 13	V	*	Use Code Letter D	Use Code Letter G	0 2 1 2	0 3 3 4	1 4 4 5	2 5 6 7	3 7 8 9	3 7 11 12	5 9 12 13	6 10 15 16	7 11 18 19	9 14 23 24	11 16 26 27	15 20 34 35	17 22 37 38	23 29 52 53	25 31 56 57	Δ	8 13
Multiple	3 6 9 12 15 18 21	V	*			# 2 # 2 0 2 0 3 0 3	# 2 0 3 0 3 1 4 1 4	# 3 0 3 1 4 2 5 2 5	# 4 1 5 2 6 3 7 3 7	0 4 1 6 3 8 5 10 7 11	0 4 2 7 4 9 6 11 9 12	0 5 3 8 6 10 8 13 11 15	0 6 3 9 7 12 10 15 14 17	1 7 4 10 8 13 12 17 17 20	1 8 6 12 11 17 16 22 22 25	2 9 7 14 13 19 19 25 25 29	3 10 10 17 17 24 24 31 32 37	4 12 11 19 19 27 27 34 36 40	6 15 16 25 26 36 37 46 49 55	6 16 17 27 29 39 40 49 53 58	Δ	3 6 9 12 15 18 21
		Less than 1.5	1.5	X	2.5	4.0	6.5	10	15	25	X	40	X	65	X	100	X	150	X	250	X	Higher than 250
	Acceptance Quality Limits (tightened inspection)																					

Δ = Use next preceding sample size code letter for which acceptance and rejection numbers are available.

V = Use next subsequent sample size code letter for which acceptance and rejection numbers are available.

Ac = Acceptance number.

Re = Rejection number.

* = Use single sampling plan above (or alternatively use code letter H).

= Acceptance not permitted at this sample size.

Table X-F—Tables for sample size code letter: F
INDIVIDUAL PLANS

PERCENT OF LOTS
EXPECTED TO BE
ACCEPTED (P_a)

CHART F—OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS
(Curves for double and multiple sampling are matched as closely as practicable)

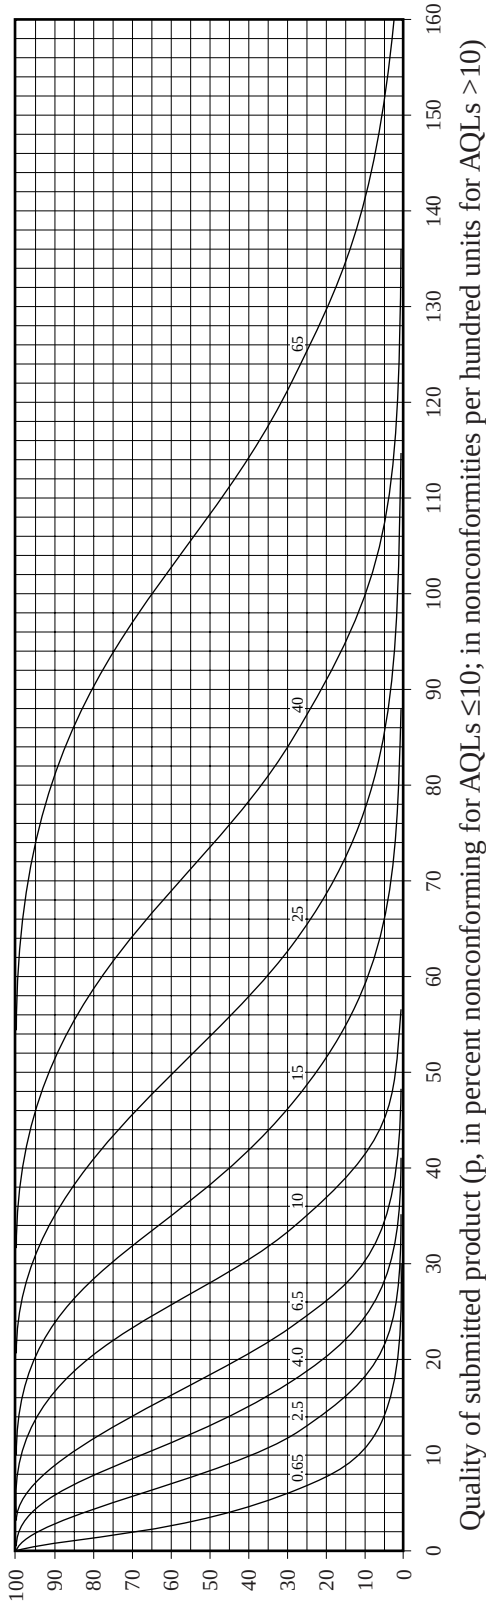


TABLE X-F-1—TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS

P_a	Acceptance Quality Limits (normal inspection)														
	0.65	2.5	4.0	6.5	10	6.5	10	15	25	40	65	p (in nonconformities per hundred units)			
	p (in percent nonconforming)					0.65	2.5	4.0	6.5	10	15				
99.0	0.0502	0.759	2.27	4.36	9.75	0.0503	0.743	2.18	4.12	8.93	14.5	17.5	23.9	30.5	37.4
95.0	0.256	1.80	4.22	7.14	14.0	0.256	1.78	4.09	6.83	13.1	19.9	23.5	30.8	38.4	46.2
90.0	0.525	2.69	5.64	9.03	16.6	0.527	2.66	5.51	8.72	15.8	23.3	27.2	35.1	43.2	51.5
75.0	1.43	4.81	8.70	12.8	21.6	1.44	4.81	8.65	12.7	21.1	29.8	34.2	43.1	52.1	61.2
50.0	3.41	8.25	13.1	18.1	27.9	3.47	8.39	13.4	18.4	28.4	38.3	43.3	53.3	63.3	73.3
25.0	6.70	12.9	18.7	24.2	34.8	6.93	13.5	19.6	25.5	37.1	48.4	54.0	65.1	76.1	87.0
10.0	10.9	18.1	24.5	30.4	41.5	11.5	19.4	26.6	33.4	46.4	58.9	65.0	77.0	88.9	101
5.0	13.9	21.6	28.3	34.4	45.6	15.0	23.7	31.5	38.8	52.6	65.7	72.2	84.8	97.2	109
1.0	20.6	28.9	35.8	42.1	53.2	23.0	33.2	42.0	50.2	65.5	80.0	87.0	101	114	127
	1.0	4.0	6.5	10	X	1.0	4.0	6.5	10	15	X	25	X	40	X
Acceptance Quality Limits (tightened inspection)															

Note: Binomial distribution used for percent nonconforming computations; Poisson for nonconformities per hundred units.

Table X-F-2—Sampling Plans for Sample Size Code Letter: F

Type of sampling plan	Cumulative sample size	Acceptance Quality Limits (normal inspection)																Cumulative sample size	
		Less than 0.65	0.65	1.0	1.5	2.5	4.0	6.5	10	15	25	40	65	Higher than 65					
		Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re					
Single	20	∇	0 1	Use Code Letter E	Use Code Letter H	Use Code Letter G	1 2	2 3	3 4	5 6	7 8	8 9	10 11	12 13	14 15	18 19	21 22	Δ	20
	13 26	∇	*				0 2	0 3	1 4	2 5	3 7	3 7	5 9	6 10	7 11	9 14	11 16	Δ	13 26
Multiple	5	∇	*				# 2	# 2	# 3	# 4	0 4	0 4	0 5	0 6	1 7	1 8	2 9	Δ	5
	10						# 2	0 3	0 3	1 5	1 6	2 7	3 8	3 9	4 10	6 12	7 14		10
	15						0 2	0 3	1 4	2 6	3 8	4 9	6 10	7 12	8 13	11 17	13 19		15
	20						0 3	1 4	2 5	3 7	5 10	6 11	8 13	10 15	12 17	16 22	19 25		20
	25						1 3	2 4	3 6	5 8	7 11	9 12	11 15	14 17	17 20	22 25	25 29		25
	30						1 3	3 5	4 6	7 9	10 12	12 14	14 17	18 20	21 23	27 29	31 33		30
	35						2 3	4 5	6 7	9 10	13 14	14 15	18 19	21 22	25 26	32 33	37 38		35
		Less than 1.0	1.0	1.5	2.5	4.0	6.5	10	15	25	40	65	Higher than 65						
Acceptance Quality Limits (tightened inspection)																			

- Δ = Use next preceding sample size code letter for which acceptance and rejection numbers are available.
 ∇ = Use next subsequent sample size code letter for which acceptance and rejection numbers are available.
 Ac = Acceptance number.
 Re = Rejection number.
 * = Use single sampling plan above (or alternatively use code letter H).
 # = Acceptance not permitted at this sample size.

Table X-G-2—Sampling Plans for Sample Size Code Letter: G

Type of sampling plan	Cumulative sample size	Acceptance Quality Limits (normal inspection)														Cumulative sample size			
		Less than 0.40	0.40	0.65	X	1.0	1.5	2.5	4.0	6.5	10	X	15	X	25		X	40	Higher than 40
Single	32	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re
		∇	0 1				1 2	2 3	3 4	5 6	7 8	8 9	10 11	12 13	14 15	18 19	21 22	Δ	
Double	20 40	∇	*	Use Code Letter F	Use Code Letter J	Use Code Letter H												Δ	
							0 2	0 3	1 4	2 5	3 7	3 7	5 9	6 10	7 11	9 14	11 16		
Multiple	8 16 24 32 40 48 56	∇	*				# 2	# 2	# 3	# 4	0 4	0 4	0 5	0 6	1 7	1 8	2 9	Δ	
							# 2	0 3	0 3	1 5	1 6	2 7	3 8	3 9	4 10	6 12	7 14		
							0 2	0 3	1 4	2 6	3 8	4 9	6 10	7 12	8 13	11 17	13 19		
							0 3	1 4	2 5	3 7	5 10	6 11	8 13	10 15	12 17	16 22	19 25		
							1 3	2 4	3 6	5 8	7 11	9 12	11 15	14 17	17 20	22 25	25 29		
							1 3	3 5	4 6	7 9	10 12	12 14	14 17	18 20	21 23	27 29	31 33		
							2 3	4 5	6 7	9 10	13 14	14 15	18 19	21 22	25 26	32 33	37 38		
		Less than 0.65	0.65	X	1.0	1.5	2.5	4.0	6.5	10	X	15	25	X	40	X	Higher than 40		
		Acceptance Quality Limits (tightened inspection)																	

Δ = Use next preceding sample size code letter for which acceptance and rejection numbers are available.

∇ = Use next subsequent sample size code letter for which acceptance and rejection numbers are available.

Ac = Acceptance number.

Re = Rejection number.


* = Use single sampling plan above (or alternatively use code letter K).

= Acceptance not permitted at this sample size.

Table X-H—Tables for sample size code letter: H
INDIVIDUAL PLANS

PERCENT OF LOTS
EXPECTED TO BE
ACCEPTED (P_a)

CHART H—OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS
(Curves for double and multiple sampling are matched as closely as practicable)

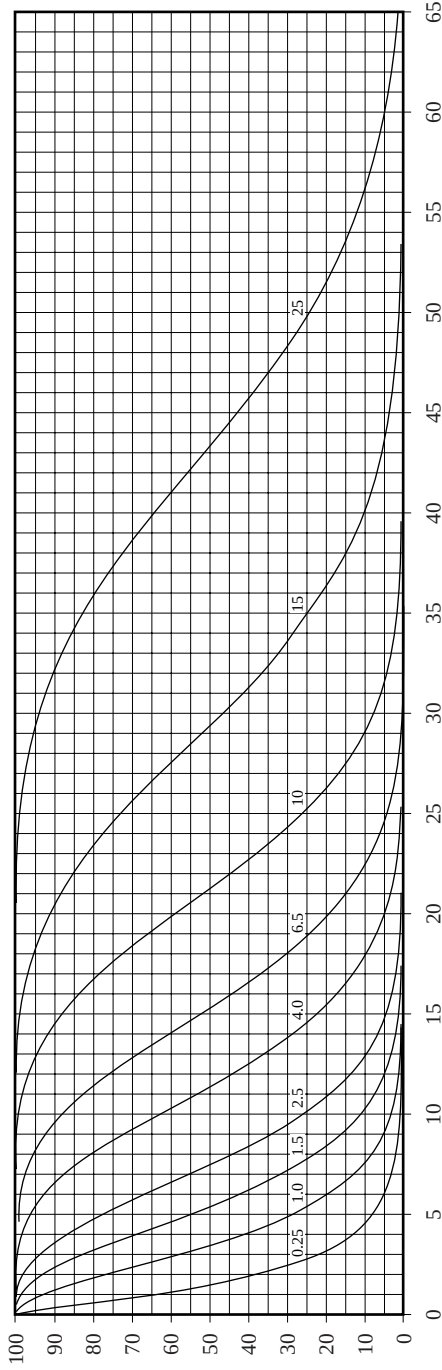

Quality of submitted product (p , in percent nonconforming for $AQLs \leq 10$; in nonconformities per hundred units for $AQLs > 10$)
Note: Figures on curves are Acceptance Quality Limits (AQLs) for normal inspection.

TABLE X-H-1—TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS

P_a	Acceptance Quality Limits (normal inspection)														
	0.25	1.0	1.5	2.5	4.0	6.5	10	15	25	40	50	60	70	80	90
	p (in percent nonconforming)														
P_a	p (in nonconformities per hundred units)														
	0.0201	0.300	0.886	1.68	3.69	6.07	7.36	10.1	0.0201	0.297	0.872	1.65	3.57	5.81	7.01
	0.0201	0.300	0.886	1.68	3.69	6.07	7.36	10.1	0.0201	0.297	0.872	1.65	3.57	5.81	7.01
	0.0201	0.300	0.886	1.68	3.69	6.07	7.36	10.1	0.0201	0.297	0.872	1.65	3.57	5.81	7.01
	0.0201	0.300	0.886	1.68	3.69	6.07	7.36	10.1	0.0201	0.297	0.872	1.65	3.57	5.81	7.01
	0.0201	0.300	0.886	1.68	3.69	6.07	7.36	10.1	0.0201	0.297	0.872	1.65	3.57	5.81	7.01
	0.0201	0.300	0.886	1.68	3.69	6.07	7.36	10.1	0.0201	0.297	0.872	1.65	3.57	5.81	7.01
	0.0201	0.300	0.886	1.68	3.69	6.07	7.36	10.1	0.0201	0.297	0.872	1.65	3.57	5.81	7.01
	0.0201	0.300	0.886	1.68	3.69	6.07	7.36	10.1	0.0201	0.297	0.872	1.65	3.57	5.81	7.01
	0.0201	0.300	0.886	1.68	3.69	6.07	7.36	10.1	0.0201	0.297	0.872	1.65	3.57	5.81	7.01
	0.0201	0.300	0.886	1.68	3.69	6.07	7.36	10.1	0.0201	0.297	0.872	1.65	3.57	5.81	7.01
Acceptance Quality Limits (tightened inspection)															
P_a	0.040	1.5	2.5	4.0	6.5	10	15	25	40	50	60	70	80	90	95
	0.040	1.5	2.5	4.0	6.5	10	15	25	40	50	60	70	80	90	95
	0.040	1.5	2.5	4.0	6.5	10	15	25	40	50	60	70	80	90	95
	0.040	1.5	2.5	4.0	6.5	10	15	25	40	50	60	70	80	90	95
	0.040	1.5	2.5	4.0	6.5	10	15	25	40	50	60	70	80	90	95
	0.040	1.5	2.5	4.0	6.5	10	15	25	40	50	60	70	80	90	95
	0.040	1.5	2.5	4.0	6.5	10	15	25	40	50	60	70	80	90	95
	0.040	1.5	2.5	4.0	6.5	10	15	25	40	50	60	70	80	90	95
	0.040	1.5	2.5	4.0	6.5	10	15	25	40	50	60	70	80	90	95
	0.040	1.5	2.5	4.0	6.5	10	15	25	40	50	60	70	80	90	95
	0.040	1.5	2.5	4.0	6.5	10	15	25	40	50	60	70	80	90	95

Note: Binomial distribution used for percent nonconforming computations; Poisson for nonconformities per hundred units.

Table X-H-2—Sampling Plans for Sample Size Code Letter: H

Type of sampling plan	Cumulative sample size	Acceptance Quality Limits (normal inspection)															Cumulative sample size					
		Less than 0.25	0.25	0.40	0.65	1.0	1.5	2.5	4.0	6.5	10	15	25	Higher than 25								
		Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re								
		Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re								
Single	50	∇	0 1	Use Code Letter G	Use Code Letter K	Use Code Letter J	1 2	2 3	3 4	5 6	7 8	8 9	10 11	12 13	14 15	18 19	21 22	Δ				
Double	32 64	∇	*	Use Code Letter G	Use Code Letter K	Use Code Letter J	0 2	0 3	1 4	2 5	3 7	3 7	5 9	6 10	7 11	9 14	11 16	Δ				
Multiple	13 26 39 52 65 78 91	∇	*	Use Code Letter G	Use Code Letter K	Use Code Letter J	# 2	# 2	# 3	# 4	0 4	0 4	0 4	0 5	0 6	1 7	1 8	2 9	Δ			
		Less than 0.40	0.40	0.65	1.0	1.5	2.5	4.0	6.5	10	15	25	Higher than 25									
		Acceptance Quality Limits (tightened inspection)																				

Δ = Use next preceding sample size code letter for which acceptance and rejection numbers are available.

∇ = Use next subsequent sample size code letter for which acceptance and rejection numbers are available.

Ac = Acceptance number.


Re = Rejection number.

* = Use single sampling plan above (or alternatively use code letter L).

= Acceptance not permitted at this sample size.

PERCENT OF LOTS
EXPECTED TO BE
ACCEPTED (P_a)

CHART J—OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS
(Curves for double and multiple sampling are matched as closely as practicable)

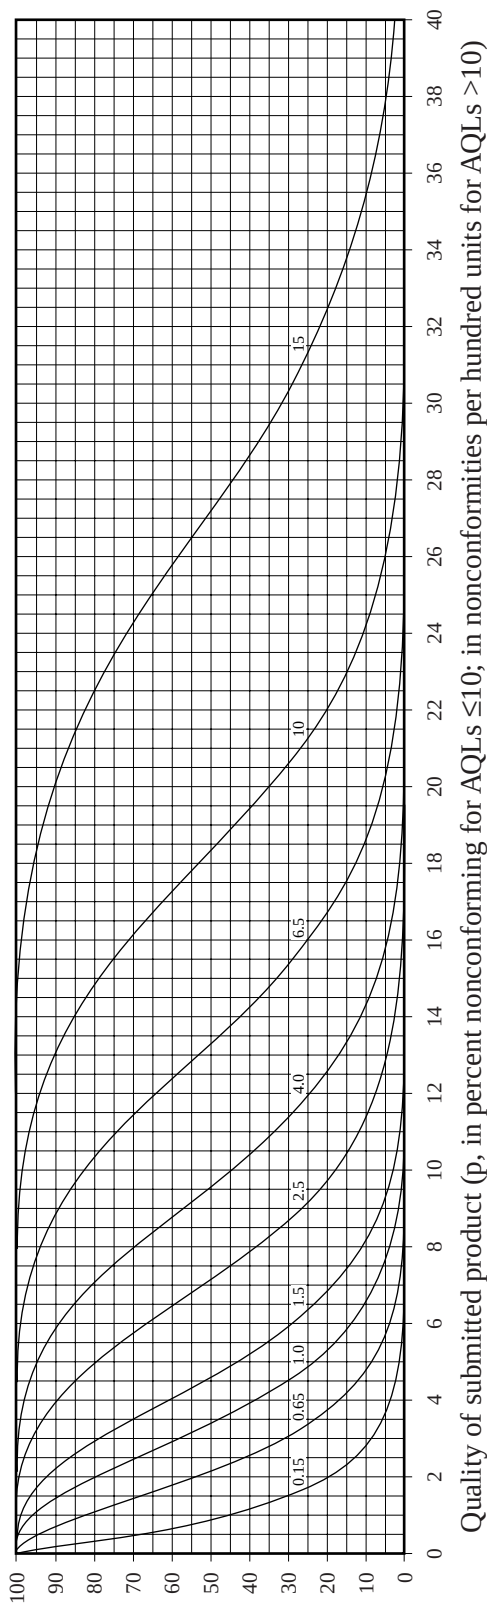

J

TABLE X-J-1—TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS

Acceptance Quality Limits (normal inspection)																						
P _a	0.15	0.65	1.0	1.5	2.5	4.0	X	6.5	10	0.15	0.65	1.0	1.5	2.5	4.0	X	6.5	10	X	15		
	p (in percent nonconforming)									p (in nonconformities per hundred units)												
99.0	0.0126	0.187	0.550	1.04	2.28	3.73	4.51	6.17	7.93	9.76	0.0126	0.186	0.545	1.03	2.23	3.63	4.38	5.96	7.62	9.35	12.9	15.7
95.0	0.0641	0.446	1.03	1.73	3.32	5.07	6.00	7.91	9.89	11.9	0.064	0.444	1.02	1.71	3.27	4.98	5.87	7.71	9.61	11.6	15.6	18.6
90.0	0.132	0.667	1.39	2.20	3.99	5.91	6.90	8.95	11.0	13.2	0.132	0.665	1.38	2.18	3.94	5.82	6.79	8.78	10.8	12.9	17.1	20.3
75.0	0.359	1.201	2.16	3.18	5.30	7.50	8.61	10.9	13.2	15.5	0.360	1.20	2.16	3.17	5.27	7.45	8.55	10.8	13.0	15.3	19.9	23.4
50.0	0.863	2.09	3.33	4.57	7.06	9.55	10.8	13.3	15.8	18.3	0.866	2.10	3.34	4.59	7.09	9.59	10.8	13.3	15.8	18.3	23.3	27.1
25.0	1.72	3.33	4.84	6.30	9.14	11.9	13.3	16.0	18.6	21.3	1.73	3.37	4.90	6.39	9.28	12.1	13.5	16.3	19.0	21.7	27.2	31.2
10.0	2.84	4.78	6.52	8.16	11.3	14.3	15.7	18.6	21.4	24.2	2.88	4.86	6.65	8.35	11.6	14.7	16.2	19.3	22.2	25.2	30.9	35.2
5.0	3.68	5.79	7.66	9.41	12.7	15.8	17.3	20.3	23.2	26.0	3.74	5.93	7.87	9.69	13.1	16.4	18.0	21.2	24.3	27.4	33.4	37.8
1.0	5.59	8.01	10.1	12.0	15.6	18.9	20.5	23.6	26.6	29.5	5.76	8.30	10.5	12.6	16.4	20.0	21.8	25.2	28.5	31.8	38.2	42.9
	0.25	1.0	1.5	2.5	4.0	X	6.5	X	10	X	0.25	1.0	1.5	2.5	4.0	X	6.5	X	10	X	15	X
Acceptance Quality Limits (tightened inspection)																						

Note: Binomial distribution used for percent nonconforming computations; Poisson for nonconformities per hundred units.

Table X-J-2—Sampling Plans for Sample Size Code Letter: J

Type of sampling plan	Cumulative sample size	Acceptance Quality Limits (normal inspection)															Cumulative sample size		
		Less than 0.15	0.15	0.25	0.40	0.65	1.0	1.5	2.5	4.0	6.5	10	15	Higher than 15					
		Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re					
Single	80	∇	0 1		Use Code Letter L	Use Code Letter K	1 2	2 3	3 4	5 6	7 8	8 9	10 11	12 13	14 15	18 19	21 22	Δ	80
Double	50 100	∇	*		Use Code Letter H		0 2	0 3	1 4	2 5	3 7	3 7	5 9	6 10	7 11	9 14	11 16	Δ	50 100
Multiple	20	∇	*				# 2	# 2	# 3	# 4	0 4	0 4	0 5	0 6	1 7	1 8	2 9	Δ	20
	40						# 2	0 3	0 3	1 5	1 6	2 7	3 8	3 9	4 10	6 12	7 14		40
	60						0 2	0 3	1 4	2 6	3 8	4 9	6 10	7 12	8 13	11 17	13 19		60
	80						0 3	1 4	2 5	3 7	5 10	6 11	8 13	10 15	12 17	16 22	19 25		80
	100						1 3	2 4	3 6	5 8	7 11	9 12	11 15	14 17	17 20	22 25	25 29		100
	120						1 3	3 5	4 6	7 9	10 12	12 14	14 17	18 20	21 23	27 29	31 33		120
	140						2 3	4 5	6 7	9 10	13 14	14 15	18 19	21 22	25 26	32 33	37 38		140
		Less than 0.25	0.25	0.40	0.65	1.0	1.5	2.5	4.0	6.5	10	15	Higher than 15						
Acceptance Quality Limits (tightened inspection)																			

Δ = Use next preceding sample size code letter for which acceptance and rejection numbers are available.

∇ = Use next subsequent sample size code letter for which acceptance and rejection numbers are available.

Ac = Acceptance number.

Re = Rejection number.

* = Use single sampling plan above (or alternatively use code letter M).

= Acceptance not permitted at this sample size.

Table X-K—Tables for sample size code letter: K
INDIVIDUAL PLANS

CHART K—OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS
(Curves for double and multiple sampling are matched as closely as practicable)

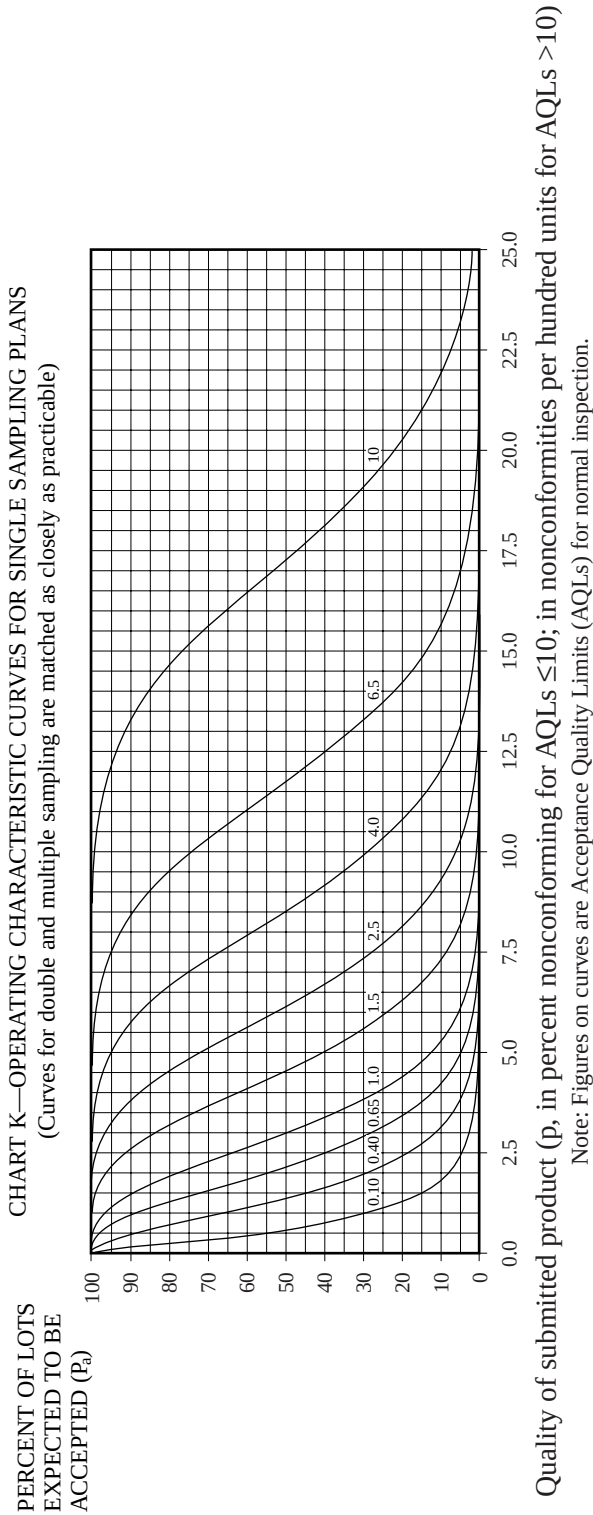


TABLE X-K-1—TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS

P _a	Acceptance Quality Limits (normal inspection)										
	0.10	0.40	0.65	1.0	1.5	2.5	4.0	6.5	10		
	p (in percent nonconforming or nonconformities per hundred units)										
99.0	0.00804	0.119	0.349	0.659	1.43	2.32	2.81	3.82	4.88	5.98	8.28
95.0	0.0410	0.284	0.654	1.09	2.09	3.18	3.76	4.94	6.15	7.40	9.95
90.0	0.0843	0.425	0.882	1.40	2.52	3.72	4.35	5.62	6.92	8.24	10.9
75.0	0.230	0.769	1.38	2.03	3.38	4.76	5.47	6.90	8.34	9.79	12.7
50.0	0.555	1.34	2.14	2.94	4.54	6.14	6.94	8.53	10.1	11.7	14.9
25.0	1.11	2.15	3.14	4.09	5.94	7.75	8.64	10.4	12.2	13.9	17.4
10.0	1.84	3.11	4.26	5.34	7.42	9.42	10.4	12.3	14.2	16.1	19.8
5.0	2.40	3.80	5.04	6.20	8.41	10.5	11.5	13.6	15.6	17.5	21.4
1.0	3.68	5.31	6.72	8.04	10.5	12.8	13.9	16.1	18.3	20.4	24.5
	0.15	0.65	1.0	1.5	2.5	X	4.0	X	6.5	X	10
	Acceptance Quality Limits (tightened inspection)										
											X

Note: Values given in the table above are based on the Poisson distribution as an approximation to the binomial distribution (See 11.1 for details)

Table X-K-2—Sampling Plans for Sample Size Code Letter: K

Type of sampling plan	Cumulative sample size	Acceptance Quality Limits (normal inspection)														Cumulative sample size
		Less than 0.10	0.10	0.15	0.25	0.40	0.65	1.0	1.5	2.5	4.0	6.5	10	Higher than 10		
		Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re		
Single	125	∇	0 1											Δ	125	
Double	80 160	∇	*											Δ	80 160	
Multiple	32	∇	*											Δ	32	
	64														64	
	96														96	
	128														128	
	160														160	
	192														192	
	224														224	
		Less than 0.15	0.15	0.25	0.40	0.65	1.0	1.5	2.5	4.0	6.5	10	Higher than 10			
Acceptance Quality Limits (tightened inspection)																

Δ = Use next preceding sample size code letter for which acceptance and rejection numbers are available.

∇ = Use next subsequent sample size code letter for which acceptance and rejection numbers are available.

Ac = Acceptance number.

Re = Rejection number.

* = Use single sampling plan above (or alternatively use code letter N).

= Acceptance not permitted at this sample size.

Table X-L—Tables for sample size code letter: L
INDIVIDUAL PLANS

PERCENT OF LOTS
EXPECTED TO BE
ACCEPTED (P_a)

CHART L—OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS
(Curves for double and multiple sampling are matched as closely as practicable)

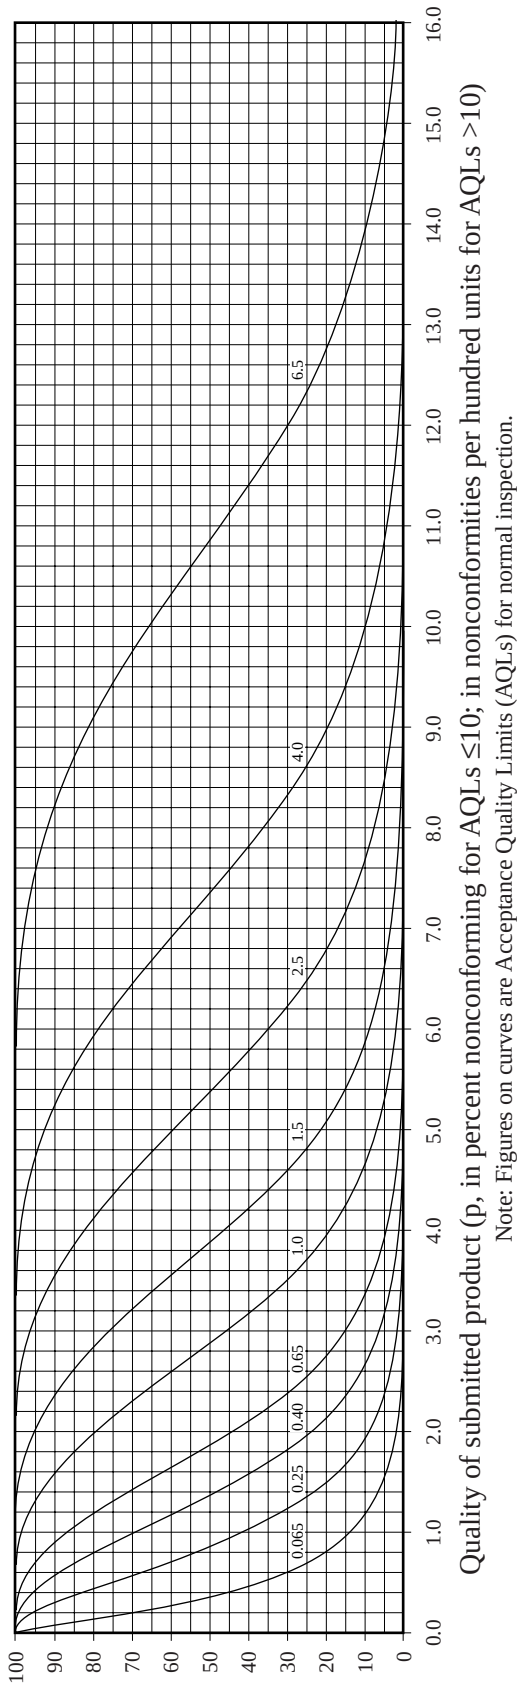


TABLE X-L-1—TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS

P _a	Acceptance Quality Limits (normal inspection)											
	0.065	0.25	0.40	0.65	1.0	1.5	2.5	4.0	6.5			
	p (in percent nonconforming or nonconformities per hundred units)											
99.0	0.00503	0.0743	0.218	0.412	0.893	1.45	1.75	2.39	3.05	3.74	5.17	6.29
95.0	0.0256	0.178	0.409	0.683	1.31	1.99	2.35	3.08	3.84	4.62	6.22	7.45
90.0	0.0527	0.266	0.551	0.872	1.58	2.33	2.72	3.51	4.32	5.15	6.84	8.12
75.0	0.144	0.481	0.864	1.27	2.11	2.98	3.42	4.31	5.21	6.12	7.95	9.34
50.0	0.347	0.839	1.34	1.84	2.84	3.83	4.33	5.33	6.33	7.33	9.33	10.8
25.0	0.693	1.35	1.96	2.55	3.71	4.84	5.40	6.51	7.61	8.70	10.9	12.5
10.0	1.15	1.94	2.66	3.34	4.64	5.89	6.50	7.70	8.89	10.1	12.4	14.1
5.0	1.50	2.37	3.15	3.88	5.26	6.57	7.22	8.48	9.72	10.9	13.3	15.1
1.0	2.30	3.32	4.20	5.02	6.55	8.00	8.70	10.1	11.4	12.7	15.3	17.2
	1.0	0.40	0.65	1.0	1.5	2.5	4.0	6.5	10.0	15.0	20.0	25.0
	Acceptance Quality Limits (tightened inspection)											

Note: Values given in the table above are based on the Poisson distribution as an approximation to the binomial distribution (See 11.1 for details)

Table X-L-2—Sampling Plans for Sample Size Code Letter: L

Type of sampling plan		Cumulative sample size	Acceptance Quality Limits (normal inspection)														Cumulative sample size		
			Less than 0.065	0.065	0.10	0.15	0.25	0.40	0.65	1.0	1.5	2.5	4.0	6.5	Higher than 6.5				
Single		200	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Δ	200	
Double		125 250	∇	*	Use Code Letter K	Use Code Letter N	Use Code Letter M	0 2	0 3	1 4	2 5	3 7	3 7	5 9	6 10	7 11	9 14	11 16	125 250
						1 2	3 4	4 5	6 7	8 9	11 12	12 13	15 16	18 19	23 24	26 27	Δ		
Multiple		50	∇	*		# 2	# 2	# 3	# 4	0 4	0 4	0 5	0 6	1 7	1 8	2 9	Δ	50	
		100				# 2	0 3	0 3	1 5	1 6	2 7	3 8	3 9	4 10	6 12	7 14		100	
		150				0 2	0 3	1 4	2 6	3 8	4 9	6 10	7 12	8 13	11 17	13 19		150	
		200				0 3	1 4	2 5	3 7	5 10	6 11	8 13	10 15	12 17	16 22	19 25		200	
		250				1 3	2 4	3 6	5 8	7 11	9 12	11 15	14 17	17 20	22 25	25 29		250	
		300				1 3	3 5	4 6	7 9	10 12	12 14	14 17	18 20	21 23	27 29	31 33		300	
		350				2 3	4 5	6 7	9 10	13 14	14 15	18 19	21 22	25 26	32 33	37 38		350	
		Less than 0.10	0.10	0.15	0.25	0.40	0.65	1.0	1.5	2.5	4.0	6.5	Higher than 6.5						
		Acceptance Quality Limits (tightened inspection)																	

Δ = Use next preceding sample size code letter for which acceptance and rejection numbers are available.

∇ = Use next subsequent sample size code letter for which acceptance and rejection numbers are available.

Ac = Acceptance number.

Re = Rejection number.

* = Use single sampling plan above (or alternatively use code letter P).

= Acceptance not permitted at this sample size.

Table X-M—Tables for sample size code letter: M
INDIVIDUAL PLANS

CHART M—OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS
(Curves for double and multiple sampling are matched as closely as practicable)

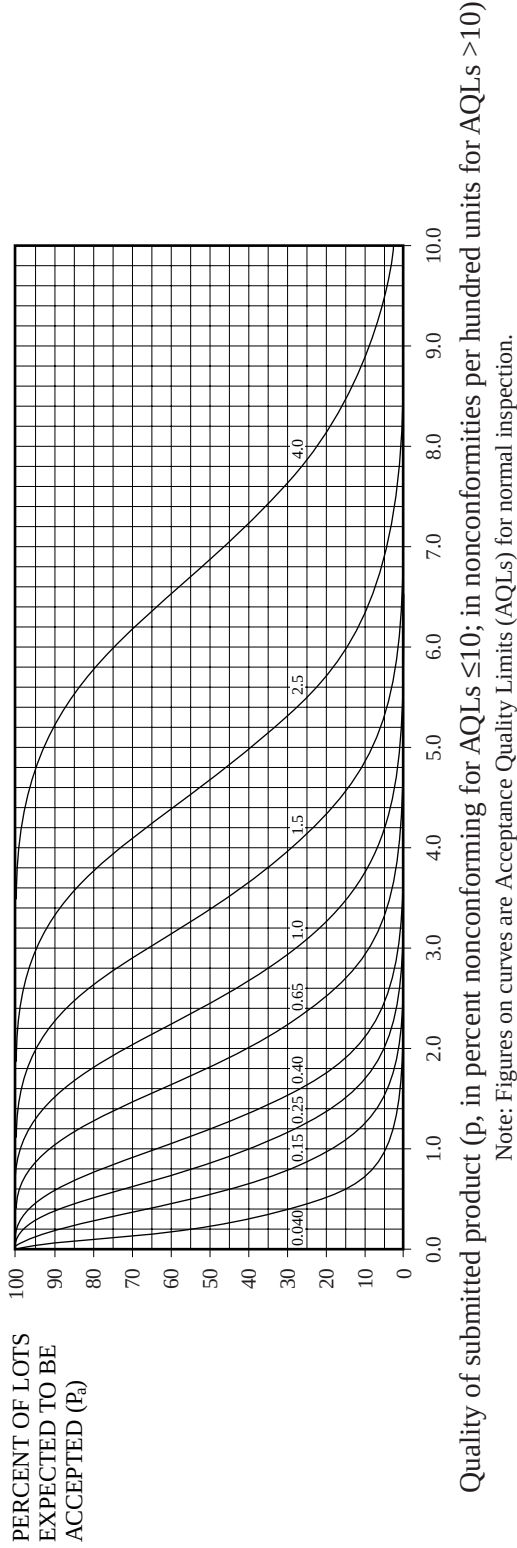


TABLE X-M-1—TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS

P _a	Acceptance Quality Limits (normal inspection)									
	0.040	0.15	0.25	0.40	0.65	1.0	1.5	2.5	4.0	
	p (in percent nonconforming or nonconformities per hundred units)									
99.0	0.0039	0.0472	0.138	0.261	0.567	0.923	1.11	1.51	1.94	2.37
95.0	0.0163	0.113	0.260	0.434	0.830	1.26	1.49	1.96	2.44	2.94
90.0	0.0335	0.169	0.350	0.554	1.00	1.48	1.72	2.23	2.74	3.27
75.0	0.0913	0.305	0.548	0.805	1.34	1.89	2.17	2.74	3.31	3.89
50.0	0.220	0.533	0.849	1.17	1.80	2.43	2.75	3.39	4.02	4.66
25.0	0.440	0.855	1.24	1.62	2.36	3.07	3.43	4.13	4.83	5.52
10.0	0.731	1.23	1.69	2.12	2.94	3.74	4.13	4.89	5.64	6.39
5.0	0.951	1.51	2.00	2.46	3.34	4.17	4.58	5.38	6.17	6.95
1.0	1.46	2.11	2.67	3.19	4.16	5.08	5.52	6.40	7.24	8.08
	0.065	0.25	0.40	0.65	1.0	1.5	2.5	4.0		
	Acceptance Quality Limits (tightened inspection)									

Note: Values given in the table above are based on the Poisson distribution as an approximation to the binomial distribution (See 11.1 for details)

Table X-M-2—Sampling Plans for Sample Size Code Letter: M

Type of sampling plan	Cumulative sample size	Acceptance Quality Limits (normal inspection)														Cumulative sample size								
		Less than 0.040	0.040	0.065	0.10	0.15	0.25	0.40	0.65	1.0	1.5	2.5	4.0	Higher than 4.0										
														Ac Re	Ac Re		Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re
Single	315	∇	0 1	Use Code Letter L	Use Code Letter P	Use Code Letter N	1 2	2 3	3 4	5 6	7 8	8 9	10 11	12 13	14 15	18 19	21 22	Δ	315					
							0 2	0 3	1 4	2 5	3 7	3 7	5 9	6 10	7 11	9 14	11 16	23 24		26 27	Δ			
Double	200 400	∇	*				1 2	3 4	4 5	6 7	8 9	11 12	12 13	15 16	18 19	23 24	26 27	Δ	200 400					
							0 2	0 3	1 4	2 5	3 7	3 7	5 9	6 10	7 11	9 14	11 16	23 24		26 27	Δ			
Multiple	80	∇	*				# 2	# 2	# 3	# 4	0 4	0 4	0 5	0 6	1 7	1 8	2 9	Δ	80					
	160						# 2	0 3	0 3	1 5	1 6	2 7	3 8	3 9	4 10	6 12	7 14						160	
	240						0 2	0 3	1 4	2 6	3 8	4 9	6 10	7 12	8 13	11 17	13 19							240
	320						0 3	1 4	2 5	3 7	5 10	6 11	8 13	10 15	12 17	16 22	19 25							
	400						1 3	2 4	3 6	5 8	7 11	9 12	11 15	14 17	17 20	22 25	25 29							400
	480						1 3	3 5	4 6	7 9	10 12	12 14	14 17	18 20	21 23	27 29	31 33							
	560						2 3	4 5	6 7	9 10	13 14	14 15	18 19	21 22	25 26	32 33	37 38							560
		Less than 0.065	0.065		0.10	0.15	0.25	0.40	0.65	1.0	1.5	2.5	4.0					Higher than 4.0						
Acceptance Quality Limits (tightened inspection)																								

Δ = Use next preceding sample size code letter for which acceptance and rejection numbers are available.
 ∇ = Use next subsequent sample size code letter for which acceptance and rejection numbers are available.
 Ac = Acceptance number.
 Re = Rejection number.
 * = Use single sampling plan above (or alternatively use code letter Q).
 # = Acceptance not permitted at this sample size.

Table X-N—Tables for sample size code letter: N
INDIVIDUAL PLANS

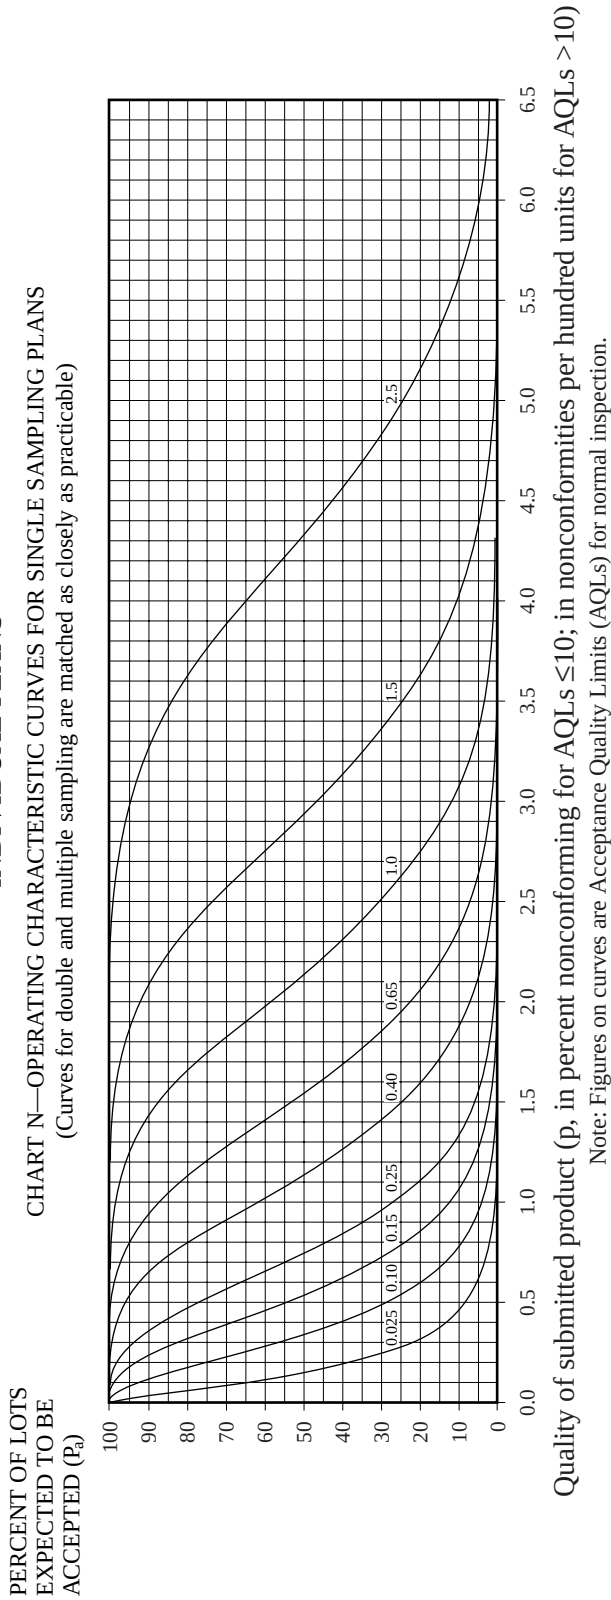


TABLE X-N-1—TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS

P _a	Acceptance Quality Limits (normal inspection)												
	0.025	0.10	0.15	0.25	0.40	0.65	1.0	1.5	2.5	p (in percent nonconforming or nonconformities per hundred units)			
99.0	0.00201	0.0297	0.087	0.165	0.357	0.581	0.701	0.954	1.22	1.50	2.07	2.51	
95.0	0.0103	0.0711	0.164	0.273	0.523	0.796	0.939	1.23	1.54	1.85	2.49	2.98	
90.0	0.0211	0.106	0.220	0.349	0.630	0.931	1.09	1.40	1.73	2.06	2.73	3.25	
75.0	0.0575	0.192	0.345	0.507	0.844	1.19	1.37	1.72	2.08	2.45	3.18	3.74	
50.0	0.139	0.336	0.535	0.734	1.13	1.53	1.73	2.13	2.53	2.93	3.73	4.33	
25.0	0.277	0.539	0.784	1.02	1.48	1.94	2.16	2.60	3.04	3.48	4.35	4.99	
10.0	0.461	0.778	1.06	1.34	1.85	2.35	2.60	3.08	3.56	4.03	4.95	5.64	
5.0	0.599	0.949	1.26	1.55	2.10	2.63	2.89	3.39	3.89	4.38	5.34	6.05	
1.0	0.921	1.33	1.68	2.01	2.62	3.20	3.48	4.03	4.56	5.09	6.12	6.87	
	0.040	0.15	0.25	0.40	0.65	1.0	1.5	2.5	4.0	6.0	10.0	15.0	
	Acceptance Quality Limits (tightened inspection)												

Note: Values given in the table above are based on the Poisson distribution as an approximation to the binomial distribution (See 11.1 for details)

Table X-N-2—Sampling Plans for Sample Size Code Letter: N

Type of sampling plan	Cumulative sample size	Acceptance Quality Limits (normal inspection)														Cumulative sample size			
		Less than 0.025	0.025	0.040	X	0.065	0.10	0.15	0.25	0.40	0.65	X	1.0	X	1.5		X	2.5	Higher than 2.5
Single	500	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re
		∇	0 1																Δ
Double	315 630	∇	*	Use Code Letter N	Use Code Letter R	Use Code Letter Q	0 2	0 3	1 4	2 5	3 7	3 7	5 9	6 10	7 11	9 14	11 16	Δ	
							1 2	3 4	4 5	6 7	8 9	11 12	12 13	15 16	18 19	23 24	26 27		
Multiple	125	∇	*				# 2	# 2	# 3	# 4	0 4	0 4	0 5	0 6	1 7	1 8	2 9	Δ	
	250						# 2	0 3	0 3	1 5	1 6	2 7	3 8	3 9	4 10	6 12	7 14		
	375						0 2	0 3	1 4	2 6	3 8	4 9	6 10	7 12	8 13	11 17	13 19		
	500						0 3	1 4	2 5	3 7	5 10	6 11	8 13	10 15	12 17	16 22	19 25		
	625						1 3	2 4	3 6	5 8	7 11	9 12	11 15	14 17	17 20	22 25	25 29		
	750						1 3	3 5	4 6	7 9	10 12	12 14	14 17	18 20	21 23	27 29	31 33		
	875						2 3	4 5	6 7	9 10	13 14	14 15	18 19	21 22	25 26	32 33	37 38		
		Less than 0.040	0.040	X	0.065	0.10	0.15	0.25	0.40	0.65	X	1.0	X	1.5	X	2.5	X	Higher than 2.5	
		Acceptance Quality Limits (tightened inspection)																	

Δ = Use next preceding sample size code letter for which acceptance and rejection numbers are available.

∇ = Use next subsequent sample size code letter for which acceptance and rejection numbers are available.

Ac = Acceptance number.

Re = Rejection number.


* = Use single sampling plan above (or alternatively use code letter R).

= Acceptance not permitted at this sample size.

Table X-P—Tables for sample size code letter: P
INDIVIDUAL PLANS

PERCENT OF LOTS
EXPECTED TO BE
ACCEPTED (P_a)

CHART P—OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS
(Curves for double and multiple sampling are matched as closely as practicable)

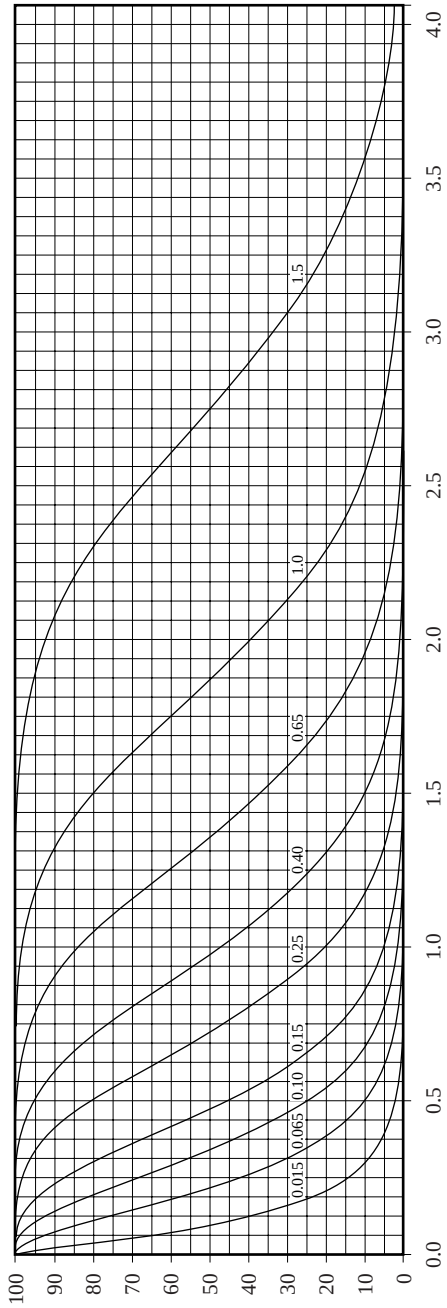

Quality of submitted product (p , in percent nonconforming for AQLs ≤ 10 ; in nonconformities per hundred units for AQLs > 10)
Note: Figures on curves are Acceptance Quality Limits (AQLs) for normal inspection.

TABLE X-P-1—TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS

P _a	Acceptance Quality Limits (normal inspection)												
	0.015	0.065	0.10	0.15	0.25	0.40	0.65	1.0	1.5	p (in percent nonconforming or nonconformities per hundred units)			
99.0	0.00126	0.0186	0.0545	0.103	0.223	0.363	0.438	0.596	0.762	0.935	1.29	1.57	
95.0	0.00641	0.0444	0.102	0.171	0.327	0.498	0.587	0.771	0.961	1.16	1.56	1.86	
90.0	0.0132	0.0665	0.138	0.218	0.394	0.582	0.679	0.878	1.08	1.29	1.71	2.03	
75.0	0.0360	0.120	0.216	0.317	0.527	0.745	0.855	1.08	1.30	1.53	1.99	2.34	
50.0	0.0866	0.210	0.334	0.459	0.709	0.959	1.08	1.33	1.58	1.83	2.33	2.71	
25.0	0.173	0.337	0.490	0.630	0.928	1.21	1.35	1.63	1.90	2.17	2.72	3.12	
10.0	0.288	0.486	0.665	0.835	1.16	1.47	1.62	1.93	2.22	2.52	3.09	3.52	
5.0	0.374	0.593	0.787	0.969	1.31	1.64	1.80	2.12	2.43	2.74	3.34	3.78	
1.0	0.576	0.830	1.05	1.26	1.64	2.00	2.18	2.52	2.85	3.18	3.82	4.29	
	0.025	0.10	0.15	0.25	0.40	0.65	1.0	1.5	2.0	2.5	3.0	3.5	4.0
	Acceptance Quality Limits (tightened inspection)												

Note: Values given in the table above are based on the Poisson distribution as an approximation to the binomial distribution (See 11.1 for details)

Table X-P-2—Sampling Plans for Sample Size Code Letter: P

Type of sampling plan	Cumulative sample size	Acceptance Quality Limits (normal inspection)															Cumulative sample size		
		Less than 0.010	0.015	0.025	0.040	0.065	0.10	0.15	0.25	0.40	0.65	1.0	1.5	Higher than 1.5					
		Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re					
Single	800	∇	0 1		Use Code Letter R	Use Code Letter Q	1 2	2 3	3 4	5 6	7 8	8 9	10 11	12 13	14 15	18 19	21 22	Δ	800
	500 1000	∇	*		Use Code Letter R	Use Code Letter Q	0 2	0 3	1 4	2 5	3 7	3 7	5 9	6 10	7 11	9 14	11 16	Δ	500 1000
Multiple	200	∇	*				# 2	# 2	# 3	# 4	0 4	0 4	0 5	0 6	1 7	1 8	2 9	Δ	200
	400						# 2	0 3	0 3	1 5	1 6	2 7	3 8	3 9	4 10	6 12	7 14		400
	600						0 2	0 3	1 4	2 6	3 8	4 9	6 10	7 12	8 13	11 17	13 19		600
	800						0 3	1 4	2 5	3 7	5 10	6 11	8 13	10 15	12 17	16 22	19 25		800
	1000						1 3	2 4	3 6	5 8	7 11	9 12	11 15	14 17	17 20	22 25	25 29		1000
	1200						1 3	3 5	4 6	7 9	10 12	12 14	14 17	18 20	21 23	27 29	31 33		1200
	1400						2 3	4 5	6 7	9 10	13 14	14 15	18 19	21 22	25 26	32 33	37 38		1400
		Less than 0.025	0.025	×	0.040	0.065	0.10	0.15	0.25	0.40	×	0.65	×	1.0	×	1.5	×	Higher than 1.5	
Acceptance Quality Limits (tightened inspection)																			

Δ = Use next preceding sample size code letter for which acceptance and rejection numbers are available.
 ∇ = Use next subsequent sample size code letter for which acceptance and rejection numbers are available.
 Ac = Acceptance number.
 Re = Rejection number.
 * = Use single sampling plan above.
 # = Acceptance not permitted at this sample size.

Table X-Q—Tables for sample size code letter: Q
INDIVIDUAL PLANS

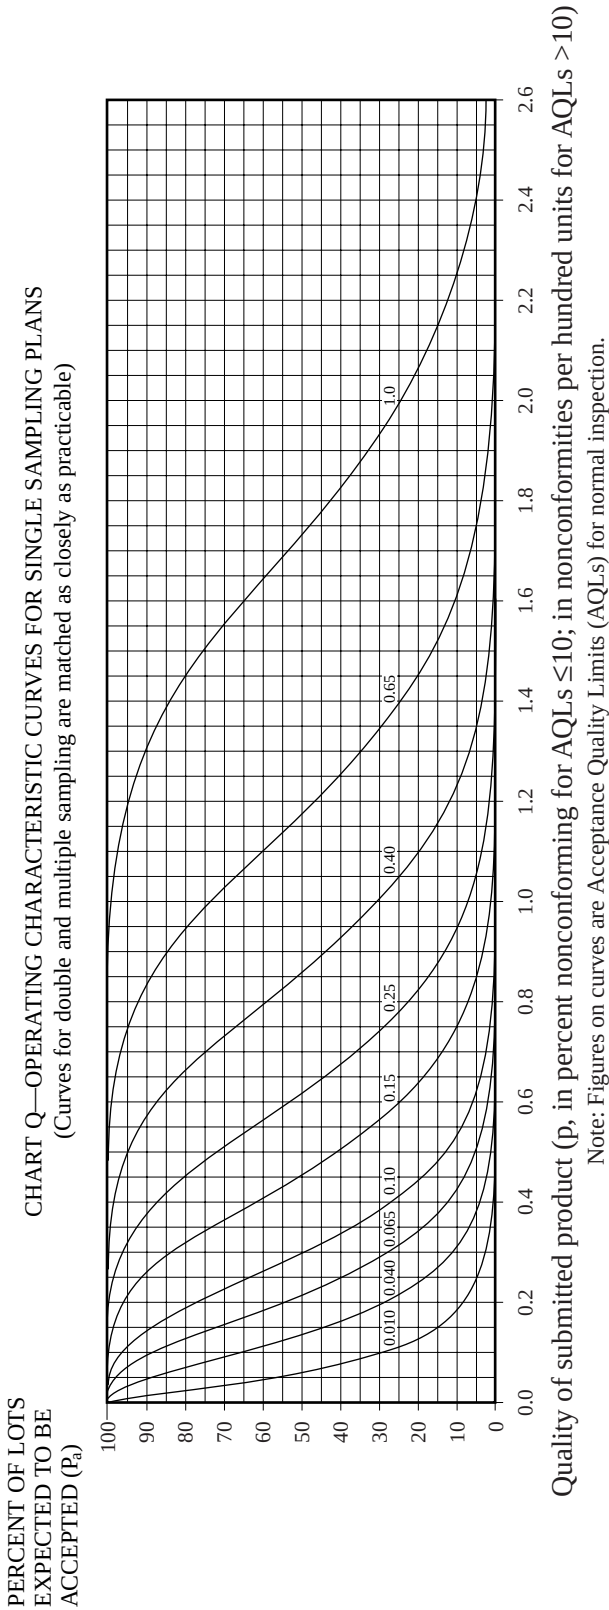


TABLE X-Q-1—TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS

P _a	Acceptance Quality Limits (normal inspection)											
	0.010	0.040	0.065	0.10	0.15	0.25	X	0.40	X	0.65	X	1.0
	p (in percent nonconforming or nonconformities per hundred units)											
99.0	0.000804	0.0119	0.0349	0.0659	0.143	0.232	0.281	0.382	0.488	0.598	0.828	1.01
95.0	0.00410	0.0284	0.0654	0.109	0.209	0.318	0.376	0.494	0.615	0.740	0.995	1.19
90.0	0.00843	0.0425	0.0882	0.140	0.252	0.372	0.435	0.562	0.692	0.824	1.09	1.30
75.0	0.0230	0.0769	0.138	0.203	0.338	0.476	0.547	0.690	0.834	0.979	1.27	1.49
50.0	0.0555	0.134	0.214	0.294	0.454	0.614	0.694	0.853	1.01	1.17	1.49	1.73
25.0	0.111	0.215	0.314	0.409	0.594	0.775	0.864	1.04	1.22	1.39	1.74	2.00
10.0	0.184	0.311	0.426	0.534	0.742	0.942	1.04	1.23	1.42	1.61	1.98	2.25
5.0	0.240	0.380	0.504	0.620	0.841	1.05	1.15	1.36	1.56	1.75	2.14	2.42
1.0	0.368	0.531	0.672	0.804	1.05	1.28	1.39	1.61	1.83	2.04	2.45	2.75
	0.015	0.065	0.10	0.15	0.25	X	0.40	X	0.65	X	1.0	X
Acceptance Quality Limits (tightened inspection)												

Note: Values given in the table above are based on the Poisson distribution as an approximation to the binomial distribution (See 11.1 for details)

Table X-Q-2—Sampling Plans for Sample Size Code Letter: Q

Type of sampling plan	Cumulative sample size	Acceptance Quality Limits (normal inspection)																	Cumulative sample size
		X	0.010	0.015	X	0.025	0.040	0.065	0.10	0.15	0.25	X	0.40	X	0.65	X	1.0	Higher than 1.0	
Single	1250	Use Code Letter R	0 1	Use Code Letter P	Use Code Letter S	Use Code Letter R	1 2	2 3	3 4	5 6	7 8	8 9	10 11	12 13	14 15	18 19	21 22	Δ	1250
							Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	
Double	800 1600	Use Code Letter R	*				0 2	0 3	1 4	2 5	3 7	3 7	5 9	6 10	7 11	9 14	11 16	Δ	800 1600
							1 2	3 4	4 5	6 7	8 9	11 12	12 13	15 16	18 19	23 24	26 27		
Multiple	315	Use Code Letter R	*				# 2	# 2	# 3	# 4	0 4	0 4	0 5	0 6	1 7	1 8	2 9	Δ	315 630 945 1260 1575 1890 2205
	# 2						0 3	0 3	1 5	1 6	2 7	3 8	3 9	4 10	6 12	7 14			
	0 2						0 3	1 4	2 6	3 8	4 9	6 10	7 12	8 13	11 17	13 19			
	0 3						1 4	2 5	3 7	5 10	6 11	8 13	10 15	12 17	16 22	19 25			
	1 3						2 4	3 6	5 8	7 11	9 12	11 15	14 17	17 20	22 25	25 29			
	1 3						3 5	4 6	7 9	10 12	12 14	14 17	18 20	21 23	27 29	31 33			
	2 3						4 5	6 7	9 10	13 14	14 15	18 19	21 22	25 26	32 33	37 38			
		0.010	0.015	X	0.025	0.040	0.065	0.10	0.15	0.25	X	0.40	X	0.65	X	1.0	X	Higher than 1.0	
		Acceptance Quality Limits (tightened inspection)																	

Δ = Use next preceding sample size code letter for which acceptance and rejection numbers are available.

Ac = Acceptance number.

Re = Rejection number.

* = Use single sampling plan above.

= Acceptance not permitted at this sample size.

Table X-R—Tables for sample size code letter: R
INDIVIDUAL PLANS

PERCENT OF LOTS
EXPECTED TO BE
ACCEPTED (P_a)

CHART R—OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS
(Curves for double and multiple sampling are matched as closely as practicable)

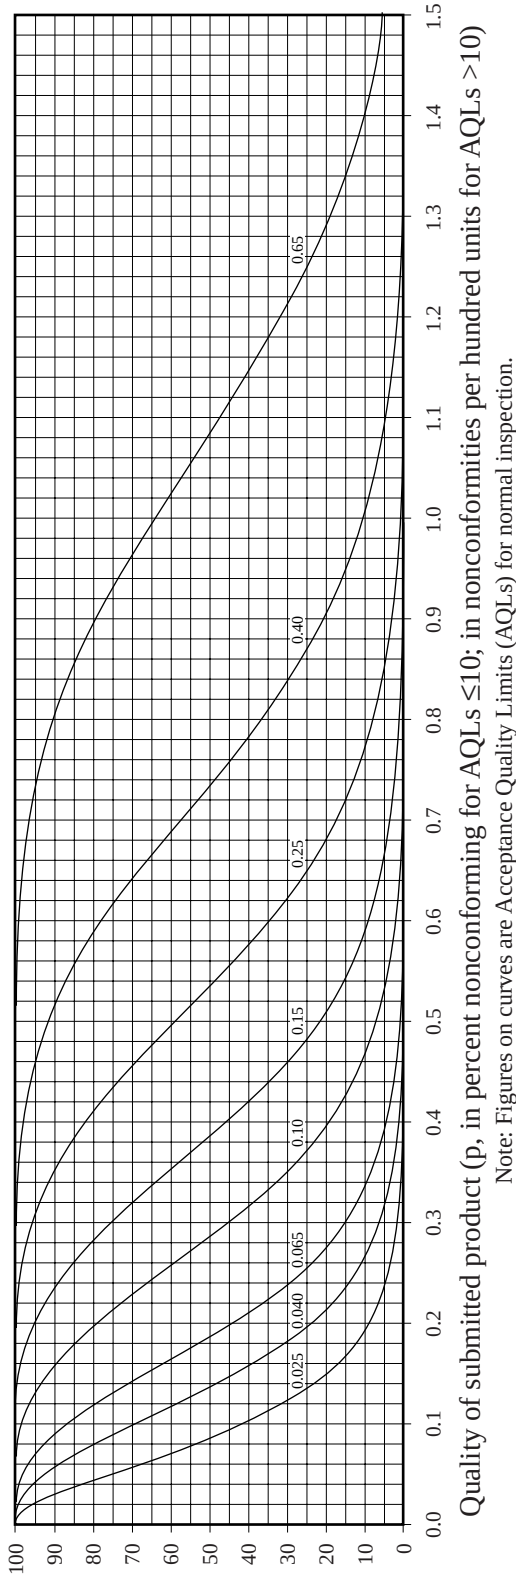


TABLE X-R-1—TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR SINGLE SAMPLING PLANS

P _a	Acceptance Quality Limits (normal inspection)										
	0.025	0.040	0.065	0.10	0.15	X	0.25	X	0.40	X	0.65
	p (in percent nonconforming or nonconformities per hundred units)										
99.0	0.00743	0.0218	0.0412	0.0893	0.145	0.175	0.239	0.305	0.374	0.517	0.629
95.0	0.0178	0.0409	0.0683	0.131	0.199	0.235	0.308	0.384	0.462	0.622	0.745
90.0	0.0266	0.0551	0.0872	0.158	0.233	0.272	0.351	0.432	0.515	0.684	0.812
75.0	0.0481	0.0864	0.127	0.211	0.298	0.342	0.431	0.521	0.612	0.795	0.934
50.0	0.0839	0.134	0.184	0.284	0.383	0.433	0.533	0.633	0.733	0.933	1.08
25.0	0.135	0.196	0.255	0.371	0.484	0.540	0.651	0.761	0.870	1.09	1.25
10.0	0.194	0.266	0.334	0.464	0.589	0.650	0.770	0.889	1.01	1.24	1.41
5.0	0.237	0.315	0.388	0.526	0.657	0.722	0.848	0.972	1.09	1.33	1.51
1.0	0.332	0.420	0.502	0.655	0.800	0.870	1.01	1.14	1.27	1.53	1.72
	0.040	0.065	0.10	0.15	X	0.25	X	0.40	X	0.65	X
	Acceptance Quality Limits (tightened inspection)										

Note: Values given in the table above are based on the Poisson distribution as an approximation to the binomial distribution (See 11.1 for details)

Table X-R-2—Sampling Plans for Sample Size Code Letter: R

Type of sampling plan	Cumulative sample size	Acceptance Quality Limits (normal inspection)																	Cumulative sample size
		X	0.010	0.015	X	0.025	0.040	0.065	0.10	0.15	X	0.25	X	0.40	X	0.65	Higher than 0.65		
Single	2000	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Ac Re	Δ	2000
		0 1																Δ	
Double	1250 2500	*																Δ	1250 2500
			0 2	0 3	1 4	2 5	3 7	3 7	8 9	11 12	12 13	15 16	18 19	23 24	26 27	11 16	26 27		
Multiple	500	*																Δ	500
	1000		# 2	0 3	0 3	1 5	1 6	2 7	3 8	3 9	4 10	6 12	7 14						
	1500		0 2	0 3	1 4	2 6	3 8	4 9	6 10	7 12	8 13	11 17	13 19						
	2000		0 3	1 4	2 5	3 7	5 10	6 11	8 13	10 15	12 17	16 22	19 25						
	2500		1 3	2 4	3 6	5 8	7 11	9 12	11 15	14 17	17 20	22 25	25 29						
	3000		1 3	3 5	4 6	7 9	10 12	12 14	14 17	18 20	21 23	27 29	31 33						
	3500		2 3	4 5	6 7	9 10	13 14	14 15	18 19	21 22	25 26	32 33	37 38						
		0.010	0.015	X	0.025	0.040	0.065	.010	0.15	X	0.25	X	0.40	X	0.65	X	Higher than 0.65		
		Acceptance Quality Limits (tightened inspection)																	

Δ = Use next preceding sample size code letter for which acceptance and rejection numbers are available.

Ac = Acceptance number.

Re = Rejection number.

* = Use single sampling plan above.

= Acceptance not permitted at this sample size.

Table X-S—Tables for Sample Size Code Letter: S

Type of sampling plan	Cumulative sample size	Acceptance Quality Limit (normal inspection)	
		X	
		Ac	Re
Single	2000	1	2
Double	2000	0	2
	4000	1	2
Multiple	800	#	2
	1600	#	2
	2400	0	2
	3200	0	3
	4000	1	3
	4800	1	3
	5600	2	3
		0.025	
		Acceptance Quality Limit (tightened inspection)	

Ac = Acceptance number.

Re = Rejection number.

= Acceptance not permitted at this sample size.

Table XI—Average Outgoing Quality Limit Factors for ANSI-Z1.4 Scheme Performance
(In nonconformities per hundred units, also applicable to percent nonconforming for AQL less than 15
with specific values for percent nonconforming shown in parentheses)

Code Letter	Acceptance Quality Limits																								
	0.010	0.015	0.025	0.040	0.065	1.0	1.5	2.5	4.0	6.5	10	15	25	40	65	100	150	250	400	650	1000				
A										(11) 13			30	48	78	130	200	310	450	710	1100				
B									(6.8) 7.5			19	32	52	84	130	210	300	480	710	1100				
C								(4.4) 4.7			(12) 12	20	31	51	78	130	180	290	430	660					
D							(2.8) 2.9			(7.0) 7.0	(13) 12	20	32	49	76	120	180	270	410						
E						(1.9) 1.9			(4.5) 4.5	(7.5) 7.4	(13) 12	20	30	47	69	110	170	260							
F								(2.9) 2.9	(4.9) 4.8	(7.9) 7.8	(14) 13	20	31	45	71										
G							(1.8) 1.8	(3.0) 3.0	(4.9) 4.9	(8.7) 7.9	(13) 13	18	28	45											
H							(1.2) 1.2	(2.0) 2.0	(3.2) 3.1	(5.1) 5.1	(8.0) 7.8	18	29												
J							(.74) .75		(.72) .72	(7.7) 7.6	(12) 12	18													
K									.46 .77	7.2 7.2	12 12														
L				.29	.48	.78	1.3 1.3	3.1 3.1	4.5 4.5	7.1 7.1															
M				.31	.50	.80	1.3 1.3	2.9 2.0	4.5 4.5																
N			.047	.31	.51	.78	1.3 1.3	2.9 1.8																	
P		.030		.32	.49	.76	1.2 1.2	1.8 1.8																	
Q	.019			.32	.49	.72	1.2 1.2																		
R			.029	.31	.45	.71																			

Note: For a better approximation to the AOQL, the above values must be multiplied by $\left(1 - \frac{\text{Normal Plan Sample Size}}{\text{Lot or Batch size}}\right)$

Table XII—Limiting Quality for ANSI-Z1.4 Scheme Performance for Which $P_d = 10$ Percent
*(In nonconformities per hundred units, also applicable to percent nonconforming for AQL less than 15
with specific values for percent nonconforming shown in parentheses)*

Code Letter	Acceptance Quality Limits																				
	0.010	0.015	0.025	0.040	0.065	1.0	1.5	2.5	4.0	6.5	10	15	25	40	65	100	150	250	400	650	1000
A										(53.6) 76.7			130	194	266	334	464	650	889	1240	1750
B									(36.9) 46.0			77.8	130	177	223	309	433	593	825	1170	1680
C								(25.0) 28.8			(40.6) 48.6	77.8	106	134	185	260	356	495	699	1010	
D							(16.2) 17.7			(26.8) 29.9	(40.6) 48.6	66.5	83.5	116	162	222	309	437	631		
E						(10.9) 11.5			(18.1) 19.4	(26.8) 29.9	(36.0) 40.9	51.4	71.3	100	137	190	269	388			
F						(6.94) 7.19		(11.6) 12.2	(18.1) 19.4	(24.5) 26.6	(30.4) 33.4	46.4	65.0	88.9	124						
G						(4.50) 4.60		(7.56) 7.78	(15.8) 16.6	(19.7) 20.9	(27.1) 29.0	40.6	55.6	77.4							
H				(2.84) 2.88			(4.77) 4.86	(7.56) 7.78	(10.3) 10.6	(12.9) 13.4	(17.8) 18.5	35.6 26.0	49.5								
J			(1.83) 1.84				(4.77) 4.86	(6.52) 6.65	(8.16) 8.35	(11.3) 11.6	(15.7) 16.2	30.9 22.2									
K																					
L																					
M																					
N																					
P																					
Q	.115																				
R			.123	.194	.266	.334	.464	.650	.889	1.24											

**LQ 10%
SCHEME
PERFORMANCE**

**LQ 5%
SCHEME
PERFORMANCE**

Table XIII—Limiting Quality for ANSI-Z1.4 Scheme Performance for Which $P_d = 5$ Percent
(In nonconformities per hundred units, also applicable to percent nonconforming for AQL less than 15
with specific values for percent nonconforming shown in parentheses)

Code Letter	Acceptance Quality Limits																					
	0.010	0.015	0.025	0.040	0.065	1.0	1.5	2.5	4.0	6.5	10	15	25	40	65	100	150	250	400	650	1000	
A										(63.2) 99.8			158	237	315	388	526	722	972	1340	1860	
B									(45.1) 59.9			94.9	158	210	258	350	481	648	890	1240	1770	
C								(31.2) 37.4			(47.1) 59.3	94.9	126	155	210	289	389	534	745	1060		
D							(20.6) 23.0			(31.6) 36.5	(47.1) 59.3	78.7	96.9	131	180	243	334	465	665			
E						(13.9) 15.0			(21.6) 23.7	(31.6) 36.5	(41.0) 48.4	59.6	80.9	111	150	205	286	409				
F					(8.94) 9.36			(14.0) 14.8	(21.6) 23.7	(28.3) 31.5	(34.4) 38.8	52.6	72.2	97.2	133							
G				(5.81) 5.99			(9.14) 9.49	(14.0) 14.8	(18.4) 19.7	(22.5) 24.2	(30.1) 32.9	45.1	60.8	83.4								
H			(3.68) 3.74			(5.79) 5.93	(9.14) 9.49	(12.1) 12.6	(14.8) 15.5	(19.9) 21.0	(27.0) 28.9	38.9	53.4									
J			(2.37) 2.40		(3.74) 3.79	(5.79) 5.93	(7.66) 7.87	(9.41) 9.69	(12.7) 13.1	(17.3) 18.0	(23.2) 24.3	33.4										
K				2.37	3.79	5.04	6.20	8.41	11.5	15.6	21.4											
L				1.51	2.37	3.88	5.26	7.22	9.72	13.3												
M			.949	1.51	2.00	3.34	4.58	6.17	8.47													
N			.374		1.55	2.10	2.89	3.89	5.34													
P		.240			1.31	1.80	2.43	3.34														
Q	.150		.237	.841	1.15	1.56	2.14															
R			.151	.237	.315	.388	.526	.722	.972	1.33												

Table XIV—Average Sample Size Tables for ANSI-Z1.4 Scheme Performance (Single Sampling)

TABLE XIV—A Tabulated Values for Average Sample Size for ANSI-Z1.4 Scheme Performance

Code A

P _a	Acceptance Quality Limits (normal inspection)													
	6.5	6.5	25	40	65	100	150	250	400	650	1000			
	*	p (in nonconformities per hundred units)												
99.0	2.0	2.0	2.0	2.0	2.0	2.0	2.0	2.0	2.0	2.0	2.0			
95.0	2.1	2.0	2.0	2.0	2.0	2.0	2.0	2.0	2.0	2.0	2.0			
90.0	2.1	2.1	2.2	2.0	2.0	2.0	2.0	2.0	2.0	2.0	2.0			
75.0	2.5	2.5	2.5	2.0	2.0	2.0	2.0	2.0	2.0	2.0	2.0			
50.0	2.9	2.9	2.9	2.0	2.0	2.0	2.0	2.0	2.0	2.0	2.0			
25.0	3.0	3.0	3.0	2.0	2.0	2.0	2.0	2.0	2.0	2.0	2.0			
10.0	3.0	3.0	3.0	2.0	2.0	2.0	2.0	2.0	2.0	2.0	2.0			
5.0	3.0	3.0	3.0	2.0	2.0	2.0	2.0	2.0	2.0	2.0	2.0			
1.0	3.0	3.0	3.0	2.0	2.0	2.0	2.0	2.0	2.0	2.0	2.0			

A

TABLE XIV—B Tabulated Values for Average Sample Size for ANSI-Z1.4 Scheme Performance

Code B

P _a	Acceptance Quality Limits (normal inspection)													
	4.0	4.0	15	25	40	65	100	150	250	400	650	1000		
	*	p (in nonconformities per hundred units)												
99.0	2.1	2.1	2.7	2.6	2.5	2.7	2.4	2.7	2.5	2.7	2.4	2.7		
95.0	2.6	2.6	3.1	3.0	3.0	3.0	3.0	3.0	3.0	3.0	3.0	3.0		
90.0	3.1	3.1	3.3	3.0	3.0	3.0	3.0	3.0	3.0	3.0	3.0	3.0		
75.0	4.0	4.0	4.0	3.0	3.0	3.0	3.0	3.0	3.0	3.0	3.0	3.0		
50.0	4.8	4.8	4.8	3.0	3.0	3.0	3.0	3.0	3.0	3.0	3.0	3.0		
25.0	5.0	5.0	5.0	3.0	3.0	3.0	3.0	3.0	3.0	3.0	3.0	3.0		
10.0	5.0	5.0	5.0	3.0	3.0	3.0	3.0	3.0	3.0	3.0	3.0	3.0		
5.0	5.0	5.0	5.0	3.0	3.0	3.0	3.0	3.0	3.0	3.0	3.0	3.0		
1.0	5.0	5.0	5.0	3.0	3.0	3.0	3.0	3.0	3.0	3.0	3.0	3.0		

B

TABLE XIV—C Tabulated Values for Average Sample Size for ANSI-Z1.4 Scheme Performance

Code C

P _a	Acceptance Quality Limits (normal inspection)													
	2.5	10	2.5	10	15	25	40	65	100	150	250	400	650	
	p (in percent nonconforming)		p (in nonconformities per hundred units)											
99.0	2.4	3.7	2.4	3.6	3.5	4.0	4.2	4.1	4.1	4.2	4.3	4.0	3.4	
95.0	3.6	4.8	3.6	4.8	4.8	4.9	5.0	5.0	5.0	5.0	5.0	5.0	5.0	
90.0	4.7	5.4	4.7	5.4	5.0	5.0	5.0	5.0	5.0	5.0	5.0	5.0	5.0	
75.0	6.5	6.5	6.5	6.6	5.0	5.0	5.0	5.0	5.0	5.0	5.0	5.0	5.0	
50.0	7.8	7.7	7.8	7.7	5.0	5.0	5.0	5.0	5.0	5.0	5.0	5.0	5.0	
25.0	8.0	8.0	8.0	8.0	5.0	5.0	5.0	5.0	5.0	5.0	5.0	5.0	5.0	
10.0	8.0	8.0	8.0	8.0	5.0	5.0	5.0	5.0	5.0	5.0	5.0	5.0	5.0	
5.0	8.0	8.0	8.0	8.0	5.0	5.0	5.0	5.0	5.0	5.0	5.0	5.0	5.0	
1.0	8.0	8.0	8.0	8.0	5.0	5.0	5.0	5.0	5.0	5.0	5.0	5.0	5.0	

C

TABLE XIV—D Tabulated Values for Average Sample Size for ANSI-Z1.4 Scheme Performance

Code D

P _a	Acceptance Quality Limits (normal inspection)													
	1.5	6.5	10	1.5	6.5	10	15	25	40	65	100	150	250	400
	p (in percent nonconforming)			p (in nonconformities per hundred units)										
99.0	3.7	5.8	5.3	3.7	5.7	5.1	6.2	6.6	6.6	5.9	5.8	7.0	6.1	5.4
95.0	5.7	7.7	7.4	5.7	7.6	7.2	7.8	7.9	8.0	7.9	7.9	8.0	8.0	7.9
90.0	7.4	8.6	7.9	7.4	8.6	7.8	8.0	8.0	8.0	8.0	8.0	8.0	8.0	8.0
75.0	11	11	8.0	11	11	8.0	8.0	8.0	8.0	8.0	8.0	8.0	8.0	8.0
50.0	13	13	8.0	13	13	8.0	8.0	8.0	8.0	8.0	8.0	8.0	8.0	8.0
25.0	13	13	8.0	13	13	8.0	8.0	8.0	8.0	8.0	8.0	8.0	8.0	8.0
10.0	13	13	8.0	13	13	8.0	8.0	8.0	8.0	8.0	8.0	8.0	8.0	8.0
5.0	13	13	8.0	13	13	8.0	8.0	8.0	8.0	8.0	8.0	8.0	8.0	8.0
1.0	13	13	8.0	13	13	8.0	8.0	8.0	8.0	8.0	8.0	8.0	8.0	8.0

D

* p (in percent nonconforming)

**AVERAGE
SAMPLE
SIZE SCHEME
PERFORMANCE**

Table XIV—Average Sample Size Tables for ANSI-Z1.4 Scheme Performance (Single Sampling)

TABLE XIV—E Tabulated Values for Average Sample Size for ANSI-Z1.4 Scheme Performance

Code E

E

P _a	Acceptance Quality Limits (normal inspection)														
	1.0	4.0	6.5	10	1.0	4.0	6.5	10	15	25	40	65	100	150	250
	p (in percent nonconforming)				p (in nonconformities per hundred units)										
99.0	6.0	9.4	8.6	11	6.0	9.3	8.4	10	11	10	9.8	8.9	10	11	8.6
95.0	9.2	12	12	13	9.2	12	12	13	13	13	13	13	13	13	13
90.0	12	14	13	13	12	14	13	13	13	13	13	13	13	13	13
75.0	17	17	13	13	17	17	13	13	13	13	13	13	13	13	13
50.0	19	19	13	13	19	19	13	13	13	13	13	13	13	13	13
25.0	20	20	13	13	20	20	13	13	13	13	13	13	13	13	13
10.0	20	20	13	13	20	20	13	13	13	13	13	13	13	13	13
5.0	20	20	13	13	20	20	13	13	13	13	13	13	13	13	13
1.0	20	20	13	13	20	20	13	13	13	13	13	13	13	13	13

TABLE XIV—F Tabulated Values for Average Sample Size for ANSI-Z1.4 Scheme Performance

Code F

F

P _a	Acceptance Quality Limits (normal inspection)														
	.65	2.5	4.0	6.5	10	.65	2.5	4.0	6.5	10	15	25	40	65	
	p (in percent nonconforming)					p (in nonconformities per hundred units)									
99.0	9.5	14.6	13.4	15.7	17.9	9.5	14.5	13.2	15.3	16.8	17.8	16.2	15.1	15.7	
95.0	14.4	19.1	18.5	19.5	19.0	14.4	19.0	18.3	19.3	19.8	20.0	19.9	19.8	19.9	
90.0	18.6	21.5	19.7	19.9	20.0	18.6	21.5	19.6	19.9	20.0	20.0	20.0	20.0	20.0	
75.0	26.1	26.2	20.0	20.0	20.0	26.0	26.2	20.0	20.0	20.0	20.0	20.0	20.0	20.0	
50.0	31.0	30.9	20.0	20.0	20.0	31.0	30.9	20.0	20.0	20.0	20.0	20.0	20.0	20.0	
25.0	32.0	32.0	20.0	20.0	20.0	32.0	32.0	20.0	20.0	20.0	20.0	20.0	20.0	20.0	
10.0	32.0	32.0	20.0	20.0	20.0	32.0	32.0	20.0	20.0	20.0	20.0	20.0	20.0	20.0	
5.0	32.0	32.0	20.0	20.0	20.0	32.0	32.0	20.0	20.0	20.0	20.0	20.0	20.0	20.0	
1.0	32.0	32.0	20.0	20.0	20.0	32.0	32.0	20.0	20.0	20.0	20.0	20.0	20.0	20.0	

TABLE XIV—G Tabulated Values for Average Sample Size for ANSI-Z1.4 Scheme Performance

Code G

G

P _a	Acceptance Quality Limits (normal inspection)														
	.4	1.5	2.5	4.0	6.5	10	.4	1.5	2.5	4.0	6.5	10	15	25	40
	p (in percent nonconforming)						p (in nonconformities per hundred units)								
99.0	15.5	25.1	21.4	25.0	28.1	28.6	15.5	24.9	21.3	24.6	27.1	27.0	26.8	24.4	26.3
95.0	23.1	31.7	29.5	31.2	31.9	32.0	23.1	31.7	29.4	31.0	31.7	31.8	31.9	31.8	31.9
90.0	29.7	34.6	31.4	31.9	32.0	32.0	29.7	34.6	31.4	31.8	32.0	32.0	32.0	32.0	32.0
75.0	41.1	41.4	32.0	32.0	32.0	32.0	41.1	41.4	32.0	32.0	32.0	32.0	32.0	32.0	32.0
50.0	48.6	48.3	32.0	32.0	32.0	32.0	48.6	48.3	32.0	32.0	32.0	32.0	32.0	32.0	32.0
25.0	50.0	50.0	32.0	32.0	32.0	32.0	50.0	50.0	32.0	32.0	32.0	32.0	32.0	32.0	32.0
10.0	50.0	50.0	32.0	32.0	32.0	32.0	50.0	50.0	32.0	32.0	32.0	32.0	32.0	32.0	32.0
5.0	50.0	50.0	32.0	32.0	32.0	32.0	50.0	50.0	32.0	32.0	32.0	32.0	32.0	32.0	32.0
1.0	50.0	50.0	32.0	32.0	32.0	32.0	50.0	50.0	32.0	32.0	32.0	32.0	32.0	32.0	32.0

TABLE XIV—H Tabulated Values for Average Sample Size for ANSI-Z1.4 Scheme Performance

Code H

H

P _a	Acceptance Quality Limits (normal inspection)															
	.25	1.0	1.5	2.5	4.0	6.5	10	.25	1.0	1.5	2.5	4.0	6.5	10	15	25
	p (in percent nonconforming)							p (in nonconformities per hundred units)								
99.0	23.8	36.3	35.6	40.3	43.1	42.4	43.4	23.8	36.2	35.3	39.8	42.1	40.8	40.5	41.9	42.7
95.0	36.0	47.7	47.8	49.2	49.7	49.8	50.0	36.0	47.6	47.7	49.0	49.6	49.6	49.8	49.9	50.0
90.0	46.5	53.7	49.6	49.9	50.0	50.0	50.0	46.5	53.7	49.6	49.9	49.9	50.0	50.0	50.0	50.0
75.0	65.1	65.6	50.0	50.0	50.0	50.0	50.0	65.1	65.6	50.0	50.0	50.0	50.0	50.0	50.0	50.0
50.0	77.6	77.1	50.0	50.0	50.0	50.0	50.0	77.6	77.2	50.0	50.0	50.0	50.0	50.0	50.0	50.0
25.0	79.9	79.9	50.0	50.0	50.0	50.0	50.0	79.9	79.9	50.0	50.0	50.0	50.0	50.0	50.0	50.0
10.0	80.0	80.0	50.0	50.0	50.0	50.0	50.0	80.0	80.0	50.0	50.0	50.0	50.0	50.0	50.0	50.0
5.0	80.0	80.0	50.0	50.0	50.0	50.0	50.0	80.0	80.0	50.0	50.0	50.0	50.0	50.0	50.0	50.0
1.0	80.0	80.0	50.0	50.0	50.0	50.0	50.0	80.0	80.0	50.0	50.0	50.0	50.0	50.0	50.0	50.0

**AVERAGE
SAMPLE
SIZE SCHEME
PERFORMANCE**

* p (in percent nonconforming)

Table XIV—Average Sample Size Tables for ANSI-Z1.4 Scheme Performance (Single Sampling)

TABLE XIV—J Tabulated Values for Average Sample Size for ANSI-Z1.4 Scheme Performance

Code J

P _a	Acceptance Quality Limits (normal inspection)																
	.15	.65	1.0	1.5	2.5	4.0	6.5	10	.15	.65	1.0	1.5	2.5	4.0	6.5	10	15
	p (in percent nonconforming)								p (in nonconformities per hundred units)								
99.0	38.3	58.0	52.9	64.2	68.3	68.7	64.2	64.7	38.3	57.9	52.8	63.7	67.3	67.1	61.7	60.5	73.5
95.0	57.5	76.2	73.4	78.6	79.5	79.7	79.6	79.8	57.5	76.1	73.2	78.5	79.3	79.6	79.3	79.3	80.0
90.0	74.0	85.5	78.5	79.8	79.9	80.0	80.0	80.0	74.0	85.4	78.4	79.8	79.9	80.0	80.0	80.0	80.0
75.0	103	103	80.0	80.0	80.0	80.0	80.0	80.0	103	103	80.0	80.0	80.0	80.0	80.0	80.0	80.0
50.0	121	121	80.0	80.0	80.0	80.0	80.0	80.0	121	121	80.0	80.0	80.0	80.0	80.0	80.0	80.0
25.0	125	125	80.0	80.0	80.0	80.0	80.0	80.0	125	125	80.0	80.0	80.0	80.0	80.0	80.0	80.0
10.0	125	125	80.0	80.0	80.0	80.0	80.0	80.0	125	125	80.0	80.0	80.0	80.0	80.0	80.0	80.0
5.0	125	125	80.0	80.0	80.0	80.0	80.0	80.0	125	125	80.0	80.0	80.0	80.0	80.0	80.0	80.0
1.0	125	125	80.0	80.0	80.0	80.0	80.0	80.0	125	125	80.0	80.0	80.0	80.0	80.0	80.0	80.0

J

TABLE XIV—K Tabulated Values for Average Sample Size for ANSI-Z1.4 Scheme Performance

Code K

P _a	Acceptance Quality Limits (normal inspection)															
	.10	.40	.65	1.0	1.5	2.5	4.0	6.5	10							
	p (in nonconformities per hundred units)															
99.0	59.6	90.5	82.4	99.6	109	105	101	92.6	107							
95.0	90.1	119	114	123	124	124	124	124	125							
90.0	116	134	123	125	125	125	125	125	125							
75.0	163	164	125	125	125	125	125	125	125							
50.0	194	193	125	125	125	125	125	125	125							
25.0	200	200	125	125	125	125	125	125	125							
10.0	200	200	125	125	125	125	125	125	125							
5.0	200	200	125	125	125	125	125	125	125							
1.0	200	200	125	125	125	125	125	125	125							

K

TABLE XIV—L Tabulated Values for Average Sample Size for ANSI-Z1.4 Scheme Performance

Code L

P _a	Acceptance Quality Limits (normal inspection)														
	.065	.25	.40	.65	1.0	1.5	2.5	4.0	6.5						
	p (in nonconformities per hundred units)														
99.0	95.6	145	132	153	168	178	162	151	157						
95.0	144	190	183	193	198	200	199	198	199						
90.0	185	214	196	199	200	200	200	200	200						
75.0	258	260	200	200	200	200	200	200	200						
50.0	306	304	200	200	200	200	200	200	200						
25.0	315	315	200	200	200	200	200	200	200						
10.0	315	315	200	200	200	200	200	200	200						
5.0	315	315	200	200	200	200	200	200	200						
1.0	315	315	200	200	200	200	200	200	200						

L

TABLE XIV—M Tabulated Values for Average Sample Size for ANSI-Z1.4 Scheme Performance

Code M

P _a	Acceptance Quality Limits (normal inspection)														
	.04	.15	.25	.40	.65	1.0	1.5	2.5	4.0						
	p (in nonconformities per hundred units)														
99.0	149	244	207	240	264	263	268	242	263						
95.0	226	312	288	304	312	313	314	313	315						
90.0	292	342	309	313	315	315	315	315	315						
75.0	408	411	315	315	315	315	315	315	315						
50.0	485	483	315	315	315	315	315	315	315						
25.0	500	499	315	315	315	315	315	315	315						
10.0	500	500	315	315	315	315	315	315	315						
5.0	500	500	315	315	315	315	315	315	315						
1.0	500	500	315	315	315	315	315	315	315						

M

**AVERAGE
SAMPLE
SIZE SCHEME
PERFORMANCE**

Table XIV—Average Sample Size Tables for ANSI-Z1.4 Scheme Performance (Single Sampling)

TABLE XIV—N Tabulated Values for Average Sample Size for ANSI-Z1.4 Scheme Performance

Code N

N

P _a	Acceptance Quality Limits (normal inspection)														
	.025	.10	.15	.25	.40	.65	1.0	1.5	2.5						
	p (in nonconformities per hundred units)														
99.0	238	362	353	398	421	407	405	419	427						
95.0	360	476	477	490	496	496	498	499	499						
90.0	465	537	496	499	499	500	500	500	500						
75.0	651	656	500	500	500	500	500	500	500						
50.0	776	772	500	500	500	500	500	500	500						
25.0	799	799	500	500	500	500	500	500	500						
10.0	800	800	500	500	500	500	500	500	500						
5.0	800	800	500	500	500	500	500	500	500						
1.0	800	800	500	500	500	500	500	500	500						

TABLE XIV—P Tabulated Values for Average Sample Size for ANSI-Z1.4 Scheme Performance

Code P

P

P _a	Acceptance Quality Limits (normal inspection)														
	.015	.065	.10	.15	.25	.40	.65	1.0	1.5						
	p (in nonconformities per hundred units)														
99.0	378	576	523	634	670	667	610	598	730						
95.0	572	759	730	784	793	795	792	793	800						
90.0	738	854	784	798	799	800	800	800	800						
75.0	1027	1035	800	800	800	800	800	800	800						
50.0	1214	1208	800	800	800	800	800	800	800						
25.0	1249	1249	800	800	800	800	800	800	800						
10.0	1250	1250	800	800	800	800	800	800	800						
5.0	1250	1250	800	800	800	800	800	800	800						
1.0	1250	1250	800	800	800	800	800	800	800						

TABLE XIV—Q Tabulated Values for Average Sample Size for ANSI-Z1.4 Scheme Performance

Code Q

Q

P _a	Acceptance Quality Limits (normal inspection)														
	.01	.04	.065	.10	.15	.25	.40	.65	1.0						
	p (in nonconformities per hundred units)														
99.0	596	905	824	996	1090	1050	1010	926	1070						
95.0	901	1190	1140	1230	1240	1240	1250	1240	1250						
90.0	1160	1340	1230	1250	1250	1250	1250	1250	1250						
75.0	1630	1640	1250	1250	1250	1250	1250	1250	1250						
50.0	1940	1930	1250	1250	1250	1250	1250	1250	1250						
25.0	2000	2000	1250	1250	1250	1250	1250	1250	1250						
10.0	2000	2000	1250	1250	1250	1250	1250	1250	1250						
5.0	2000	2000	1250	1250	1250	1250	1250	1250	1250						
1.0	2000	2000	1250	1250	1250	1250	1250	1250	1250						

TABLE XIV—R Tabulated Values for Average Sample Size for ANSI-Z1.4 Scheme Performance

Code R


R

P _a	Acceptance Quality Limits (normal inspection)														
	.025	.040	.065	.10	.15	.25	.40	.65							
	p (in nonconformities per hundred units)														
99.0	1450	1320	1530	1680	1780	1620	1510	1570							
95.0	1900	1830	1930	1980	2000	1990	1980	1990							
90.0	2140	1960	1990	2000	2000	2000	2000	2000							
75.0	2600	2000	2000	2000	2000	2000	2000	2000							
50.0	3040	2000	2000	2000	2000	2000	2000	2000							
25.0	3150	2000	2000	2000	2000	2000	2000	2000							
10.0	3150	2000	2000	2000	2000	2000	2000	2000							
5.0	3150	2000	2000	2000	2000	2000	2000	2000							
1.0	3150	2000	2000	2000	2000	2000	2000	2000							

**AVERAGE
SAMPLE
SIZE SCHEME
PERFORMANCE**

Scheme Performance with Switching Rules
Chart XV-A Operating Characteristic Curves for ANSI Z1.4 Scheme Performance
 (Curves for double and multiple sampling are matched as closely as practicable)

PERCENT OF LOTS
 EXPECTED TO BE
 ACCEPTED (P_a)

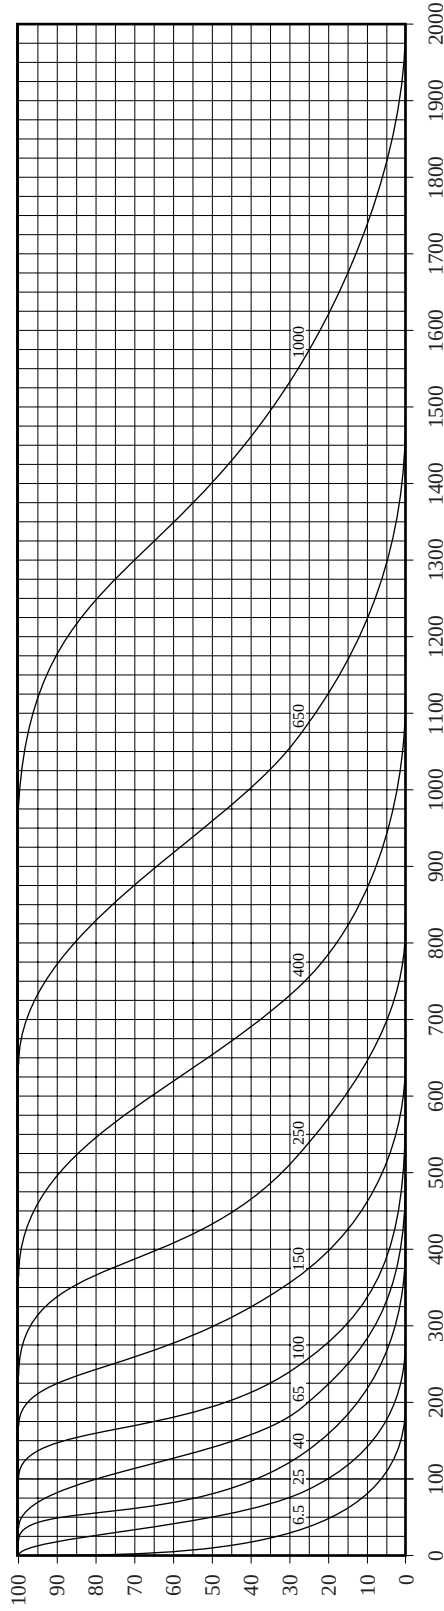

Quality of submitted product (p , in percent nonconforming for AQLs ≤ 10 ; in nonconformities per hundred units for AQLs > 10)

Note: Figures on curves are Acceptance Quality Limits (AQLs) for normal inspection.

TABLE XV-A-1—TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR ANSI Z1.4 SCHEME PERFORMANCE

P_a	Acceptance Quality Limits (normal inspection)											
	6.5	10	15	25	40	65	100	150	250	400	650	1000
	p (in percent nonconforming)											
99.0	0.501	0.502	7.43	21.8	41.2	89.1	145	239	374	628	977	
95.0	2.50	2.53	17.5	38.7	66.1	123	192	302	456	734	1110	
90.0	4.84	4.96	24.6	47.9	79.9	138	214	333	497	783	1180	
75.0	10.8	11.4	38.0	63.7	103	162	248	380	560	855	1270	
50.0	21.2	23.8	57.8	88.5	138	195	294	443	642	948	1400	
25.0	37.0	46.3	89.9	135	196	256	372	540	761	1090	1570	
10.0	53.6	76.7	130	194	266	334	464	650	889	1240	1750	
5.0	63.2	99.8	158	237	315	388	526	722	972	1340	1860	
1.0	78.4	154	221	332	420	502	655	871	1140	1530	2090	



	Acceptance Quality Limits (normal inspection)													
P _a	4.0	4.0	15	25	40	65	100	150	250	400	650	1000		
	p (in percent nonconforming)													
	p (in nonconformities per hundred units)													
99.0	0.467	0.468	5.46	16.2	31.4	60.2	92.5	154	244	401	637	1010		
95.0	1.96	1.98	11.6	25.8	44.4	81.9	128	201	304	489	742	1150		
90.0	3.40	3.46	15.9	31.9	53.3	92.2	143	222	332	522	785	1200		
75.0	6.94	7.19	23.8	42.4	68.8	108	165	253	373	570	850	1290		
50.0	13.4	14.4	35.1	59.0	92.0	130	196	295	428	632	931	1400		
25.0	24.2	27.8	53.9	89.9	131	171	248	360	507	725	1050	1540		
10.0	36.9	46.0	77.8	130	177	223	309	433	593	825	1170	1680		
5.0	45.1	59.9	94.9	158	210	258	350	481	648	890	1240	1770		
1.0	60.2	92.2	133	221	280	335	437	581	761	1020	1390	1950		

Scheme Performance with Switching Rules
Chart XV-C Operating Characteristic Curves for ANSI Z1.4 Scheme Performance
 (Curves for double and multiple sampling are matched as closely as practicable)

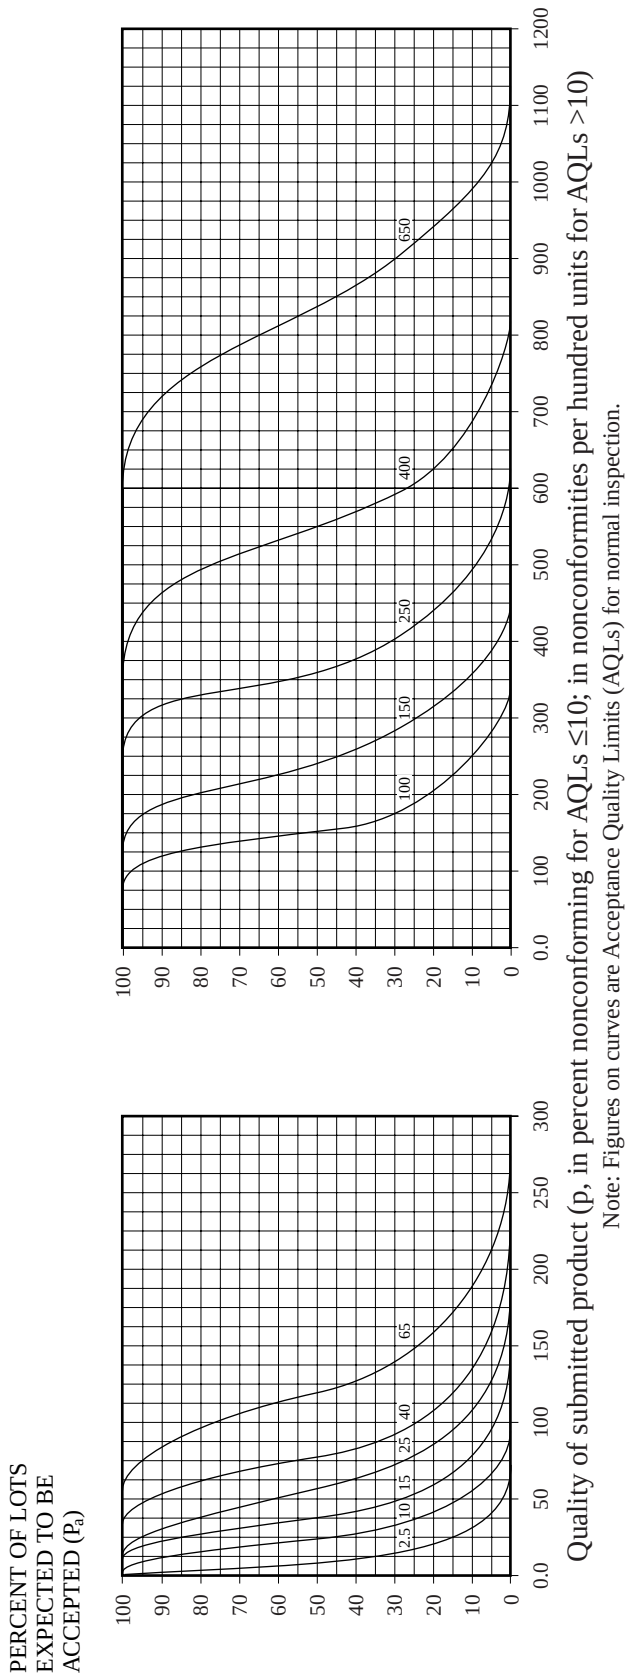


TABLE XV-C-1— TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR ANSI Z1.4 SCHEME PERFORMANCE

P _a	Acceptance Quality Limits (normal inspection)												
	2.5	10	2.5	10	15	25	40	65	100	150	250	400	650
	p (in percent nonconforming)		p (in nonconformities per hundred units)										
99.0	0.416	4.16	0.416	3.83	10.8	18.4	37.7	61.3	100	154	256	399	640
95.0	1.42	7.73	1.43	7.29	15.7	26.6	49.2	76.9	121	183	294	445	689
90.0	2.26	10.2	2.29	9.79	19.2	32.0	55.3	85.7	133	199	313	471	722
75.0	4.36	14.7	4.46	14.6	25.5	41.3	64.7	99.0	152	224	342	510	774
50.0	8.58	20.9	8.98	21.8	35.4	55.2	77.8	117	177	257	379	559	838
25.0	15.9	30.3	17.3	33.07	53.9	78.5	102	149	216	304	435	627	924
10.0	25.0	40.6	28.8	48.6	77.8	106	134	185	260	356	495	699	1010
5.0	31.2	47.1	37.4	59.3	94.9	126	155	210	289	389	534	745	1060
1.0	43.7	58.9	57.6	83.0	133	168	201	262	348	457	612	835	1170

Scheme Performance with Switching Rules
Chart XV-D Operating Characteristic Curves for ANSI Z1.4 Scheme Performance
 (Curves for double and multiple sampling are matched as closely as practicable)

PERCENT OF LOTS
 EXPECTED TO BE
 ACCEPTED (P_a)

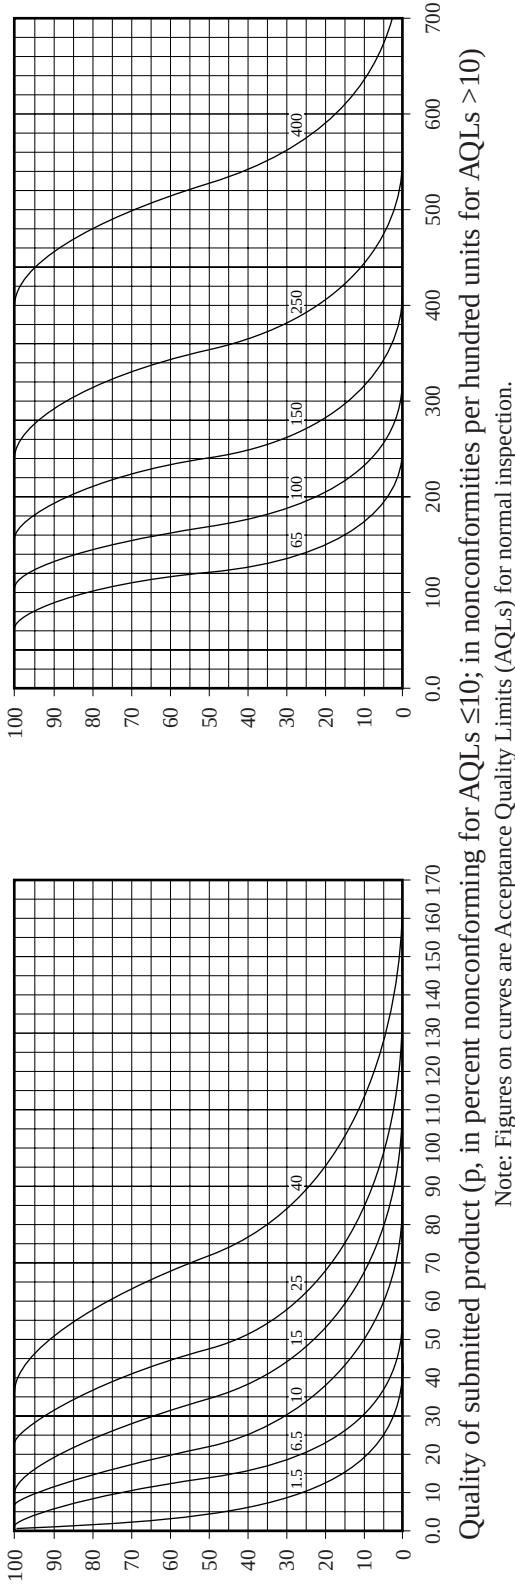


TABLE XV-D-1— TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR ANSI Z1.4 SCHEME PERFORMANCE

P _a	Acceptance Quality Limits (normal inspection)													
	1.5	6.5	10	p (in nonconformities per hundred units)										
	p (in percent nonconforming)			1.5	6.5	10	15	25	40	65	100	150	250	400
99.0	0.272	2.55	7.86	0.273	2.43	7.20	11.6	23.7	38.3	64.1	99.7	160	252	403
95.0	0.911	4.73	10.7	0.915	4.57	10.1	16.6	30.8	48.0	75.7	114	184	278	431
90.0	1.43	6.26	12.7	1.44	6.10	12.1	20.0	34.6	53.5	83.2	124	196	294	451
75.0	2.73	9.10	16.2	2.77	9.07	15.9	25.8	40.4	61.9	95.0	140	214	319	484
50.0	5.38	13.1	21.3	5.53	13.5	22.1	34.5	48.6	73.4	111	161	237	349	524
25.0	10.1	19.4	30.3	10.7	20.7	33.7	49.0	64.0	92.9	135	190	272	392	577
10.0	16.2	26.8	40.6	17.7	29.9	48.6	66.5	83.5	116	162	222	309	437	631
5.0	20.6	31.6	47.1	23.0	36.5	59.3	78.7	96.9	131	180	243	334	465	665
1.0	29.8	41.3	58.9	35.5	51.1	83.0	105	126	164	218	285	382	522	732

Scheme Performance with Switching Rules
Chart XV-E Operating Characteristic Curves for ANSI Z1.4 Scheme Performance
 (Curves for double and multiple sampling are matched as closely as practicable)

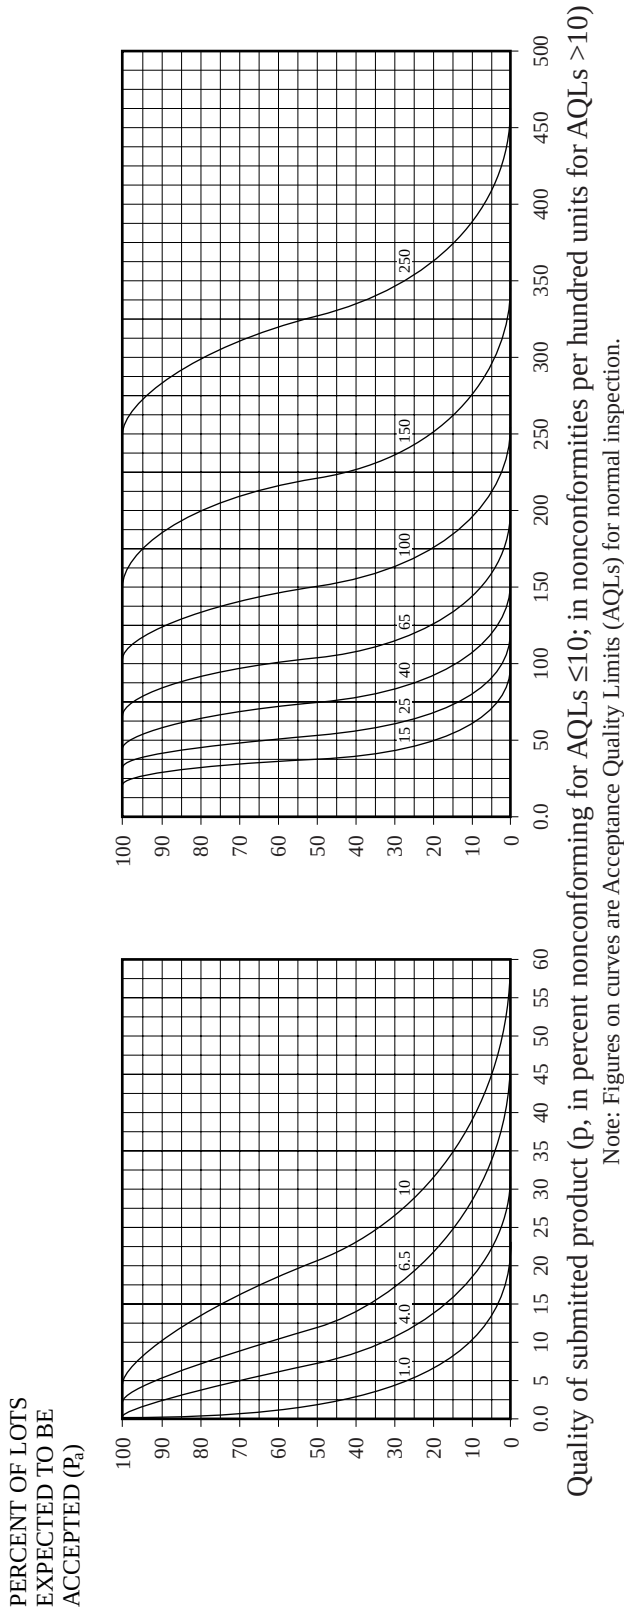


TABLE XV-E-1—TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR ANSI Z1.4 SCHEME PERFORMANCE

	Acceptance Quality Limits (normal inspection)														
P _a	1.0	4.0	6.5	10	1.0	4.0	6.5	10	15	25	40	65	100	150	250
	p (in percent nonconforming)				p (in nonconformities per hundred units)										
99.0	0.165	1.53	4.64	7.62	0.165	1.48	4.41	7.13	14.4	23.7	39.3	62.2	100	153	248
95.0	0.558	2.88	6.42	10.9	0.560	2.82	6.19	10.2	18.9	29.6	46.6	70.6	113	171	265
90.0	0.889	3.86	7.64	12.9	0.893	3.80	7.42	12.3	21.3	32.9	51.2	76.5	120	181	278
75.0	1.74	5.77	9.88	16.2	1.75	5.76	9.80	15.9	24.9	38.1	58.4	86.2	132	196	298
50.0	3.51	8.55	13.3	20.7	3.58	8.70	13.6	21.2	29.9	45.2	68.1	98.8	146	215	322
25.0	6.70	12.9	19.4	28.0	6.94	13.5	20.7	30.2	39.4	57.2	83.1	117	167	241	355
10.0	10.9	18.1	26.8	36.0	11.5	19.4	29.9	40.9	51.4	71.3	100	137	190	269	388
5.0	13.9	21.6	31.6	41.0	15.0	23.7	36.5	48.4	59.6	80.9	111	150	205	286	409
1.0	20.6	28.9	41.3	50.6	23.1	33.2	51.1	64.7	77.3	101	134	176	235	321	450

Scheme Performance with Switching Rules
Chart XV-F Operating Characteristic Curves for ANSI Z1.4 Scheme Performance
(Curves for double and multiple sampling are matched as closely as practicable)

PERCENT OF LOTS
EXPECTED TO BE
ACCEPTED (P_a)


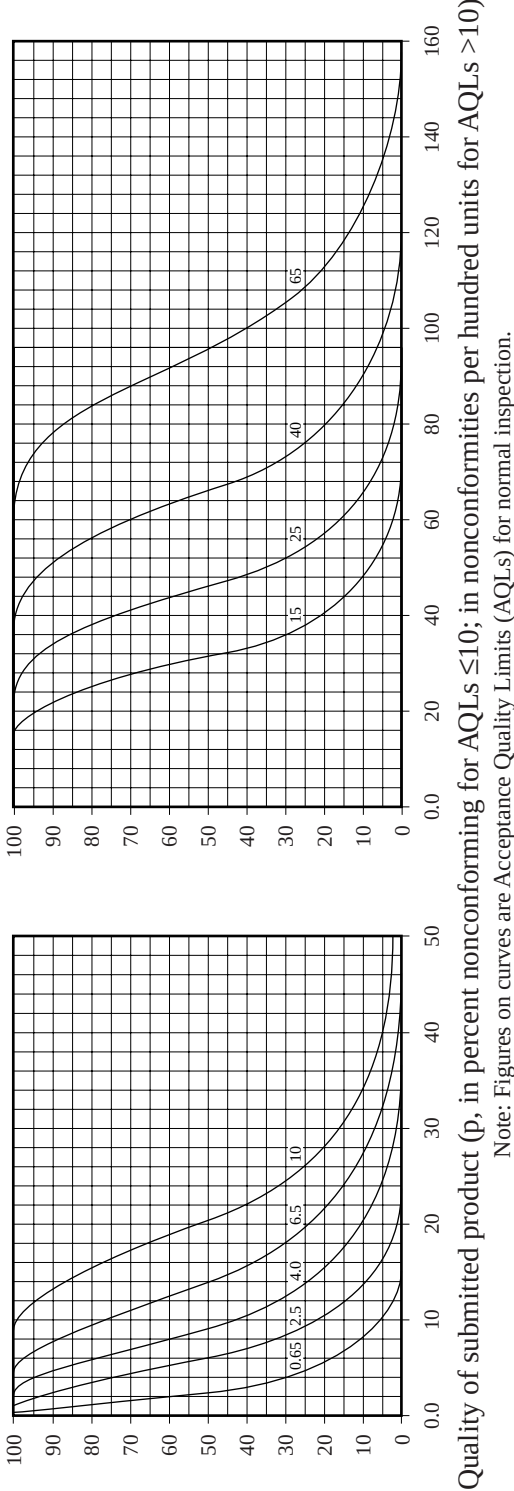


TABLE XV-F-1— TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR ANSI Z1.4 SCHEME PERFORMANCE

P _a	Acceptance Quality Limits (normal inspection)													
	p (in percent nonconforming)					p (in nonconformities per hundred units)								
	.65	2.5	4.0	6.5	10	.65	2.5	4.0	6.5	10	15	25	40	65
99.0	0.104	.978	2.94	4.93	10.1	0.104	.958	2.84	4.72	9.41	15.0	25.0	39.5	64.9
95.0	0.357	1.85	4.11	6.94	13.0	0.358	1.82	4.02	6.69	12.3	19.2	30.2	45.7	73.4
90.0	0.571	2.47	4.91	8.24	14.4	0.572	2.45	4.82	8.00	13.8	21.4	33.3	49.7	78.3
75.0	1.11	3.66	6.40	10.4	16.5	1.11	3.66	6.37	10.3	16.2	24.8	38.0	56.0	85.5
50.0	2.22	5.40	8.71	13.6	19.2	2.24	5.46	8.85	13.8	19.5	29.4	44.3	64.2	94.8
25.0	4.24	8.21	12.9	18.7	24.3	4.34	8.43	13.5	19.6	25.6	37.2	54.0	76.1	109
10.0	6.94	11.6	18.1	24.5	30.4	7.19	12.2	19.4	26.6	33.4	46.4	65.0	88.9	124
5.0	8.94	14.0	21.6	28.3	34.4	9.36	14.8	23.7	31.5	38.8	52.6	72.2	97.2	133
1.0	13.4	19.0	28.9	35.8	42.1	14.4	20.7	33.2	42.0	50.2	65.5	87.1	114	153

Scheme Performance with Switching Rules
Chart XV-G Operating Characteristic Curves for ANSI Z1.4 Scheme Performance
 (Curves for double and multiple sampling are matched as closely as practicable)

PERCENT OF LOTS
 EXPECTED TO BE
 ACCEPTED (P_a)

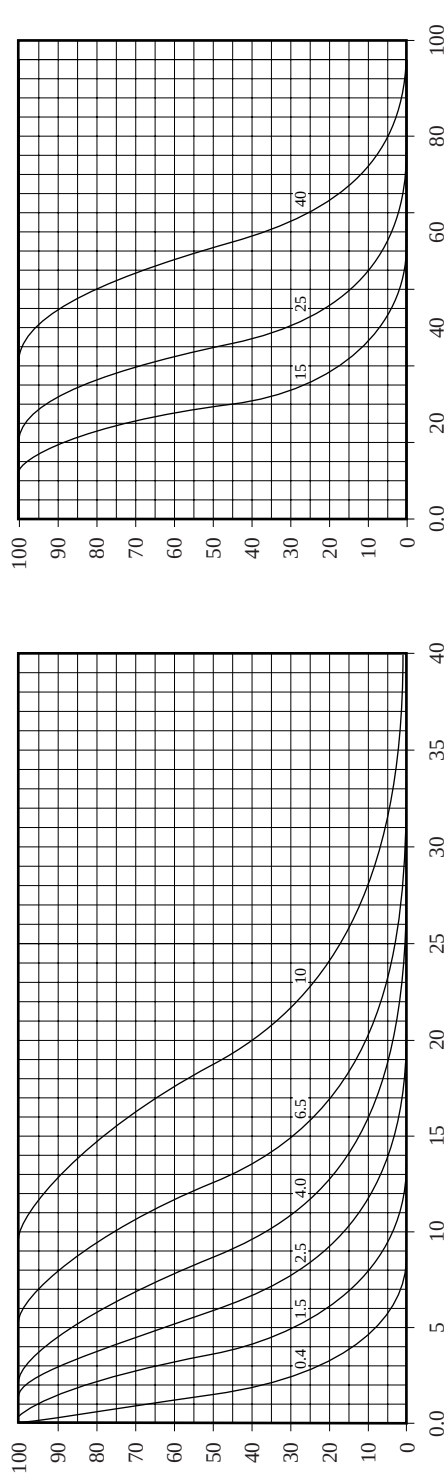

Quality of submitted product (p , in percent nonconforming for AQLs ≤ 10 ; in nonconformities per hundred units for AQLs > 10)


Note: Figures on curves are Acceptance Quality Limits (AQLs) for normal inspection.

TABLE XV-G-1— TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR ANSI Z1.4 SCHEME PERFORMANCE

P_a	Acceptance Quality Limits (normal inspection)														
	p (in percent nonconforming)					p (in nonconformities per hundred units)									
	.4	1.5	2.5	4.0	6.5	10	.4	1.5	2.5	4.0	6.5	10	15	25	40
99.0	0.0643	0.571	1.80	3.02	6.12	10.0	0.0643	.564	1.77	2.95	5.88	9.49	15.5	24.6	40.3
95.0	0.223	1.12	2.54	4.28	7.96	12.6	0.223	1.11	2.51	4.18	7.69	12.0	18.9	28.6	45.9
90.0	0.357	1.53	3.05	5.09	8.87	13.9	0.358	1.52	3.01	5.00	8.64	13.4	20.8	31.1	48.9
75.0	0.703	2.32	3.99	6.49	10.2	15.7	0.706	2.32	3.98	6.45	10.1	15.5	23.7	35.0	53.4
50.0	1.42	3.46	5.48	8.54	12.1	18.2	1.43	3.48	5.53	8.63	12.2	18.3	27.7	40.1	59.2
25.0	2.74	5.30	8.21	11.9	15.5	22.3	2.78	5.39	8.43	12.3	16.0	23.2	33.8	47.6	67.9
10.0	4.50	7.56	11.6	15.8	19.7	27.1	4.60	7.78	12.2	16.6	20.9	29.0	40.6	55.6	77.4
5.0	5.81	9.14	14.0	18.4	22.5	30.1	5.99	9.49	14.8	19.7	24.2	32.9	45.1	60.8	83.4
1.0	8.80	12.5	19.0	23.8	28.1	36.0	9.22	13.3	20.7	26.3	31.4	41.0	54.4	71.4	95.6

Scheme Performance with Switching Rules
Chart XV-H Operating Characteristic Curves for ANSI Z1.4 Scheme Performance
(Curves for double and multiple sampling are matched as closely as practicable)

PERCENT OF LOTS
EXPECTED TO BE
ACCEPTED (P_a)

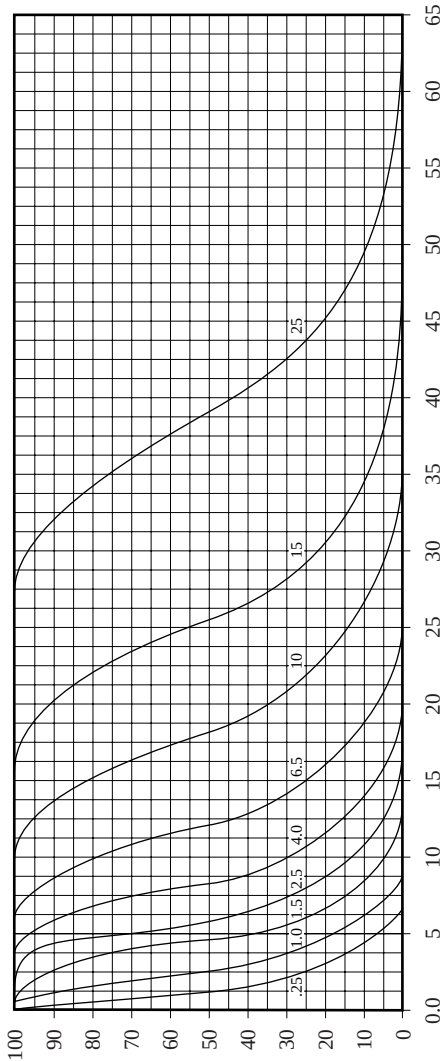


Quality of submitted product (p, in percent nonconforming for AQLs ≤10; in nonconformities per hundred units for AQLs >10)
Note: Figures on curves are Acceptance Quality Limits (AQLs) for normal inspection.

TABLE XV-H-1— TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR ANSI Z1.4 SCHEME PERFORMANCE

P _a	Acceptance Quality Limits (normal inspection)														
	p (in percent nonconforming)							p (in nonconformities per hundred units)							
	.25	1.0	1.5	2.5	4.0	6.5	10	.25	1.0	1.5	2.5	4.0	6.5	10	25
99.0	0.0416	0.386	1.09	1.87	3.86	6.33	10.4	0.0416	0.383	1.08	1.84	3.77	6.14	10.0	25.6
95.0	0.143	0.733	1.59	2.70	5.03	7.92	12.6	0.143	0.729	1.57	2.66	4.92	7.69	12.1	29.4
90.0	0.229	0.983	1.93	3.23	5.62	8.76	13.7	0.229	0.979	1.92	3.20	5.53	8.57	13.3	31.3
75.0	0.445	1.46	2.55	4.15	6.52	10.0	15.4	0.446	1.46	2.55	4.13	6.47	9.90	15.2	34.2
50.0	0.893	2.17	3.52	5.49	7.74	11.7	17.6	0.898	2.18	3.54	5.52	7.78	11.7	17.7	37.9
25.0	1.72	3.34	5.30	7.70	10.0	14.5	21.0	1.73	3.37	5.39	7.85	10.2	14.9	21.6	43.5
10.0	2.84	4.77	7.56	10.3	12.9	17.8	24.7	2.88	4.86	7.78	10.6	13.4	18.5	26.0	49.5
5.0	3.68	5.79	9.14	12.1	14.8	19.9	27.0	3.74	5.93	9.49	12.6	15.5	21.0	28.9	53.4
1.0	5.59	8.01	12.5	15.8	18.7	24.1	31.6	5.76	8.30	13.3	16.8	20.1	26.2	34.8	61.2

Scheme Performance with Switching Rules
Chart XV-J Operating Characteristic Curves for ANSI Z1.4 Scheme Performance
 (Curves for double and multiple sampling are matched as closely as practicable)

PERCENT OF LOTS
 EXPECTED TO BE
 ACCEPTED (P_a)

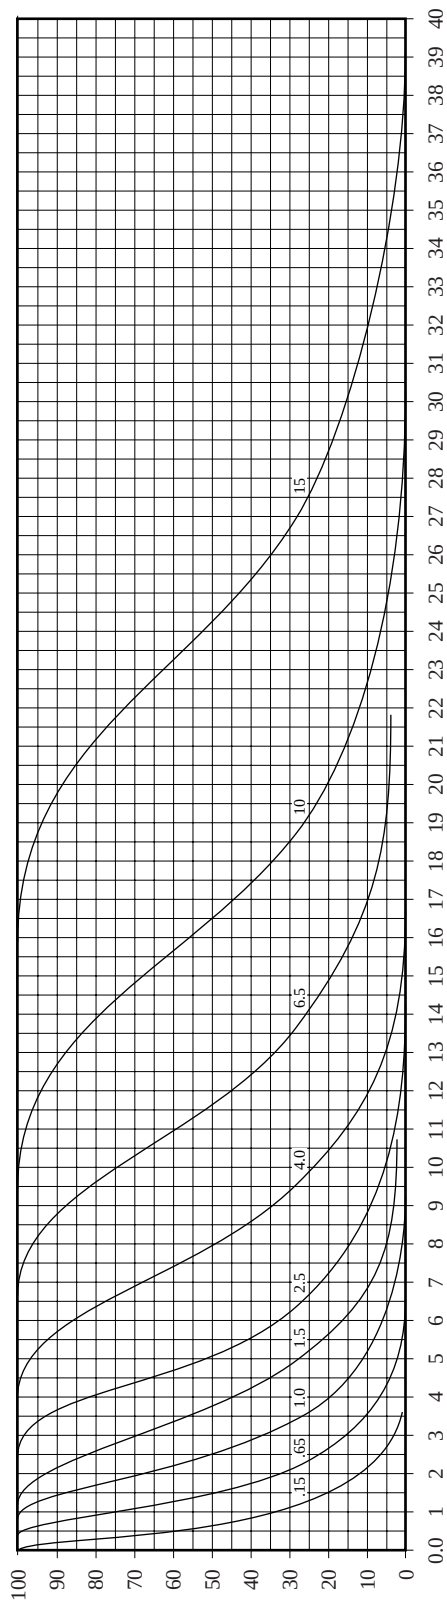

Quality of submitted product (p , in percent nonconforming for $AQLs \leq 10$; in nonconformities per hundred units for $AQLs > 10$)
 Note: Figures on curves are Acceptance Quality Limits ($AQLs$) for normal inspection.

TABLE XV-J-1— TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR ANSI Z1.4 SCHEME PERFORMANCE

P _a	Acceptance Quality Limits (normal inspection)																
	p (in percent nonconforming)								p (in nonconformities per hundred units)								
	.15	.65	1.0	1.5	2.5	4.0	6.5	10	.15	.65	1.0	1.5	2.5	4.0	6.5	10	15
99.0	0.0260	0.240	0.715	1.16	2.39	3.88	6.49	10.2	0.0260	0.239	0.710	1.15	2.35	3.80	6.35	9.87	15.9
95.0	0.0896	0.458	1.01	1.68	3.12	4.89	7.74	11.8	0.0897	0.457	1.00	1.66	3.08	4.80	7.56	11.4	18.4
90.0	0.144	0.617	1.21	2.01	3.49	5.43	8.48	12.7	0.144	0.615	1.20	2.00	3.46	5.35	8.32	12.4	19.6
75.0	0.282	0.928	1.59	2.59	4.06	6.23	9.58	14.2	0.282	0.928	1.59	2.58	4.04	6.19	9.50	14.0	21.4
50.0	0.571	1.39	2.20	3.44	4.85	7.31	11.0	16.0	0.573	1.39	2.21	3.45	4.86	7.34	11.1	16.1	23.7
25.0	1.10	2.14	3.34	4.85	6.32	9.15	13.3	18.6	1.11	2.16	3.37	4.90	6.40	9.29	13.5	19.0	27.2
10.0	1.83	3.08	4.77	6.52	8.16	11.3	15.7	21.4	1.84	3.11	4.86	6.65	8.35	11.6	16.2	22.2	30.9
5.0	2.37	3.74	5.79	7.66	9.41	12.7	17.3	23.2	2.40	3.79	5.93	7.87	9.69	13.1	18.0	24.3	33.4
1.0	3.62	5.19	8.01	10.1	12.0	15.6	20.5	26.6	3.69	5.31	8.30	10.5	12.6	16.4	21.8	28.5	38.2

Scheme Performance with Switching Rules
Chart XV-K Operating Characteristic Curves for ANSI Z1.4 Scheme Performance
(Curves for double and multiple sampling are matched as closely as practicable)

PERCENT OF LOTS
EXPECTED TO BE
ACCEPTED (P_a)


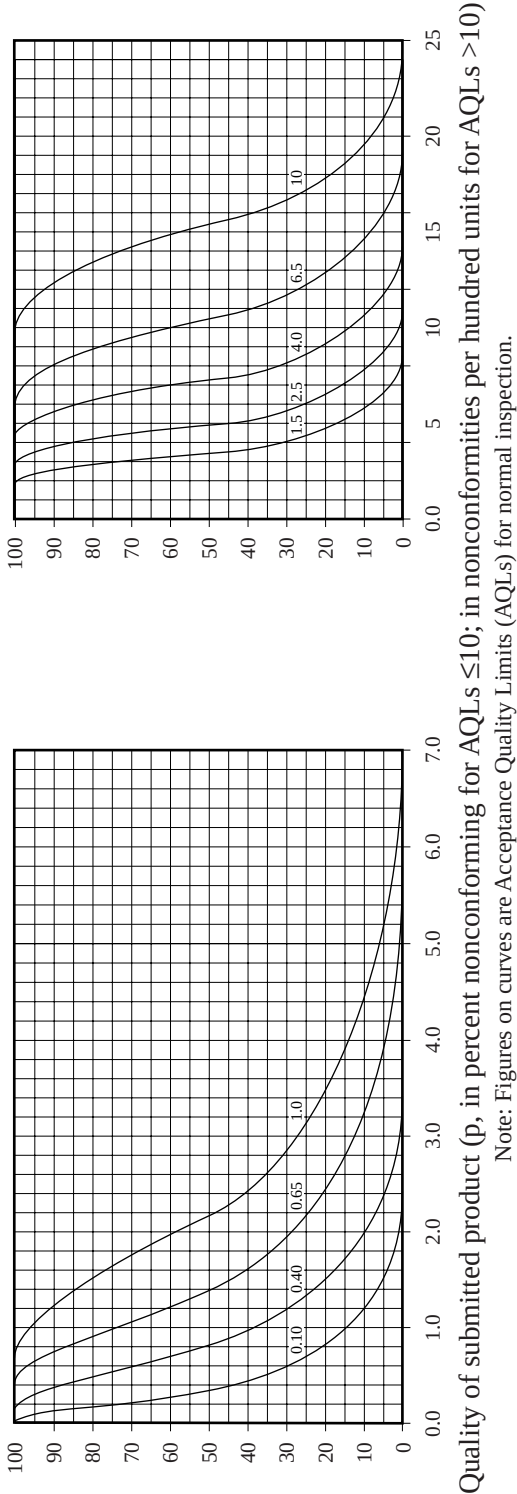


TABLE XV-K-1— TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR ANSI Z1.4 SCHEME PERFORMANCE

P _a	Acceptance Quality Limits (normal inspection)										
	.10	.40	.65	1.0	1.5	2.5	4.0	6.5	10		
	p (in percent nonconforming or nonconformities per hundred units)										
99.0	0.0167	0.153	0.455	0.738	1.49	2.43	4.01	6.34	10.3		
95.0	0.0573	0.292	0.643	1.06	1.97	3.07	4.84	7.32	11.7		
90.0	0.0916	0.392	0.771	1.28	2.21	3.43	5.33	7.96	12.5		
75.0	0.178	0.586	1.02	1.65	2.59	3.96	6.08	8.96	13.7		
50.0	0.359	0.873	1.42	2.21	3.11	4.70	7.08	10.3	15.2		
25.0	0.694	1.35	2.16	3.14	4.10	5.94	8.65	12.2	17.4		
10.0	1.15	1.94	3.11	4.26	5.34	7.42	10.4	14.2	19.8		
5.0	1.50	2.37	3.79	5.04	6.20	8.41	11.5	15.6	21.4		
1.0	2.31	3.32	5.31	6.73	8.04	10.5	13.9	18.3	24.5		

Scheme Performance with Switching Rules
Chart XV-L Operating Characteristic Curves for ANSI Z1.4 Scheme Performance
 (Curves for double and multiple sampling are matched as closely as practicable)

PERCENT OF LOTS
 EXPECTED TO BE
 ACCEPTED (P_a)

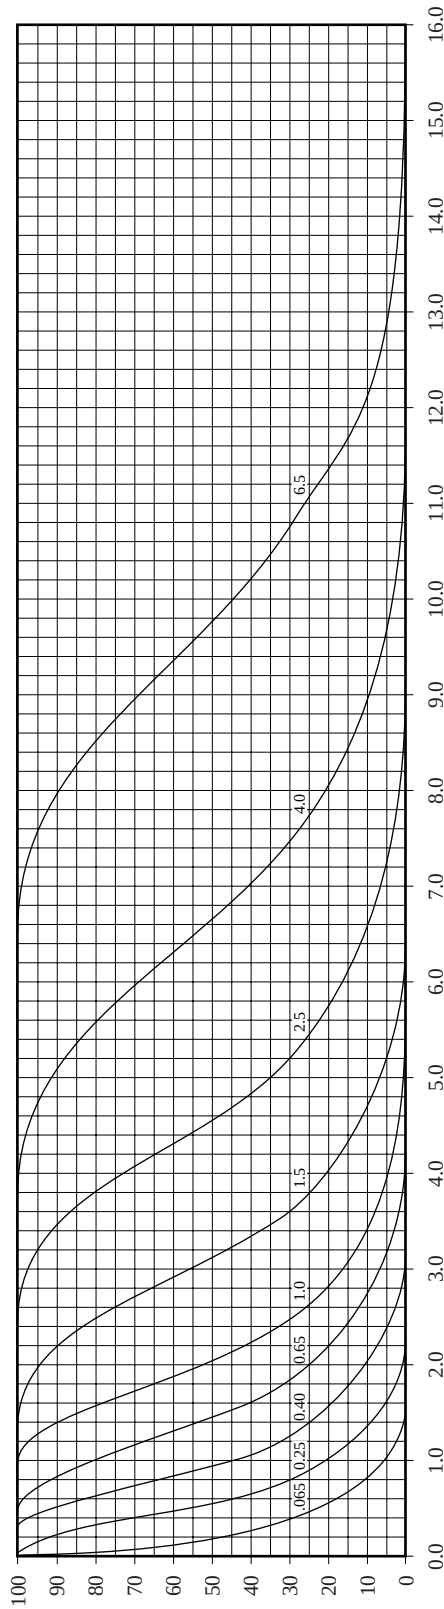


Quality of submitted product (p , in percent nonconforming for AQLs ≤ 10 ; in nonconformities per hundred units for AQLs > 10)
 Note: Figures on curves are Acceptance Quality Limits (AQLs) for normal inspection.

TABLE XV-L-1—TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR ANSI Z1.4 SCHEME PERFORMANCE

P_a	Acceptance Quality Limits (normal inspection)										
	.065	.25	.40	.65	1.0	1.5	2.5	4.0	6.5		
	p (in percent nonconforming or nonconformities per hundred units)										
99.0	0.0104	0.0957	0.284	0.472	0.941	1.50	2.50	3.95	6.49		
95.0	0.0358	0.183	0.402	0.669	1.23	1.92	3.02	4.57	7.34		
90.0	0.0574	0.246	0.482	0.800	1.38	2.14	3.33	4.97	7.83		
75.0	0.112	0.369	0.637	1.03	1.62	2.48	3.80	5.60	8.55		
50.0	0.228	0.554	0.885	1.38	1.95	2.94	4.43	6.42	9.48		
25.0	0.441	0.856	1.35	1.96	2.56	3.72	5.40	7.61	10.9		
10.0	0.731	1.23	1.94	2.66	3.34	4.64	6.50	8.89	12.4		
5.0	0.951	1.51	2.37	3.15	3.88	5.26	7.22	9.72	13.3		
1.0	1.46	2.11	3.32	4.20	5.02	6.55	8.71	11.4	15.3		

Scheme Performance with Switching Rules
Chart XV-M Operating Characteristic Curves for ANSI Z1.4 Scheme Performance
(Curves for double and multiple sampling are matched as closely as practicable)

PERCENT OF LOTS
EXPECTED TO BE
ACCEPTED (P_a)

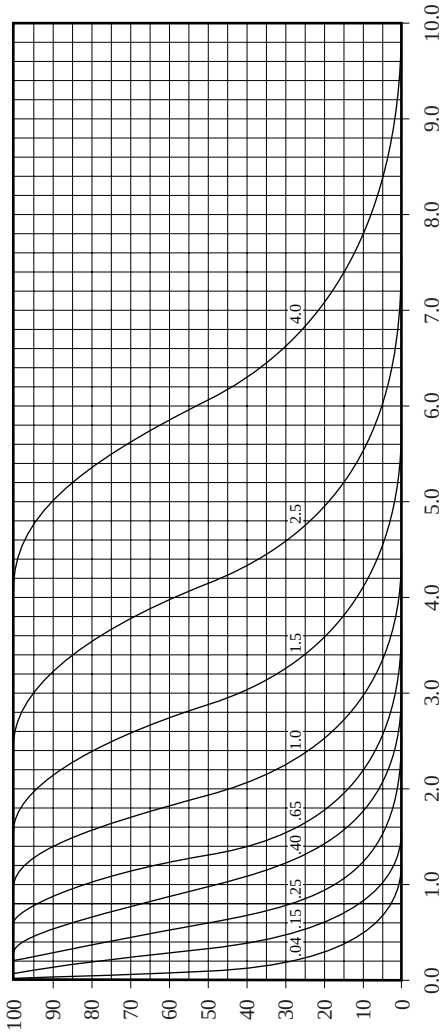


Quality of submitted product (p, in percent nonconforming for AQLs ≤10; in nonconformities per hundred units for AQLs >10)
Note: Figures on curves are Acceptance Quality Limits (AQLs) for normal inspection.

TABLE XV-M-1— TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR ANSI Z1.4 SCHEME PERFORMANCE

P _a	Acceptance Quality Limits (normal inspection)											
	.04	.15	.25	.40	.65	1.0	1.5	2.5	4.0			
	p (in percent nonconforming or nonconformities per hundred units)											
99.0	0.00665	0.0574	0.181	0.300	0.598	0.967	1.57	2.50	4.08			
95.0	0.0228	0.113	0.255	0.425	0.781	1.22	1.92	2.90	4.66			
90.0	0.0364	0.154	0.306	0.508	0.878	1.36	2.11	3.16	4.97			
75.0	0.0711	0.233	0.404	0.655	1.03	1.57	2.41	3.56	5.43			
50.0	0.143	0.349	0.562	0.876	1.23	1.86	2.81	4.08	6.02			
25.0	0.278	0.539	0.856	1.25	1.63	2.36	3.43	4.83	6.90			
10.0	0.460	0.778	1.23	1.69	2.12	2.94	4.13	5.64	7.86			
5.0	0.599	0.949	1.51	2.00	2.46	3.34	4.58	6.17	8.47			
1.0	0.922	1.33	2.11	2.67	3.19	4.16	5.53	7.25	9.71			

Scheme Performance with Switching Rules
Chart XV-N Operating Characteristic Curves for ANSI Z1.4 Scheme Performance
 (Curves for double and multiple sampling are matched as closely as practicable)

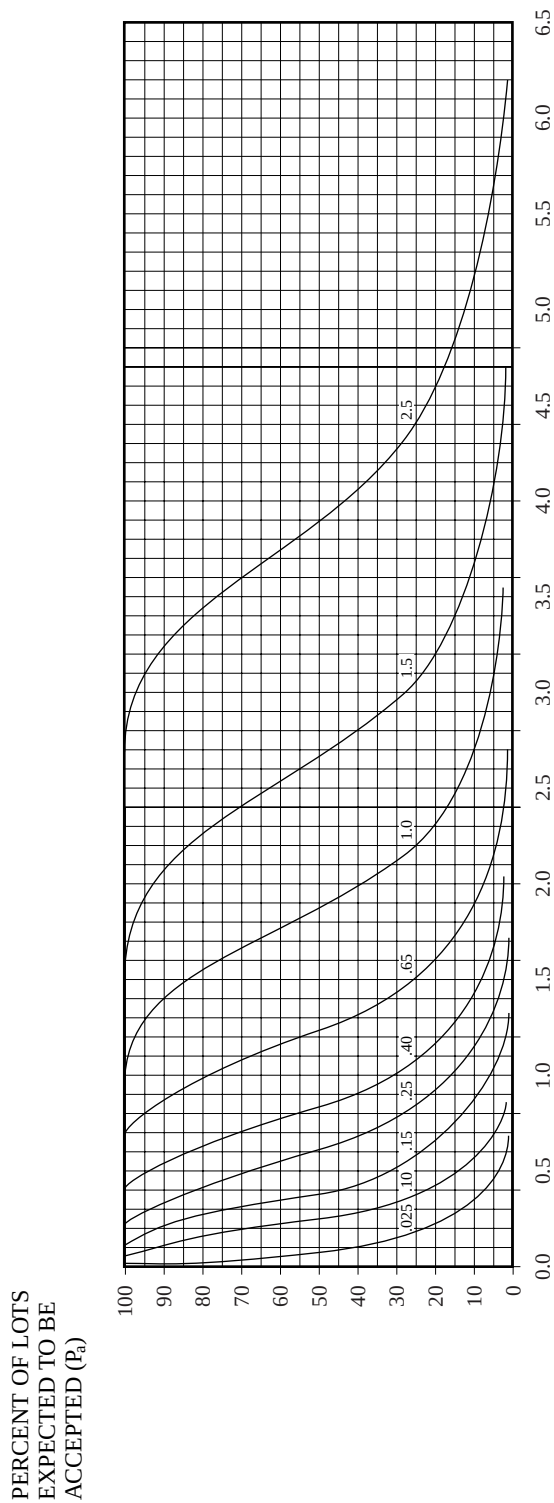


Note: Figures on curves are Acceptance Quality Limits (AQLs) for normal inspection.

TABLE XV-N-1—TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR ANSI Z1.4 SCHEME PERFORMANCE

P_a	Acceptance Quality Limits (normal inspection)											
	.025	.10	.15	.25	.40	.65	1.0	1.5	2.5			
	p (in percent nonconforming or nonconformities per hundred units)											
99.0	0.00416	0.0383	0.108	0.184	0.377	0.613	1.00	1.54	2.56			
95.0	0.0143	0.0729	0.157	0.266	0.492	0.769	1.21	1.83	2.94			
90.0	0.0229	0.0979	0.192	0.320	0.553	0.857	1.33	1.99	3.13			
75.0	0.0446	0.146	0.255	0.413	0.647	0.990	1.52	2.24	3.42			
50.0	0.0898	0.218	0.354	0.552	0.778	1.17	1.77	2.57	3.79			
25.0	0.174	0.337	0.539	0.785	1.02	1.49	2.16	3.04	4.35			
10.0	0.288	0.486	0.778	1.06	1.34	1.85	2.60	3.56	4.95			
5.0	0.374	0.593	0.949	1.26	1.55	2.10	2.89	3.89	5.34			
1.0	0.576	0.830	1.33	1.68	2.01	2.62	3.48	4.57	6.12			

Scheme Performance with Switching Rules
Chart XV-P Operating Characteristic Curves for ANSI Z1.4 Scheme Performance
(Curves for double and multiple sampling are matched as closely as practicable)

PERCENT OF LOTS
EXPECTED TO BE
ACCEPTED (P_a)

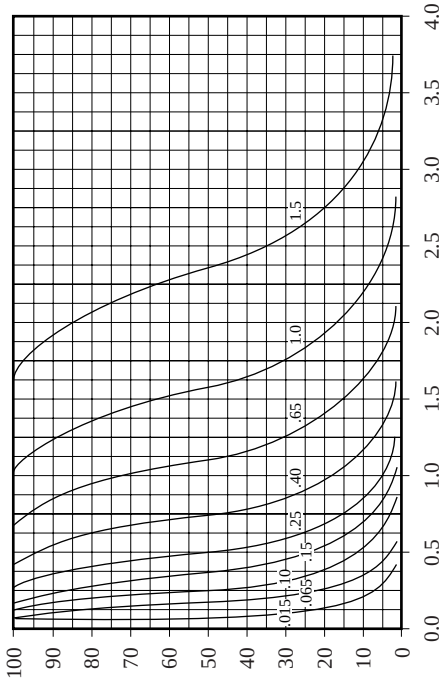


Quality of submitted product (p, in percent nonconforming for AQLs ≤10; in nonconformities per hundred units for AQLs >10)
Note: Figures on curves are Acceptance Quality Limits (AQLs) for normal inspection.

TABLE XV-P-1— TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR ANSI Z1.4 SCHEME PERFORMANCE

P _a	Acceptance Quality Limits (normal inspection)										
	.015	.065	.10	.15	.25	.40	.65	1.0	1.5		
	p (in percent nonconforming or nonconformities per hundred units)										
99.0	0.00263	0.0240	0.0713	0.116	0.236	0.381	0.636	0.989	1.59		
95.0	0.00901	0.0457	0.101	0.166	0.308	0.480	0.757	1.14	1.84		
90.0	0.0144	0.0616	0.121	0.200	0.346	0.535	0.832	1.24	1.96		
75.0	0.0283	0.0928	0.159	0.258	0.404	0.619	0.950	1.40	2.14		
50.0	0.0573	0.139	0.221	0.345	0.486	0.734	1.11	1.61	2.37		
25.0	0.111	0.216	0.337	0.490	0.640	0.929	1.35	1.90	2.72		
10.0	0.184	0.311	0.486	0.665	0.835	1.16	1.62	2.22	3.09		
5.0	0.240	0.379	0.593	0.787	0.969	1.31	1.80	2.43	3.34		
1.0	0.369	0.531	0.830	1.05	1.26	1.64	2.18	2.85	3.82		

Scheme Performance with Switching Rules
Chart XV-Q Operating Characteristic Curves for ANSI Z1.4 Scheme Performance
 (Curves for double and multiple sampling are matched as closely as practicable)

PERCENT OF LOTS
 EXPECTED TO BE
 ACCEPTED (P_a)

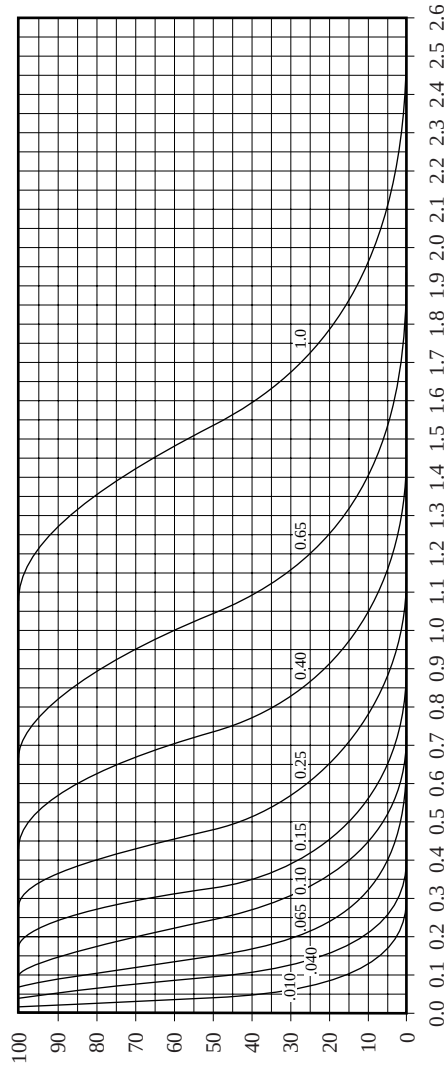


Quality of submitted product (p , in percent nonconforming for AQLs ≤ 10 ; in nonconformities per hundred units for AQLs > 10)
 Note: Figures on curves are Acceptance Quality Limits (AQLs) for normal inspection.

TABLE XV-Q-1— TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR ANSI Z1.4 SCHEME PERFORMANCE

P_a	Acceptance Quality Limits (normal inspection)											
	.01	.04	.065	.10	.15	.25	.40	.65	1.0			
	p (in percent nonconforming or nonconformities per hundred units)											
99.0	0.00167	0.0153	0.0455	0.0738	0.149	0.243	0.401	0.634	1.03			
95.0	0.00573	0.0292	0.0643	0.106	0.197	0.307	0.484	0.732	1.17			
90.0	0.00915	0.0392	0.0771	0.128	0.221	0.343	0.533	0.796	1.25			
75.0	0.0178	0.0586	0.102	0.165	0.259	0.396	0.608	0.896	1.37			
50.0	0.0358	0.0873	0.142	0.221	0.311	0.470	0.708	1.03	1.52			
25.0	0.0694	0.135	0.216	0.314	0.410	0.594	0.865	1.22	1.74			
10.0	0.115	0.194	0.311	0.426	0.534	0.742	1.04	1.42	1.98			
5.0	0.150	0.237	0.379	0.504	0.620	0.841	1.15	1.56	2.14			
1.0	0.231	0.332	0.531	0.673	0.804	1.05	1.39	1.83	2.45			

Scheme Performance with Switching Rules
Chart XV-R Operating Characteristic Curves for ANSI Z1.4 Scheme Performance
(Curves for double and multiple sampling are matched as closely as practicable)

PERCENT OF LOTS
EXPECTED TO BE
ACCEPTED (P_a)

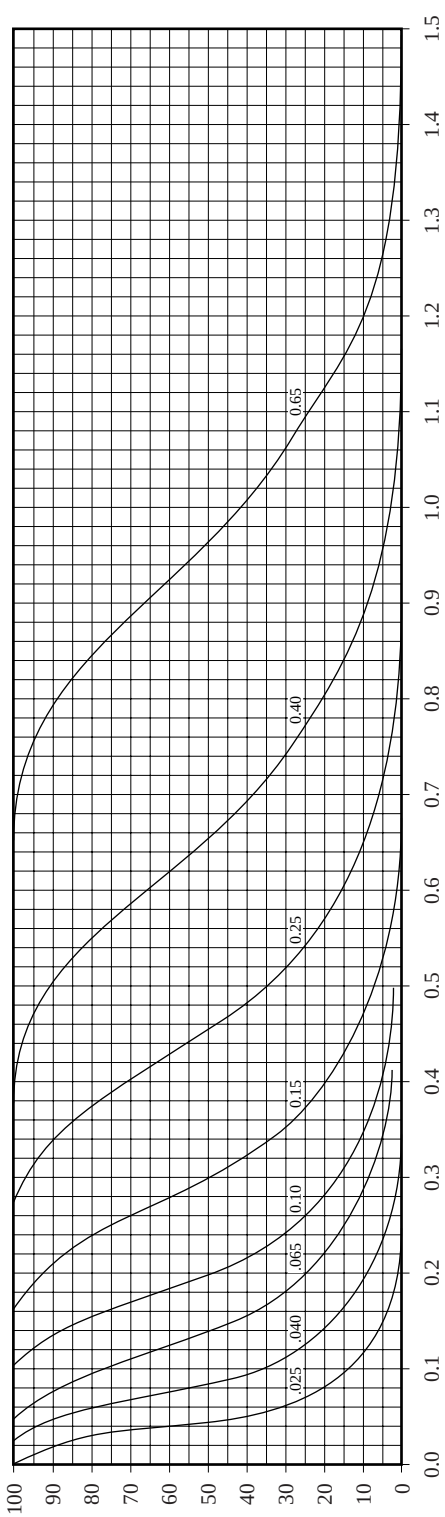

Quality of submitted product (p , in percent nonconforming for AQLs ≤ 10 ; in nonconformities per hundred units for AQLs > 10)
Note: Figures on curves are Acceptance Quality Limits (AQLs) for normal inspection.

TABLE XV-R-1—TABULATED VALUES FOR OPERATING CHARACTERISTIC CURVES FOR ANSI Z1.4 SCHEME PERFORMANCE

P_a	Acceptance Quality Limits (normal inspection)												
	.025	.040	.065	.10	.15	.25	.40	.65					
	p (in percent nonconforming or nonconformities per hundred units)												
99.0	0.00957	0.0284	0.0473	0.0941	0.150	0.250	0.395	0.649					
95.0	0.0183	0.0402	0.0669	0.123	0.192	0.302	0.457	0.734					
90.0	0.0246	0.0482	0.0800	0.138	0.214	0.333	0.497	0.783					
75.0	0.0369	0.0637	0.103	0.162	0.248	0.380	0.560	0.855					
50.0	0.0554	0.0885	0.138	0.195	0.294	0.443	0.642	0.948					
25.0	0.0856	0.135	0.196	0.256	0.372	0.540	0.761	1.09					
10.0	0.123	0.194	0.266	0.334	0.464	0.650	0.889	1.24					
5.0	0.151	0.237	0.315	0.388	0.526	0.722	0.972	1.33					
1.0	0.211	0.332	0.420	0.502	0.656	0.871	1.14	1.53					

INDEX OF TERMS WITH SPECIAL MEANINGS

Term	Paragraph
Acceptance Quality Limit (AQL)	4.2 and 11.1
Acceptance number	9.4 and 10.1.1
Attributes	1.4
Average Outgoing Quality (AOQ)	11.3
Average Outgoing Quality Limit (AOQL).	11.4
Average sample size	11.5
Batch	5.1
Code letters	9.3
Defect	2.0
Double sampling plan.	10.1.2
Inspection.	1.3
Inspection by attributes.	1.4
Inspection level	9.2
Inspection lot or inspection batch	5.1
Isolated lot	11.6
Limit number	8.3.3 and 8.5
Limiting Quality (LQ)	11.6
Lot	5.1
Lot or batch size.	5.3
Multiple sampling plan.	10.1.3
Nonconformity	2.0
Nonconformities per hundred units.	3.3
Normal inspection	8.1 and 8.2
Operating characteristic curve	11.1
Original inspection.	11.2
Percent nonconforming.	3.2
Preferred AQLs	4.6
Process average	11.2
Reduced inspection	8.2, 8.3.3, 8.3.4, 8.5, and 10.1.4
Rejection number.	10.1.1
Responsible authority.	1.1
Resubmitted lots or batches	6.4
Sample	7.1
Sample size	7.1
Sample size code letter.	4.1 and 9.3
Sampling plan	9.5
Scheme Performance	11.1
Single sampling plan	10.1.1
Small-sample inspection.	9.2
Switching procedures	8.3
Tightened inspection	8.2, 8.3.1, and 8.3.2
Unit of product.	1.5

(This page intentionally left blank)



Quality Press
600 N. Plankinton Avenue
Milwaukee, Wisconsin 53203
Call toll free 800-248-1946
Fax 414-272-1734
www.asq.org
<http://qualitypress.asq.org>
<http://standardsgroup.asq.org>
E-mail: authors@asq.org

T004

Printed in the United States of America